



INFP

INFINITY® Process Panel Meter DC Current, Voltage, Potentiometer

Operator's Manual







Additional products from

NEWPORT Electronics, Inc.

Counters Frequency Meters PID Controllers Clock/Timers **Printers Process Meters** On/Off Controllers Recorders Relative Humidity **Transmitters** Thermocouples **Thermistors** Wire

Rate Meters Timers **Totalizers** Strain Gauge Meters Voltmeters **Multimeters** Soldering Iron **Testers** pH pens pH Controllers pH Electrodes **RTDs Thermowells** Flow Sensors

For Immediate Assistance In the U.S.A. and Canada: 1-800-NEWPORT® In Mexico: (95) 800-NEWPORTSM Or call your local NEWPORT Office.

NEWPORTnet[™] On-Line Service http://www.newportUS.com

Internet e-mail info@newportUS.com

It is the policy of NEWPORT to comply with all worldwide safety and EMC/EMI regulations that apply. NEWPORT is constantly pursuing certification of its products to the European New Approach Directives. NEWPORT will add the CE mark to every appropriate device upon certification.

The information contained in this document is believed to be correct but NEWPORT Electronics, Inc. accepts no liability for any errors it contains, and reserves the right to alter specifications without notice.

WARNING: These products are not designed for use in, and should not be used for, patient connected applications.

PATENT NOTICE: The "Meter Case Bezel Design" is a trademark of NEWPORT Electronics, Inc., registered in the U.S. PATENT NOTICE: This product is covered by one or more of the following patents: U.S. Pat. No. Des. 336,895; 5,274,577 / Canada 2052599; 2052600 / Italy 1249456; 1250938 / France Brevet No. 91 12756 / Spain 2039150; 2048066 / UK Patent No. GB2 249 837; GB2 248 954 / Germany DE 41 34398 C2. Other International Patents Pending.



This device is marked with the international hazard symbol. It is important to read the Setup Guide before installing or commissioning this device as it contains important information relating to safety and EMC.

1.1 1.2 1.3	INTRODUCTION Description Features Available Models	1
SECTION 2	UNPACKING	4
SECTION 3 3.1	SAFETY CONSIDERATIONS Safety Considerations	6
SECTION 4 4.1 4.2	PARTS OF THE METER Front of the Meter Rear of the Meter	
5.1 5.2 5.2.1 5.2.2 5.2.3 5.2.3 5.2.4 5.2.5	SETUP Conditions Requiring Disassembly Assembly/Disassembly Opening Safety Precaution/Product ID Label Main Board Power Jumpers Printed Circuit Board(s) Installation How to Access Jumpers Panel-Mount Assembly	13 16 17 18
6.1 6.2 6.3 6.4	JUMPER POSITIONS Introduction	26 26
7.1 7.2 7.3	SIGNAL AND POWER INPUT CONNECTIONS Introduction	30
SECTION 8 8.1	METHODS FOR SCALING THE METER TO DISPLAY IN ENGINEERING UNITS Introduction	
8.2 8.3	Setup Meter Input Type and Range	34 et
8.3.1 8.3.2	Setting Input Configuration ("IN CNF")	37

SECTION 8	METHODS FOR SCALING THE METER TO DISPLAY IN ENGINEERING UNITS	I
8.4	Scaling your meter without connection a sensor	
	using calculated values	44
8.4.1	Preparing your meter for scaling with Input Scale and Offs	et.44
8.4.2	Scaling your meter	47
8.4.3	To select Decimal Point Position	
8.4.4	Entering Zero Offset Numbers	53
SECTION 9	EXPLANATION OF LOCKOUT CONFIGURATIONS AND FUNCTION MENUS	METER
9.1	Individual Lockout Information	56
9.2	Meter Function Menus	
9.2.1	Input	
9.2.2	RDG.CNF (Reading Configuration)	62
9.2.3	RDG SC (Reading Scale) And RDG OF (Reading Offset)	64
9.2.4	IN CNF (Input Configuration)	66
9.2.5	IN.SC.OF (Input Scale and Offset)	
9.2.6	DEC PT (Decimal Point)	69
9.2.7	CNT BY (Count By)	70
9.2.8	FIL.CNF (Filter Configuration)	71
9.2.9	FIL TI (Filter Time Constant)	72
9.2.10	SP CNF (Setpoints 1 & 2 Configuration)	73
9.2.11	AL CNF (Alarm Configuration)	74
9.2.12	AL FNC (Alarm Function)	76
9.2.13	AL RDG (Alarm Readings)	77
9.2.14	SP DB (Setpoint Deadband)	78
9.2.15	AL DB (Alarm Deadband)	78
9.2.16	OUT.CNF (Output Configuration)	79
9.2.17	OT.SC.OF (Output Scale and Offset)	80
9.2.18	BAUD (Baud Rate)	81
9.2.19	SERCNF (Serial Communication Configuration)	
9.2.20	ADDRESS (Multipoint Communications Device Address)	83
9.2.21	DAT FT (Data Format)	83
9.2.22	BUS FT (Bus Format)	
9.2.23	SERCNT (Serial Count)	
9 2 24	Analog Output Calibration Numbers	87

SECTION 10	SETPOINTS/ALARMS	
10.1 10.2 10.3 10.4 10.5 10.6 10.7 10.8	Features overview	90 91 92 94
10.9	and "SP 2" Deadband (HYSTERESIS)" "AL DB": Select Alarm 1 ("SP 3")	
10.10 10.11	and Alarm 2 ("SP 4") Deadband (HYSTERESIS)	96
SECTION 11	PEAK AND VALLEY READINGS	97
12.1 12.2 12.3 12.4 12.5 12.6 12.7	ANALOG OUTPUT OPTION Features Overview	99 99 99 100 102
3.1 13.1 13.2 13.3 13.4 13.5 13.6 13.7 13.8 13.9 13.10 13.11 13.12 13.13 13.14	BCD OPTION Features Overview BCD Card Jumper Table Interconnect Board 50-Line Cable Compatibility Selection the source of BCD Data: "OUT.CNF" Hold Control Data Ready Timing Pulses Bringing out the BCD Overflow line 3 Digit at a time Multiplex 6 Digit at a time Card Address Select Data Polarity: Jumper S8 Decimal Point Address Code Applying Non-Isolated/Isolated Power Driving a Printer	105 106 106 106 106 106 106 107 108 108
SECTION 14 14.1 14.2	RELAY OPTIONS Features Overview	109

SECTION 15	RS-232 OR RS-485 OPTION BOARD	
15.1	Features Overview	112
15.2	Front-Panel Pushbutton Configuration	114
15.3	Instructions for using the setup program	115
15.4	Screen Error Messages	117
15.5	Serial Communication Sample Program	118
15.5.1	Program Objectives	
15.5.2	Code and [Notes]	
SECTION 16	EXTERNAL CONTROL LINES	
16.1	TARE (PIN 1)	120
16.2	PEAK (PIN 2)	
16.3	VALLEY (PIN 3)	
16.4	SWLIN2 (PIN 4)	
16.5	PEAK & VALLEY or EXTERNAL RESET (PIN 5)	121
16.6	PUSH TO CAL (PIN 6)	
16.7	Digital Return (PIN 7)	
16.8	+5 V (PIN 8)	
16.9	Display Hold (PIN 9)	
16.10	LOCKOUT EEPROM (and 'MENU' BUTTON) (PIN 10)	121
16.11	Print Command and/or Reset of Alarms (PIN 11)	
16.12	Nonstandard RX (PIN 12) and Nonstandard TX (PIN 13) .	
16.13	PUSH TO CAL (PIN 14)	122
16.14	+V EXT (PIN 15)	
16.15	SP1 (PIN 16)	
16.16	SP2 (PIN 17)	
16.17	AL1 (PIN 18)	
16.18	AL2 (PIN 19)	
16.19	RTN EXT (PIN 20)	122
17.1	DISPLAY MESSAGES AND TROUBLESHOOTING GUIL Error Mode Message	
17.1.1	Flashing "999999" (Numerical Overflow)	123
17.1.2	Flashing "ERR O1" (Offset Overflow)	123
17.1.3	Flashing "ERR O2" (Setpoint Overflow)	123
17.1.4	"NOSTŎR" & "STORED"	
	(Programming Entries In EEPROM)	123
17.1.5	Flashing "+OVLD" (Positive Input Overload)	123
17.1.6	Flashing "+OPEN" (Open Sensor Indication)	123
17.1.7	Flashing "-OPEN" (Open Sensor Indication)	124
17.1.8	Flashing "I OVSC" (Input Overscale)	124
17.1.9	Flashing "R OVSC" (Reading Overscale)	124
17.1.10	Flashing "CB OVF" (Count By Overflow)	124
17.1.11	Flashing "UOM.OVF" (Unit Of Measure Overflow)	124
17.2	Troubleshooting Guide	124

SECTION 18	SPECIFICATIONS	
	Current Input	.127
18.2	Voltage Input	.127
18.3	Potentiometer Input	.127
18.4	General	.127
SECTION 19	FACTORY PRESET VALUES	.132
SECTION 20	RECORD YOUR SETUP VALUES	.135

Figures

Figure 4-1	Front Detail	7
Figure 4-2A	AC Power - Connector Label for Rear Connectors	10
Figure 4-2B	DC Power - Connector Label for Rear Connectors	11
Figure 4-3	Rear of the meter with the optional 4-relay output board and a serial communications board installed	12
Figure 4-4	Rear of the meter with the optional BCD output board and a serial communications output board installed	12
Figure 5-1	Meter Exploded View	14
Figure 5-2	Board Assembly Removing/Installing Detail	15
Figure 5-3	Transformer Jumpers	17
Figure 5-4	Optional Printed Circuit Board Locations	18
Figure 5-5	Signal Input Board	19
Figure 5-6	Main Board	20
Figure 5-7	BCD Option Board	20
Figure 5-8	Relay Option Board	21
Figure 5-9	4-Relay Option Board	21
Figure 5-10	Analog Output Option Board	22
Figure 5-11	RS-232 Option Board	22
Figure 5-12	RS-485 Option Board	22
Figure 5-13	Panel Mounting Assembly	24
Figure 6-1	S1 and S2 Jumper Locations on Signal Input Board	28
Figure 6-2	Main Board Jumper Positions S3 and S4	28
Figure 7-1	Current Input Without Sensor Excitation	30
Figure 7-2	Current Input With Sensor Excitation	30
Figure 7-3	Voltage Input Without Sensor Excitation	31
Figure 7-4	3-Wire Voltage Input With Sensor Excitation	31
Figure 7-5	4-Wire Voltage Input With Sensor Excitation	31
Figure 7-6	Potentiometer Connections with Internal Power Supply and Ratio Measurement.	32
Figure 7-7	Potentiometer Connections With External Power Supply and Ratio Measurement (Remove jumper S2-T)	32
Figure 7-8	AC Connector Wiring at P1	33

Figures

Figure 8-1	Factory Calculated Scale Factors	47
Figure 10-1	Setpoints 1 & 2 Action	89
Figure 10-2	Setpoints 3 & 4 Action	89
Figure 10-3	Process Deviation	91
Figure 10-4	High Deviation for both Active Above and Active Below.	91
Figure 10-5	Low Deviation for both Active Above and Active Below	92
Figure 10-6	Band Deviation for both Active Above and Active Below	92
Figure 10-7	AL CNF Hysteresis	93
Figure 12-1	Analog Option Board and Connection Diagram at P5	100
Figure 12-2	Isolated Analog Output Board Wiring Connections	102
Figure 13-1	BCD 40-Pin Cable Connector (P8)	103
Figure 13-2	BCD Option Board	104
Figure 13-3	Address Programming Chart for 4 -line Address	107
Figure 14-1	Dual Relay	109
Figure 14-2	Relay Board Jumpers and Plugs	110
Figure 14-3	Dual Relay Output Board Wiring Connections	111
Figure 14-4	Relay Output Board Wiring Connections	111
Figure 15-1	RS-232 Option Board and Pin Designations	113
Figure 15-2	RS-485 Option Board and Pin Designations	113
Figure 16-1	Connector Label Detail	120
Figure 16-2	Connection of External Power for Setpoint Transistors	122
Figure 18-1	Meter Housing and Panel Cutout.	130



Notes, Warnings, and Cautions

Information that is especially important to note is identified by these labels:

- NOTE
- WARNING
- CAUTION
- IMPORTANT



NOTE: provides you with information that is important to successfully setup and use the Programmable Digital Meter.



CAUTION or WARNING: tells you about the risk of electric shock.



CAUTION, WARNING or IMPORTANT: tells you of circumstances or practices that can effect the meter's functionality and must refer to accompanying documents.

1.1 DESCRIPTION

This Process meter is part of a complete line of process indicators/controllers, offering exceptional performance.

The process meter is front panel programmable to accept 0-20 and 4-20 mAdc current inputs, unipolar and bipolar DC voltage inputs and potentiometer inputs. The meter will accept inputs from most of the process sensors in use today such as transmitters, pressure transducers, and potentiometers.

Configuring the meter is accomplished through the 5 front panel buttons. If the RS-232 or RS-485 communication option is installed, the user may remotely set the display parameters.

Options for the meter include analog and BCD outputs, relay outputs, and RS-232 or RS-485 communications.

1.2 FEATURES

The following is a list of features of the meter.

- · 6-digit LED display in red or green
- · 0.005% accuracy of reading
- 12 DC input ranges: 0-100 mV, 0-1 V, 0-5 V, 1-5 V, 0-10 V, 0-100 V, ±50 mV, ±500 mV, ±5 V, ±50 V, 0-20 mA, or 4-20 mA
- 10 or 24 V dc sensor excitation
- Peak & Valley detection and memory
- External Tare
- Up to 13 readings per second
- 4 isolated open collector outputs(standard) and optional isolated relay or isolated BCD and isolated analog outputs
- Optional isolated RS-232 or RS-485 communications
- NEMA 4 Front Panel/IP65
- Non-volatile memory without battery back-up
- 115 Vac, 50/60 Hz, 230 Vac, 50/60 Hz power supply

1.3 AVAILABLE MODELS

The following models and options are available. Optional boards are either installed at the time of purchase, or available as separate items and installed by the user after purchase.

MAIN ASSEMBLIES

MODEL NUMBER	DESCRIPTION
INFP0	Red LEDs, 115 V ac, 50/60Hz
INFP1	Red LEDs, 230 V ac, 50/60Hz
INFP2	Green LED's, 115 V ac, 50/60 Hz
INFP3	Green LED's, 230 V ac, 50/60Hz



NOTE: The following options are available installed at the time of purchase or as separate items installed by the user after purchase:

Analog Output Board, BCD Output Board, Relay Output Board, RS-232 Communications Board, and RS-485 Communications Board.

CONTROL/BCD OUTPUT OPTIONS

MODEL NUMBER	DESCRIPTION
"0"	Standard four open-collector outputs are standard
"1" (BCD1)	Isolated BCD Output Board
"2" (REL1)	Dual 7A Form-C Relays
"4" (REL4)	Dual 7A & Dual 1A Form-C Relays



NOTE: Choose only one Control/BCD output option per meter. A 40-pin mating connector is included with the BCD option.

ANALOG OUTPUT

MODEL NUMBER	DESCRIPTION
"0"	None
"1" (ANO2)	Isolated configurable analog (4-20 mA, 0-1, 0-5, 1-5, 0-10 V dc, 0-20 mA) output

SERIAL COMMUNICATIONS OPTION

MODEL NUMBER	DESCRIPTION
"1" (RS20)*	Isolated RS-232 Communications
"2" (RS40)**	Isolated RS-485 Communications



NOTES: Choose only one option per meter. Both computer communications come with 3.5" setup/programming disk and one 6 ft. communications cable with phone plug termination.

- * Recommend purchase of 9SC2 or 25SC2 (see OPTIONS below)
- ** Recommend purchase of 9SC4 or 25SC4 (see OPTIONS below)

OPTIONS

MODEL NUMBER	DESCRIPTION
FS	Custom Calibration/configuration
H5	50 Hz line frequency (Requires"FS")
H6	60 Hz line frequency (Requires"FS")
BL	Blank lens
9SC2	9-pin Serial Connector for RS-232
9SC4	9-pin Serial Connector for RS-485
25SC2	25-pin Serial Connector for RS-232
25SC4	25-pin Serial Connector for RS-485
SB03	Setup & configurations diskettes
RP18	19" Rack panel for one (1) meter
RP28	19" Rack panel for two (2) meters
RP38	19" Rack panel for three (3) meters
SPC4	1/8 DIN NEMA 4 heavy duty cover with thumb screws
SPC18	1/8 DIN NEMA 4 Splash Proof lens cover
TP1	Trimplate adapter

[']Unpacking

Unpack all items and make sure that every item on the packing list is present. The items you should receive are listed below. If something is missing, use the phone number for the Customer Service Department nearest you.

Also, inspect the shipping container and enclosed equipment for any signs of damage. Take particular note of any evidence of rough handling in transit. Immediately report any damage to the shipping agent.




NOTE: The shipping agent will not honor any claims unless all shipping material is saved for their examination. After examining and removing contents, save all packing material and containers in the event that reshipment is required.


When you ordered your process meter, you will receive the following items in the shipping box:

QTY	DESCRIPTION	<u>ILLUSTRATION</u>
1	Basic Meter in a Mounting Sleeve with Gasket	
1	Front-Panel Button Cover	
	AC Power Connector (orange - P1)	P1
2	Input Connectors (gray - P3 and P9)	1 D 2 D 3 D


1 Rear Protective Cover with Screw

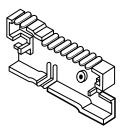

1 20-Socket Ribbon Connector (P2 Connector)




2 Panel-MountingGaskets (1 Spare)



1 Process Owner's Guide



1 Quick Start Manual



Other items may also be in the box depending on the options ordered. Refer to specific options described previously.

Safety Considerations

3.1 SAFETY CONSIDERATIONS



This device is marked with the international caution symbol. It is important to read this manual before installing or commissioning this device as it contains important information relating to Safety and EMC (Electromagnetic Compatibility).

Unpacking & Inspection



Unpack the instrument and inspect for obvious shipping damage. Do not Note attempt to operate the unit if damage is found.

This instrument is a panel mount device protected in accordance with Class I of EN 61010 (115/230 AC power connections). Installation of this instrument should be done by Qualified personnel. In order to ensure safe operation, the following instructions should be followed.

This instrument has no power-on switch. An external switch or circuit-breaker shall be included in the building installation as a disconnecting device. It shall be marked to indicate this function, and it shall be in close proximity to the equipment within easy reach of the operator. The switch or circuit-breaker shall not interrupt the Protective Conductor (Earth wire), and it shall meet the relevant requirements of IEC 947-1 and IEC 947-3 (International Electrotechnical Commission). The switch shall not be incorporated in the mains supply cord.

Furthermore, to provide protection against excessive energy being drawn from the mains supply in case of a fault in the equipment, an overcurrent protection device shall be installed.



The Protective Conductor must be connected for safety reasons. Check that the power cable has the proper Earth wire, and it is properly connected. It is not safe to operate this unit without the Protective Conductor Terminal connected. Conductor Terminal connected.



- Do not exceed voltage rating on the label located on the top of the instrument housing.
- Always disconnect power before changing signal and power connections.
- Do not use this instrument on a work bench without its case for safety reasons.
- Do not operate this instrument in flammable or explosive atmospheres.
- Do not expose this instrument to rain or moisture.
- Unit mounting should allow for adequate ventilation to ensure instrument does not exceed operating temperature rating.
- Use electrical wires with adequate size to handle mechanical strain and power requirements. Install without exposing bare wire outside the connector to minimize electrical shock hazards.

EMC Considerations

- Whenever EMC is an issue, always use shielded cables.
- Never run signal and power wires in the same conduit.
- Use signal wire connections with twisted-pair cables.
- Install Ferrite Bead(s) on signal wires close to the instrument if EMC problems persist.

4.1 FRONT OF THE METER

The following is a brief description of each part of the front of the meter.

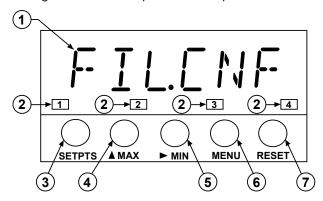


Figure 4-1. Front Detail

ITEM DESCRIPTION

1 –.8.8.8.8.8. or 8.8.8.8.8.

6-digit, 14 segment, alphanumeric 0.54" high LED display with programmable decimal point.

2 SETPOINT LED

These LEDs, labeled 1 through 4, display the status of setpoints 1, 2, 3 (Alarm 1), and 4 (Alarm 2).

3 SETPTS BUTTON

This button functions only in the run mode. When the Setpoint/Alarm features are unlocked, pressing this button sequentially recalls the previous setpoint settings to the display. After the 'MIN' and 'MAX' buttons are used to alter those values as desired, pressing the 'SETPTS' button, again, stores these new values.

Unless the 'SETPTS' button is pressed, each of the four setpoint values is displayed for approximately 10 seconds after the last press of the 'SETPTS' button. Holding the 'SETPTS' button depressed stalls this automatic sequence, retaining the most recent setpoint number on the display.

Parts of the Meter

ITEM	DESCRIPTION	
4	▲ /MAX BUTTON	
	During run mode, pressing this button displays the "HI RDG" (peak reading) value that has occurred up to the moment the 'MAX' button is pressed. This peak reading flashes, to distinguish its value from the current readings. Since this is a dynamic peak reading, the value will change if the value increases while reviewing it.	
	To return to display of the current readings without resetting the peak-value memory to zero (0), press the 'MAX' button once again.	
To reset the peak-value memory (period), press the 'RESET' button	To reset the peak-value memory (start a new peak determining period), press the 'RESET' button once.	
	During the configuration mode, the 'MAX' button is used to change the numerical value of the flashing digit displayed. For submenu items, such as "L1C.1=0", pressing the 'MAX' button toggles the choice from "0" to "1".	
	The meter allows rapid changes of a displayed numerical value by making "0" the first value to occur when the 'MAX' button is pressed. After that, the numbers increase to "9" and then roll over to "0" again. A negative ("-") symbol may be displayed in the most significant digit (i.e. the digit at the far left such as shown here "8.8.8.8.8.")	
	In the SETPT (SETPOINT) mode (SP1, SP2, etc), pressing the ' MAX ' button causes the flashing digit to increment by 1 from 0 to 9.	
5	►/MIN BUTTON	
	During run mode, pressing the 'MIN' button recalls the "LO RDG" (valley reading) measured since the last press of the 'RESET' button. This lowest value flashes, to distinguish it from the current process display. Since this is a dynamic valley reading, the value will change if the value decreases while reviewing it.	

ITEM DESCRIPTION

To return to the actual process display, without resetting the low-value memory, press the 'MIN' button once again.

To reset the memory for current-value readings (start a new observation period), press the 'RESET' button once and the meter will return to the run mode.

In the configuration mode, once in a submenu (like input type) the 'MIN' button allows you scroll through the available choices such as, 0-20 mA or 4-20 mA, etc.

In the **SETPT** mode, the **'MIN'** button advances the flashing digit to the right.

6 MENU BUTTON

In the run mode, this button terminates the measurement process and allows you to enter the configuration mode, advancing through the configuration menus.

In the configuration mode, this button will store changes in the non-volatile memory at the same time advancing the display to the next menu item.

7 RESET BUTTON

In the run mode, pressing the **'RESET'** button once erases the memories of peak ("HI RDG"), valley ("LO RDG"), and ALARM latches. The display then returns to the run mode.



WARNING: Pressing the '**RESET**' button two (2) times will result in a hard reset of the meter. This will clear the Peak & Valley, Alarm latches and meter reading and immediately begin a new measurement.

In the configuration mode, pressing the 'RESET' button once, displays the previous selection. For example, if you were in "IN CNF" then pressed the 'RESET' button once, the display will then show "RD.SC.OF". Press the 'RESET' button two times to return to the run mode.

Parts of the Meter

4.2 REAR OF THE METER

The following is a brief description of each part of the rear of the meter. The label on the top of the mounting sleeve (not the case) identifies the location of the connectors found at the rear of the meter. Figure 4-2A & figure 4-2B shows this label.

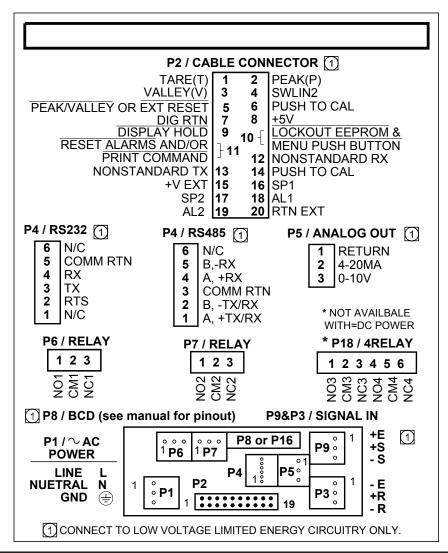


Figure 4-2A. AC Power - Connector Label for Rear Connectors

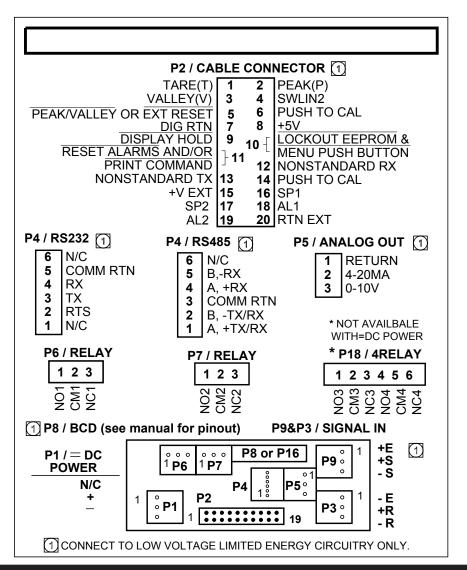


Figure 4-2B. DC Power - Connector Label for Rear Connectors

Parts of the Meter

Figure 4-3 shows the rear of the meter with the optional 4-relay output board and a serial communications board installed.

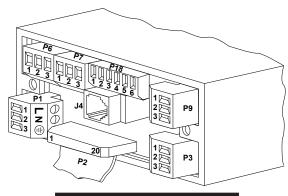


Figure 4-3. Rear View

Figure 4-4 shows the rear of the meter with the optional BCD output board and a serial communications output board installed.

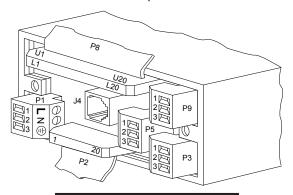


Figure 4-4. Rear View

CONNECTOR #	DESCRIPTION
P1	AC Power Connector
P2	External I/O Connector
P3	Input Connector, –E, +R, –R
J4	Optional RS-232 or RS-485 Phone Jack Connector
P5	Optional Analog Out Connector
P6	Optional Form-C Relay #1 Connector
P7	Optional Form-C Relay #2 Connector
P8	Optional BCD Connector
P9	Input Connector, +E, +S, -S
P18	Optional Form-C Relay #3 and #4 Connector

TABLE 4-1 Rear Connector Descriptions

5.1 CONDITIONS REQUIRING DISASSEMBLY

You may need to remove the sleeve or open the meter for several reasons:

- 1. To inspect the rating label on the case (not the same label as on the sleeve) (Section 5.2.1).
- 2. To check or change the 115 V ac or 230 V ac or main board jumpers (Sections 5.2.2 and 5.2.4).
- 3. To install optional output board(s) (Section 5.2.3).
- 4. To mount the meter in a panel (Section 5.2.5).

5.2 ASSEMBLY/DISASSEMBLY OPENING OPENING THE METER

Your meter is fully assembled, but not wired. See Section 7 for wiring connection for power and sensor inputs. In most cases, if you have ordered optional boards with the meter, these boards will already be installed.

You will need to remove only the rear cover to complete wiring, but you will have to open the meter to do one or more of the following:



WARNING!: You must disconnect and turn-off the power and connector signals before accessing the unit and installing optional boards. Failure to do so may result in injury!

- a. Check or reconfigure the Transformer Jumpers on the Main Board so that they correspond to your line voltage (W1 and W2 for 115 V ac, or W3 for 230 V ac). See Section 5.2.2.
- b. Install optional boards. See Section 5.2.3.
- c. Access jumpers on the Main and optional boards. See Section 5.2.4.

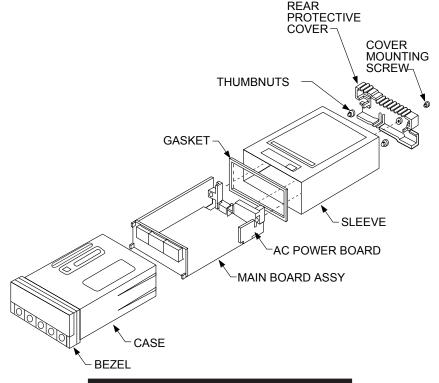


Figure 5-1. Meter Exploded View

Using Figures 5-1 as a guide, follow these simple instructions to open the meter:



IMPORTANT: Turn-off the power and input signals from the unit before proceeding. Failure to do so may result in injury!

- Remove the cover mounting screw that secures the rear protective cover to the meter, and remove the Rear Protective Cover.
 - If you are simply wiring the meter–but not checking jumpers or installing or removing boards–this is as far as the meter needs to be disassembled. Go to Section 5.2.1.
- 2. Remove all wiring connectors from the rear of the meter.
- 3. Remove the two thumbnuts that secure the case to the sleeve.
- 4. Remove the sleeve completely by sliding it back from the front bezel.

Using Figure 5-2 as a guide, bend the side-panel detents on the case outward and pull the board assembly out of the case by the mounting screw stem.

Note 🖘

NOTE: From this point forward, these 5 steps are referred to as "Reveal the main board".

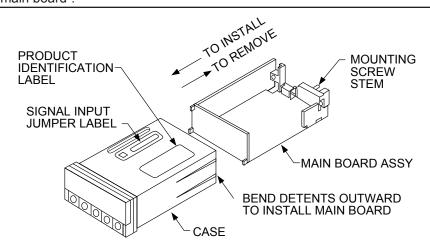


Figure 5-2. Board Assembly Removing/Installing Detail

The meter is now disassembled to the point where you can check and configure jumpers and install boards.

REINSERTING THE MAIN BOARD ASSEMBLY INTO THE CASE

Reinsert the Main Board into the case once jumpers and optional boards have been configured and installed.

Spread the side-panel detents of the case, and carefully slide the main board all the way in.

5 Setup

5.2.1 Safety Precaution/Product ID Label

To look at the Rating/Product ID label on the case, you must follow the first step as described in Section 5-2. Refer to Figure 5-2 for the location of the Product Identification label.

The meter is protected in accordance with Class I of EN61010. Refer to Safety Considerations page.



WARNING: If your meter is to be wired to sensors to control inputs that could be hazardous potentials, these potentials will be carried to the 20-pin output connector (P2) at the rear. They will also be present on the meter's circuit boards. Follow all instructions carefully BEFORE connecting the meter to any source of power.

DO NOT contact any exposed metal parts, install optional board(s), change jumpers, or in any way disassemble or assemble the meter while it is connected to AC voltage.

Note the following information and guidelines for safe operation of your meter:

Power Voltage

Your power source voltage rating should agree with the voltage under which the meter has been configured to operate. The first thing you should do is verify this.

The meter's operating voltage is shown in the VOLTS: entry of the Product Identification and Serial Number Label. It is located on the case, as shown in Figure 5-2, and is clearly visible on the meter packing box.

5.2.2 Main Board Power Jumpers

To check voltage jumpers or to change from 115 V ac to 230 V ac:



CAUTION: The meter has no power-on switch; it will be in operation as soon as you apply power. To change the factory preset jumpers, disconnect the power from the unit. Failure to do so may result in injury! The jumpers must be changed by specifically trained personnel.

- 1. "Reveal the Main Board" (refer to Section 5.2, Disassembly).
- 2. Locate the main board assembly and position it in front of you the same way as shown in Figure 5-3.
- On the main board, locate the transformer jumpers W1, W2, and W3 near the transformer T1.
 If your power requirement is 115 V ac, jumpers W1 and W2 should be installed. (DO NOT INSTALL W3)

If your power requirement is 230 V ac, jumper W3 should be installed. (DO NOT INSTALL W1 OR W2)


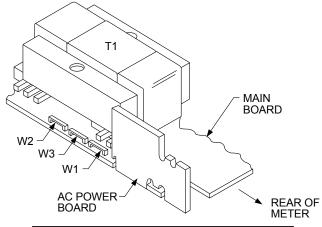


Figure 5-3. Transformer Jumpers

5.2.3 Printed Circuit Board(s) Installation

To install optional printed circuit board(s):

- 1. "Reveal the Main Board" (refer to Section 5.2, Disassembly).
- 2. Using Figure 5-4 as a reference, insert option board(s) into the corresponding slot(s) on the main board. Each circuit board is keyed to fit in it's own position.

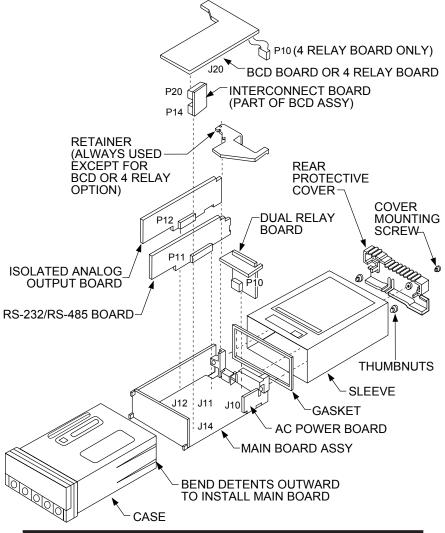

5.2.4 How to Access Jumpers

To gain access to jumper S1 and S2 used to configure input type remove the mounting sleeve. The jumpers may be accessed through the slot in the case.

To gain access to jumpers on the main board for power, excitation and lockout selection:

1. "Reveal the main board" (refer to Section 5.2, Disassembly).



NOTE: To access the S1 and S2 jumpers on the Signal Input Board, you only need to remove the mounting sleeve.

2. To re-assemble the meter, follow the steps in reverse order.

Figures 5-5 through 5-11 show the layout of the seven (7) printed circuit boards with respective jumper blocks, where applicable, used in the meter. Figures 5-7 through 5-11 show the optional boards.

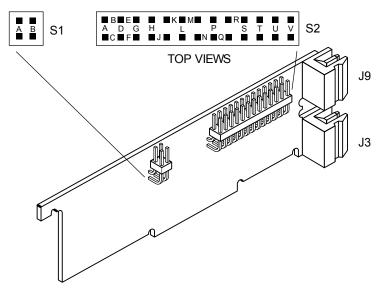


Figure 5-5. Signal Input Board

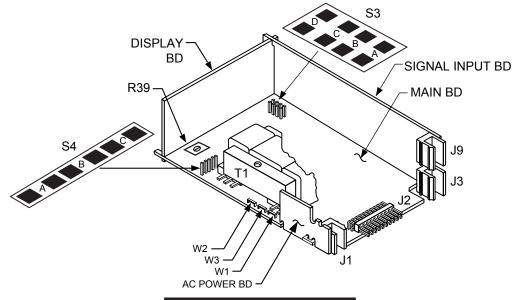


Figure 5-6. Main Board

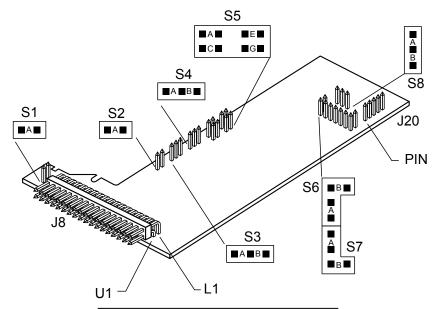


Figure 5-7. BCD Option Board

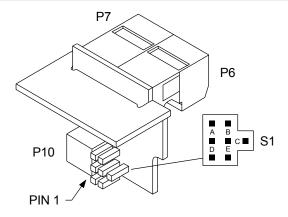


Figure 5-8. Relay Option Board

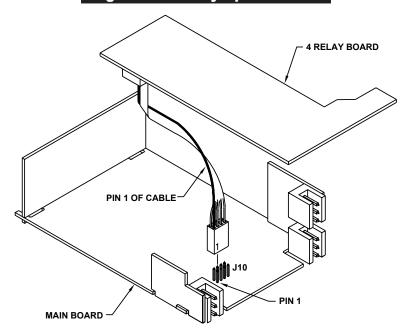


Figure 5-9. 4-Relay Option Board



NOTE: Both the Dual Relay Output Board and the 4 Relay Output Board can be installed at J10. However, only one option board can be installed at a time.

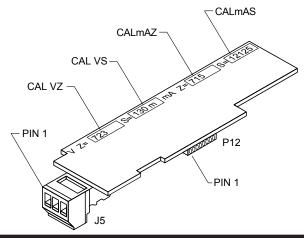


Figure 5-10. Analog Output Option Board

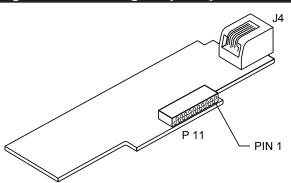


Figure 5-11. RS-232 Option Board

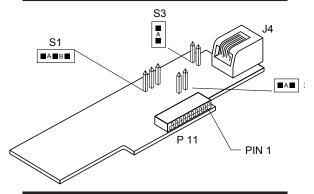


Figure 5-12. RS-485 Option Board

5.2.5 PANEL-MOUNT ASSEMBLY


The meter can be mounted in a panel so that the front of the meter is flush with the vertical panel surface. Panel mounting can be seen as simply "sandwiching" the panel between the inner case and the outer sleeve in the last phases of assembly. Figure 5-13 shows the panel cutout dimensions, and the dimensions for the panel thickness. It requires that the following already be done:

- Your line voltage rating has been checked against the meter rating on the Product ID and serial number label on the meter case. See Section 5.2.1.
- You have configured all jumpers—those on the main board as well as those on any optional boards. See Section 5.2.2 for main board jumper configuration and the appropriate sections for optional board jumper configuration.
- 3. You have installed all optional boards and inserted the main board assembly back into the case. See Section 5.2.3.
- You have wired P1, the AC power connector, and P2 the input output control connector; connectors are not installed in the meter, but are ready to be installed. See Section 7.
- 5. You have wired all connectors for optional boards; connectors are not connected to the meter, but are ready to be installed.

If all of these steps are done, use Figure 5-13 as a guide:



CAUTION: Connectors with the wiring connections will be installed after mounting the unit.

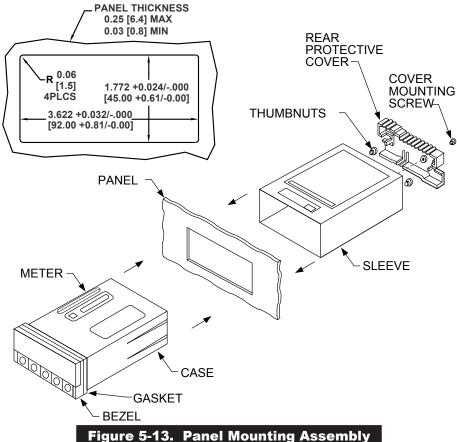

- 6. Punch or cut a hole in the panel using the panel cutout dimensions in
- 7. Insert the panel-mount gasket around the rear of the case and slide it forward to the bezel (if it's not already in place).

Figure 5-13. Remove burrs and paint the panel as required.

- 8. Working from the front of the panel, insert the case assembly, rear end first, all the way into the panel cutout such that the gasket firmly backs the panel surface.
- 9. Working from the rear of the panel, slide the sleeve forward over the case and up to the panel surface.

The panel should now be sandwiched between the bezel-backed gasket in front and the sleeve in back.

10. Replace the thumbnuts that secure the sleeve tabs to the case.



WARNING: Do not "turn-on" the ac power and input signals until all connections are connected to the meter.

11. Set P1, the AC power connector, aside and connect or reconnect all other connectors to the back of the meter using Figures 4-3 and 4-4 in Section 4.2 as guides.

Connect P1 last.



NOTE: The P1 connector is "keyed"; it is shaped in such a way that it fits only the J1 male pins.

Replace the rear protective cover and secure it with the cover mounting screw.

Your meter is now ready for operation and you can turn-on the power.

The meter display should light, and pass through "RESET 2" to run or display mode. If the meter flashes an overscale or overload message, press the 'MENU' button to advance to the configuration mode. Do not be concerned about overloads (the +S input can stand 120 V continuously and current inputs can handle ten times rated current).

Jumper Positions

6.1 INTRODUCTION

This section is for the configuration and setup of your jumper positions for readrate, unipolar or bipolar signal input, sensor input signal jumpers, sensor excitation jumpers, pushbutton lockouts and lockout of lockout configuration menus.

6.2 S1 JUMPER POSITIONS FOR READRATE AND UNIPOLAR OR BIPOLAR INPUT(S)

The typical readrate for your meter is 3/per second. This requires that no jumper has been installed in the S1A position and Input Configuration ("IN CNF") bit "INP.2" has been set to equal "0". Your meter is capable of a fast readrate of 13/per second. This requires that you install a jumper in the S1A position and the Input Configuration ("IN CNF") bit "INP.2" has been set to equal "1". Refer to Figure 6-1 for the location of the S1 jumpers.

The typical setting for your meter is unipolar. For unipolar input, no jumper is installed in the S1B position and Input Configuration ("IN CNF") bit "INP.3" must be set to equal "0". For bipolar inputs, install a jumper in S1B and set Input Configuration ("IN CNF") bit "INP.3" to equal "1".


6.3 S2 JUMPER POSITIONS FOR INPUT RANGES

The following are the input signal jumper positions required to be installed in the "S2" position on your meter for the CURRENT or VOLTAGE input ranges you require. These jumper positions include those that are required for sensor excitation. Jumpers S2-N & S2-T are for either 10 Vdc or 24 Vdc sensor excitation. To select desired excitation see Section 6.4. Refer to Figure 6-1 for the location of the S2 jumpers.

VOLTAGE - UNIPOLAR

Jumpers for 0 to 100 mV range: (meter supplied excitation)

Jumpers for 0 to 1 V range: (meter supplied excitation)



Jumpers for 0 to 10 V range: (meter supplied excitation)



Jumpers for 0 to 100 V range: (meter supplied excitation)



VOLTAGE - BIPOLAR

Jumpers for -50 to +50 mV range: (meter supplied excitation)




,



Jumpers for -500 to +500 mV range: (meter supplied excitation)






Jumpers for -5 to +5 V range: (meter supplied excitation)




S1



Jumpers for -50 to +50 V range: (meter supplied excitation)



S1




CURRENT

Jumpers for 0-20 mA or 4-20 mA: (Factory preset value) (meter supplied excitation)



S1




POTENTIOMETER

Jumpers for 0 to 10 V range: (using 10 Vdc drive)



S1



Jumper Positions

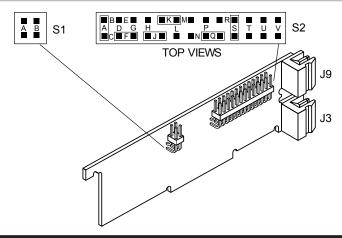


Figure 6-1. S1 and S2 Jumper Locations on Signal Input Board

6.4 JUMPER SETTING(S) FOR SENSOR EXCITATION

Your meter is capable of supplying either 1.5 to 11Vdc or 24 Vdc sensor excitation. (refer to Figure 6-2.).

- For 1.5 to 11Vdc excitation, install S4A and C jumpers, then adjust the potentiometer (R39) for proper voltage.
- For 24Vdc excitation, remove S4A and C jumpers and install S4B.

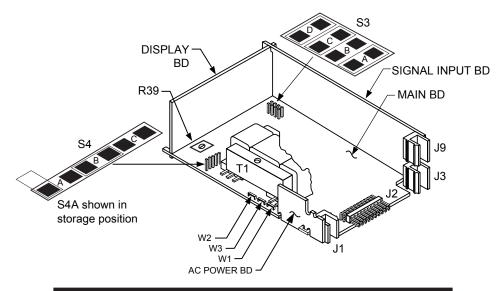


Figure 6-2. Main Board Jumper Positions S3 and S4

Jumper Positions 6

SENSOR EXCITATION

24 Vdc meter excitation (S2N, S2T, omit S4A)



S

62 BBEE BKBM BR T U V
A D G H L P S T U V
C F B J J B BN Q B B B

10 Vdc meter excitation (S2N, S2T, & S4A)



SZ



1.25 Vdc meter excitation (S2Q)



S



160 µA meter excitation (S2P)



S1


S₁



1.6 mA meter excitation (S2P, S2V)



S1



S4

S4B	Installed	For 24 Vdc excitation. (S4A located in storage position).
S4A ,S4C	Installed	For 10 Vdc excitation.

S3

S3A	Installed	Unlocks "MENU" button for programming.
S3B	Omit	See note below.
S3C	Installed	Unlocks lockout menu (L1 through L4).
S3D	Installed	Unlocks Front push button.



NOTE: S3B should **NOT** be installed. This jumper is only used when recalibrating the meter (e.g. an annual, careful performance by the calibration lab). When this jumper is installed, calibration coefficients can be changed via digital communications.



7.1 INTRODUCTION

The following describes how to connect your sensors to your meter with and without sensor excitation and how to connect the AC power to your meter. Prior to wiring the sensor to the meter, check with a multimeter that a proper excitation exists.



WARNING: Do not connect ac power to your meter until you have completed all input and output connections. Failure to do so may result in injury! This device must only be installed electrically by specially trained electrician with corresponding qualifications.

7.2 SIGNAL INPUT CONNECTIONS

The following figures (7-1 through 7-5) show the connections for voltage, current and potentiometer inputs:

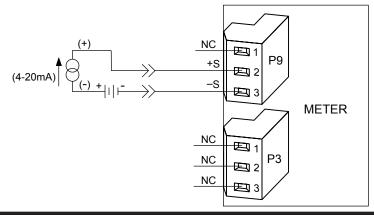


Figure 7-1. Current Input Without Sensor Excitation

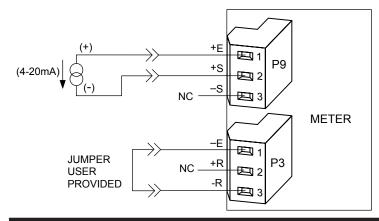


Figure 7-2. Current Input With Sensor Excitation

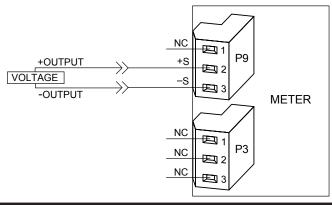


Figure 7-3. Voltage Input Without Sensor Excitation

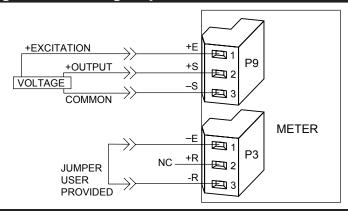


Figure 7-4. 3-Wire Voltage Input With Sensor Excitation

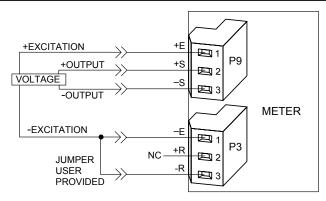


Figure 7-5 4-Wire Voltage Input With Sensor Excitation



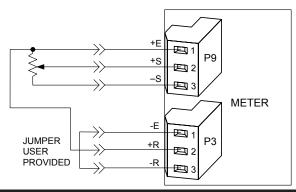


Figure 7-6. Potentiometer Connections with Internal Power Supply and Ratio Measurement.

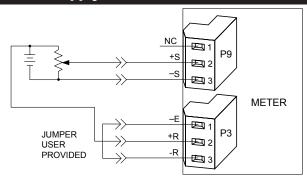


Figure 7-7 Potentiometer Connections With External Power Supply and Ratio Measurement (Remove jumper S2-T)

7.3 AC WIRING CONNECTION

Wire your power (from a wall socket or other source) to P1, the orange, 3-socket connector that plugs into the 3 pins on the left side as you view the meter from the rear. The orange (power) connector must be wired according to the following table (also refer to Figure 7-8):

USA WIRING CODE	EUROPE WIRING CODE	CONNECTION	PIN # ON ORANGE CONNECTOR
Black	Brown	AC Line (L)	1
White	Blue	AC Neutral (N)	2
Green	Green/Yellow	AC Protective Ground	3

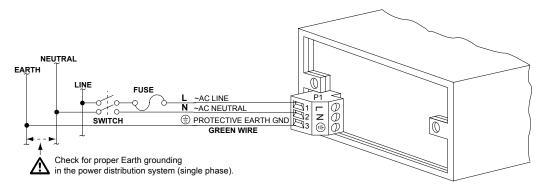


Figure 7-8. AC Connector Wiring at P1

Connect your AC meter power as described above and as shown in Figure 7-8:



CAUTION: As mentioned in Section 5.2.2, the meter has no power ON/OFF switch. The meter will be ON when power is applied.



WARNING: Do not connect ac power to your meter until you have completed all input and output connections. Failure to do so may result in injury! This device must only be installed electrically by specially trained electrician with corresponding qualifications. The main power input to the unit as well as the AC input signal to be measured must agree with the wiring instruction. The meter is factory set to the power specified by the customer at the time of ordering. The voltage is printed on the Product ID Label.

You are now ready to proceed with scaling your meter to display in engineering units as described in Section 8.

Scaling to Display Engineering Units

METHOD FOR SCALING THE METER TO DISPLAY IN ENGINEERING UNITS

8.1 INTRODUCTION

There are two basic methods for scaling your meter to display engineering units; scaling by using measured input values or scaling without connecting a sensor using assumed input values. Both methods use the Input Scale and Offset ("IN.SC.OF") method.

8.2 SETUP METER INPUT TYPE AND RANGE

If you have received your meter setup for your required input and do not require changes or rescaling, skip this section entirely and proceed with the normal use of your meter.

If you received your meter and you only require a scaling change, proceed with the steps in Section 8.3.

If you received your meter and it has been configured for input other than what you require, you must proceed with the following steps before rescaling the display:



WARNING: You must set your jumper positions at the S1 and S2 positions BEFORE proceeding. Refer to Section 6 for jumper positions.

PRESS	THEN PRESS (TO CHANGE IF REQUIRED)	UNTIL DISPLAY SHOWS	COMMENTS
'MENU'		"INPUT"	Press the ' MENU ' button until the display shows "INPUT".
'MIN'		"VOLT"	Press the 'MIN' button and the display will show some type of input such as "VOLT".
'MAX'		"CURRNT" or "VOLT" or "POT"	Press the 'MAX' button until the display shows a flashing input type that you want such as "CURRNT", "VOLT" or "POT".
'MENU'		"CURRNT"	Press the 'MENU' button to store you selection. The display will momentarily show "STORED" only if a change has been made and then will display your selection such as "CURRNT".
For Curren	t Inputs:		
'MAX'		"4-20 mA" or "0-20 mA"	Press the 'MAX' button and the display shows a flashing input range of 4-20 mA, or "0-20 mA." Press the 'MAX' button to select the 4-20 mA input range.
For Voltage	e Inputs:		
'MAX'		Unipolar "100 mV", "1 V", "10 V", "100 V" Bipolar "50 mV", "500 mV", "5 V", "50 V"	Press the 'MAX' button and the display will show a flashing input voltage range
	iometer Input: inge is selected.		
'MENU'		"STORED" then "RDG.CNF"	Press the 'MENU' button to store your selection. The display will momentarily show "STORED" only if a change has been made and then "RDG.CNF"

You are now ready to proceed with Input Scale and Offset ("IN.SC.OF")

Scaling to Display Engineering Units

8.3 SCALING YOUR METER USING 2-COORDINATE INPUT SCALE AND OFFSET (IN.SC.OF) WITH SENSOR CONNECTED TO YOUR METER

The most accurate method for scaling your meter to display engineering units is by connecting your sensor to your meter, apply two known loads, record them as INPUT1 and INPUT2 respectively and use these numbers for entry into 2-coordinate Input Scale and Offset ("IN.SC.OF").

The typical factory calibration and configuration is for the meter to accept a 4-20 mAdc and scaled to display 0 to 020000.

An example would be a 2-wire transmitter that sends a signal of 4-20 mAdc. With a signal input of 4 mA the display will show "000000" and with a signal input of 20 mA this display will show "02000". However, the output signal from your transmitter may be something like 3.98 mA and 19.99 mA. Using Input Scale and Offset ("IN.SC.OF") you can configure your meter to accurately display your required engineering units.



NOTE: Although the full span input of your sensor signal is preferred for maximum resolution, you may record any two points within the signal span for scaling accurately into engineering units.

The following will walk you step by step in configuring your meter for scaling your meter using the Input Scale and Offset ("IN.SC.OF") procedure.

8.3.1 SETTING INPUT CONFIGURATION ("IN CNF")

PRESS	THEN PRESS UNTIL (TO CHANGE DISPLAY IF REQUIRED) SHOWS	COMMENTS
FRESS	IF REQUIRED) SHOWS	COMMENTS
'MENU'	"IN CNF"	Press the 'MENU' button until the display shows "IN CNF".
'MIN'	"INP.3=0"	Press the 'MIN' button until the display shows "INP.3=0" or "INP.3=1".
'MAX'	"INP.3=0"	Press the 'MAX' button to select "INP.3=0"- Unipolar input for current, voltage and potentiometer inputs.
or		
'MAX'	"INP.3=1"	Press the 'MAX' button to select "INP.3=1"- Bipolar input for voltage or potentiometer inputs.
'MIN'	"INP.6=0" or "INP.6=1"	Press the 'MIN' button until the display "INP.6=0" or "INP.6=1".
'MAX'	"INP.6=1"	Press the 'MAX' button until the display shows "INP.6=1" to enable Input Scale and Offset ("IN.SC.OF").
'MENU'	"IN.SC.OF"	Press the 'MENU' button to store your selection and the display will momentarily show "STORED" then "IN.SC.OF".

If you need to re-scale your meter, you must proceed with the following steps:

Scaling to Display Engineering Units

8.3.2 SCALING YOUR METER WITH YOUR SENSOR CONNECTED

Before proceeding, you must first apply a low input ("INPUT1") and a high input ("INPUT 2") into your meter and record the exact display shown. As explained in Section 8.3, the display you will be recording will be 0 and 100000 if your meter has not been changed from the typical factory setup and calibration. The following is an example using the numbers below as the recorded input displayed on the meter. You should use the numbers you have recorded:

Low input: 4 milliamps
Meter display ("INPUT 1"): 000000.
High input: 20 milliamps
Meter display ("INPUT 2"): 020000.



Note: If you are using an input signal that is reverse acting (e.g. 20-4 mA), then the 20 mA reading would be "INPUT1" and the 4 mA reading would be "INPUT 2".

In addition to recording your display readings for your two inputs, you must also decide what you want these inputs to display on your meter.

In order to simplify this (especially if you want to display numbers to the right of the decimal point position), you should think of your meter as a process indicator and your decimal point as being passive or cosmetic.

As an example, if you wanted your display to read 0.000 to 68.000, you would record and enter your "READ 1" number as 000000. and your "READ 2" number as 068000. Then after storing these numbers, you would then place your decimal point position (refer to Section 8.3.4) so that your display would show 0.000 to 68.000.

Record your "INPUT1" and "READ 1" numbers, and your "INPUT2" and "READ 2" numbers, record them below and proceed as follows:

INPUT1 =	000003.
READ 1 =	000000
INPUT2 =	020018.
READ 2 =	068000.

For the purpose of this example, we will use the numbers described above for the following procedure:

C))		
	7		/
	2	7	7
	1	7	

PRESS	THEN PRESS (TO CHANGE IF REQUIRED)	UNTIL DISPLAY SHOWS	COMMENTS
'MENU'		"IN.SC.OF"	Press the ' MENU ' button until the display shows "IN.SC.OF" Input Scale and Offset.
'MIN'		"INPUT1"	Press the 'MIN' button and the display will show "INPUT1".
'MIN'		"XXXXX"	Press the 'MIN' button and the display will show some 6 digit number.
'MAX'	'MIN'	"000003."	Using the 'MAX' button to change the value of the flashing digit and the 'MIN' button to scroll to the next digit to the right, enter your "INPUT1" number on the display.
'MENU'		"READ 1"	Press the 'MENU' button and the display will show "READ 1".
'MIN'		"XXXXX"	Press the 'MIN' button and the display will show some 6-digit number.
'MAX'	'MIN'	"000000."	Using the 'MAX' button to change the value of the flashing digit and the 'MIN' button to scroll to the next digit to the light, enter the engineering value that you want your "INPUT1" number to display on the meter.
'MENU'		"INPUT2"	Press the 'MENU' button and the display will show "INPUT2".
'MIN'		"XXXXXX"	Press the 'MIN' button and the display will show some 6-digit number,
'MAX'	'MIN'	"100018."	Using the 'MAX' button to change the value of the flashing digit and the 'MIN' button to scroll to the next digit to the right, enter your "INPUT 2" number on the display.

Scaling to Display Engineering Units

PRESS	THEN PRESS (TO CHANGE IF REQUIRED)	UNTIL DISPLAY SHOWS	COMMENTS
'MENU'		"READ 2"	Press the ' MENU ' button and the display will show "READ 2".
'MIN'		"XXXXXX"	Press the 'MIN' button and the display will show some 6-digit number.
'MAX'	'MIN'	"068000."	Using the 'MAX' button to change the value of the flashing digit and the 'MIN' button to scroll to the next digit to the right, enter the engineering value you want your "INPUT 2" to display.
'MENU'		"STORED"	Press the 'MENU' button to store your selection and the display will momentarily show "STORED" then "DEC PT".

Now you are ready to position your decimal point position by completing the following steps:

8.3.3 TO SELECT DECIMAL POINT POSITION (DEC PT)

The following is the procedure for selecting your decimal point position.

PRESS	THEN PRESS (TO CHANGE IF REQUIRED)	UNTIL DISPLAY SHOWS	COMMENTS
'MENU'		"DEC PT"	Press the 'MENU' button until the display shows "DEC PT".
'MIN'	'MAX'	"FFF.FFF"	Press the 'MIN' button and the display will show "FFFFFF." or the previously selected position. Press the 'MAX' button to select the decimal point position you require, the meter displays the previously selected decimal point location within the "F's"
'MENU'		"CNT BY"	Press the 'MENU' button to store your decimal point selection and the meter will momentarily display "STORED" only if you have made a change, and then "CNT BY".
'RESET'	'RESET'	"RESET2" then the Measured Value	Press the 'RESET' button two times. The display will momentarily show "RESET2" and then will display the currently measured values,

Your meter is now calibrated. If you need to offset your zero reading on your meter after calibration, you must proceed with the following steps:

Scaling to Display Engineering Units

8.3.4 ENTERING ZERO OFFSET NUMBERS

The RDG OF (Reading Offset) menu item should be used if the meter shows a nonzero reading with zero input. The offset value zeroes the display by canceling out the nonzero reading.

If your meter displays a positive reading at zero input, you must enter a negative offset value. If your meter displays a negative reading at zero input, you must enter a positive offset value.

If you are using an active decimal point (RDG.2=0), your offset value will be the negative of the display reading at zero point.

If you are using the more common independent decimal point (the factory setting, RDG.2=1), follow these instructions display reading to the appropriate offset value:

- Note the display reading at zero input, ignoring the decimal point. This
 reading represents the count value the number of whole counts that
 need to be offset,
- 2. Shift the count value to the left side of the decimal point.
- 3. If the count value is positive, make it negative by replacing the leading digit (the left-most digit) with a minus sign. If the count value is negative, make it positive by replacing the negative sign with a zero.

Example 1: Your meter displays 000.003 when the input is zero. The count value is 000003. Shift this value to the left side of the decimal point: 003.000. Change the leading zero to a minus sign: -03.000. This is the "converted offset value" you will use for configuring RDG OF.

Example 2: Your meter displays -00.003 when the input is zero. The count value is -00003. Shift this value to the left side of the decimal point: -03.000. Change the leading minus sign to a zero: 003.000. This is the "converted offset value" you will use for configuring RDG OF.

If the nonzero reading is fluctuating between two numbers, convert the smaller count value to the offset value, then add a 5 just right of the decimal point. This adds half a count to the offset. For example, the display is fluctuating between 00.0001 and 00.0002. Calculate the offset using the 000001 count value. The converted offset value is -1.0000. Add a 5 to the right of the decimal point: -the final offset value is -1.5000.

	THEN PRESS	UNTIL	
PRESS	(TO CHANGE IF REQUIRED)	DISPLAY SHOWS	COMMENTS
'MENU'		"RDG OF"	Press the ' MENU ' button until the display shows "RDG OF".
'MIN'		"000000."	Press the 'MIN' button and the display will show the last offset entered.
'MIN'	'MAX'	"XXXXX"	Use the 'MIN' to move to each digit and the 'MAX' button to change the flashing digits value and enter your zero offset number.
'MENU'		"STORED" then "IN CNF"	Press the 'MENU' button to store your selection. The display will momentarily show "STORED" then "IN CNF".
'RESET'	'RESET'	"RESET2" the then Measured Value	Press the 'RESET' button two times. The display will momentarily show "RESET2" and you will display the currently measured values.
			values.



NOTE: If after zeroing the display with RDG OF, the reading again drifts from zero, the required offset value is the sum of the current RDG OF value and the current converted offset value. The examples below illustrate the calculation of required offset values when using an independent decimal. If you are using an active decimal point, the current converted offset value is simply the negative value of the display reading.

Example 1: You use a RDG OF value of -1.0000 to zero the meter. The next morning, the meter displays 00.0008 at zero input; you need to rezero. The current count value is 000008; shifting this value to the left of the decimal makes it 08.0000, and making the value negative makes it -8.0000. The required RDG OF value is the sum of the current RDG OF value (-1.0000) and the current converted offset value (-8.0000):

-1.0000 + -8.0000 = -9.0000

Scaling to Display Engineering Units

Example: You use a RDG OF value of -1.0000 to zero the meter. The next morning, the meter displays -0.0008 at zero input; you need to rezero. The current count value is -00008; shifting this value to the left of the decimal makes it -8.0000, and making the value positive makes it 08.0000. The required RDG OF value is sum of the current RDG OF value (-1.0000) and the current converted offset value (08.0000):

-1.0000 + 08.0000 = 07.0000

If you require further configuration(s) for your specific application, refer to sections 9 through 21.



NOTE: Should you receive an error code of any kind while configuring your meter, refer to Section 17 - Troubleshooting - Display Messages and Troubleshooting Guide.

8.4 SCALING YOUR METER WITHOUT CONNECTING A SENSOR USING CALCULATED VALUES

Your meter can be scaled without connecting a sensor and taking measured values rising Input Scale and Offset ("IN.SC.OF").

The typical configuration and scaling of your meter is 4-20 mAdc input with a display equal to 0 to 100000. If your meter has not been rescaled and your input is 4-20 mAdc, you can use the factory scaling "0" as your "INPUT1" and "100000" as your "INPUT2" and proceed with the step by step procedure in Section 8.4.1.

If you need to change your input signal, you must rescale your meter as described in the following steps:

8.4.1 PREPARING YOUR METER FOR SCALING WITH INPUT SCALE AND OFFSET

If you are changing your input signal you must follow the instruction for installing the correct jumper positions as described in Section 6 and the sensor connections as described in Section 7.



WARNING: Do not connect your AC meter power until all input jumpers and sensor input connections are completed. Failure to do so could result in damage to your sensor and/or the meter.

The following procedure will direct you step by step in preparing your meter for rescaling using Input Scale and Offset ("IN.SC.OF")

	7	
>	≺	
U	J	

	THEN PRESS (TO CHANGE	UNTIL DISPLAY	
PRESS	ÎF REQUIRED)	SHOWS	COMMENTS
'MENU'		"IN.SC.OF"	Press the 'MENU' button until the display shows "IN.SC.OF" Input Scale and Offset.
'MIN'		"INPUT1"	Press the 'MIN' button and the display will show "INPUT1".
'MIN'		"XXXXXX"	Press the 'MIN' button and the display will show some 6 digit number.
'MENU'		"IN.SC.OF"	Press the ' MENU ' button until the display shows "IN.SC.OF" Input Scale and Offset.
'MIN'		"INPUT1"	Press the 'MIN' button and the display wilt show "INPUT1".
'MIN'		"XXXXX"	Press the 'MIN' button and the display will show some 6-digit number.
'MAX'	'MIN'	"000000."	Using the 'MAX' button to change the value of the flashing digit and the 'MIN' button to scroll to the next digit to the right, enter "000000." on the display.
'MENU'		"READ 1"	Press the 'MENU' button and the display will show "READ 1".
'MIN'		"XXXXX"	Press the 'MIN' button and the display will show some 6-digit number.
'MAX	'MIN'	"000000."	Using the 'MAX' button to change the value of the flashing digit and the 'MIN' button to scroll to the next digit to the right, enter "000000" on the meter
'MENU'		"INPUT2"	Press the 'MENU' button and the display will show "INPUT2".
'MIN'		"XXXXXX"	Press the 'MIN' button and the display will show some 6-digit number.

Scaling to Display Engineering Units

PRESS	THEN PRESS (TO CHANGE IF REQUIRED)	UNTIL DISPLAY SHOWS	COMMENTS
'MAX'	'MIN'	"100000."	Using the 'MAX' button to change the value of the flashing digit and the 'MIN' button to scroll to the next digit to the right, enter "000000." on the display.
'MENU'		"READ 2"	Press the ' MENU ' button and the display will show "READ 2".
'MIN'		"XXXXXX"	Press the 'MIN' button and the display will show some 6-digit number.
'MAX'	'MIN'	"100000."	Using the 'MAX' button to change the value of the flashing digit and the 'MIN' button to scroll to the next digit to the right, enter "100000." on the display.
'MENU'		"STORED"	Press the 'MENU' button to store your selection and the display will momentarily show "STORED" then "DEC PT".
Proceed w		<u> </u>	ning your decimal point position:
PRESS	THEN PRESS (TO CHANGE IF REQUIRED)	UNTIL DISPLAY SHOWS	COMMENTS
'MENU'		"DEC PT"	Press the 'MENU' button until the display shows "DEC PT".
'MIN'	'MAX'	"FFF.FFF"	Press the 'MIN' button and the display will show "FFFFFF." or the previously selected position. Press the 'MAX' button to select the decimal point position you require, the meter displays the previously selected decimal Point location within the "F's".
'MENU'		"CNT BY"	Press the 'MENU' button to store your decimal point selection and the meter will momentarily display "STORED" only if you have made a change and then "CNT BY".

You are now ready to scale your meter rising Input Scale and Offset ("IN.SC.OF") without connecting a sensor or signal source to your meter.

8.4.2 SCALING YOUR METER

Scaling your Meter without a sensor or a signal source connected is easily accomplished by using one of the calculated scale factors as shown in Figure 8-1.

These calculated scale factors are the numbers that your meter would display if you connected a signal source.

You must complete the procedure for preparing your meter for scaling as described in Section 8.4.1. Failure to complete this procedure will result in erroneous readings.

INPUT SIGNAL	LOW VALUE	HIGH VALUE
0-20 mA	000000	020000
4-20 mA	000000	020000
± 50 mV	-50000	050000
± 500 mV	-50000	050000
0-20 mV	000000	020000
0-30 mV	000000	030000
0-50 mV	000000	050000
0-100 mV	000000	100000
0-1 V	000000	100000
0-5 V	000000	050000
1-5 V	010000	050000
1-6 V	010000	060000
0-10 V	000000	100000
0-50 V	000000	050000
0-100 V	000000	100000
+/-5 V	-50000	050000
+/-50 V	-50000	050000

Figure 8-1 . Factory Calculated Scale Factors

Scaling to Display Engineering Units

For the purpose of this procedure, we will use an input of 1-5 Vdc and scale the meter to display 0 to 2500.0.

The calculated scale factors can now be used to scale your meter to display in engineering units using Input Scale and Offset ("IN.SC.OF") as follows:

Record your "INPUT1" and "READ 1" numbers, and your "INPUT2" and "READ 2" numbers, record them below and proceed as follows:

INPUT1 =	Example 010000.
READ 1 =	000000.
INPUT2 =	050000.
READ 2 =	025000.

)	
7	5	
	~	
		_

	THEN PRESS (TO CHANGE	UNTIL DISPLAY	
PRESS	ÎF REQUIRED		COMMENTS
'MENU'		"IN.SC.OF"	Press the 'MENU' button until the display shows "IN.SC.OF" Input Scale and Offset.
'MIN'		"INPUT1"	Press the 'MIN' button and the display will show "INPUT1",
'MIN'		"XXXXX"	Press the 'MIN' button and the display will show some 6-digit number.
'MAX'	'MIN'	"010000."	Using the 'MAX' button to change the value of the flashing digit and the 'MIN' button to scroll to the next digit to the right, enter your "INPUT1" number on the display.
'MENU'		"READ 1"	Press the 'MENU' button on the display will show 'READ 1".
'MIN'		"XXXXX"	Press the 'MIN' button and the display will show some 6-digit number.
'MAX'	'MIN'	"000000."	Using the 'MAX' button to change the value of the flashing digit and the 'MIN' button to scroll to the next digit to the right, enter the engineering value that you want your "INPUT1" number to display on the meter.
'MENU'		"INPUT2"	Press the ' MENU ' button and the display will show "INPUT2".
'MIN'		"XXXXX"	Press the 'MIN' button and the display will show some 6-digit number.
'MAX'	'MIN'	"050000."	Using the 'MAX' button to change the value of the flashing digit and the 'MIN' button to scroll to the next digit to the right, enter your "INPUT 2" number on the display.

Scaling to Display Engineering Units

PRESS	THEN PRESS (TO CHANGE IF REQUIRED)	UNTIL DISPLAY SHOWS	COMMENTS
'MENU'		"READ 2"	Press the ' MENU ' button and the display will show 'READ 2".
'MIN'		"XXXXXX"	Press the 'MIN' button and the display will show some 6-digit number.
'MAX'	'MIN'	"025000."	Using the 'MAX' button to change the value of the flashing digit and the 'MIN' button to scroll to the next digit to the right, enter the engineering value, you want your "INPUT 2" to display.
'MENU'		"STORED"	Press the 'MENU' button to store your selection and the display will momentarily show "STORED" then "DEC PT".

Now you are ready to position your decimal point position by completing the following steps:

8.4.3 TO SELECT DECIMAL POINT POSITION

The following is the procedure for selecting your decimal point position.

PRESS	THEN PRESS (TO CHANGE IF REQUIRED)	UNTIL DISPLAY SHOWS	COMMENTS
'MENU'		"DEC PT"	Press the ' MENU ' button until the display shows "DEC PT".
'MIN'	'MAX'	"FFFFF.F"	Press the 'MIN' button and the display will show "FFFFFF." or the previously selected position, Press the 'MAX' Button to select the decimal point position you require, the meter displays the previously selected decimal point location within the "F's".
'MENU'		"CNT BY"	Press the 'MENU' button to store your decimal point selection and the meter will momentarily display "STORED" only if you have made a change and then "CNT BY".
'RESET'	'RESET'	"RESET2" then the Measured Value	Press the 'RESET' button two times. The display will momentarily show "RESET2" then will display the currently measured values.

Your meter is now calibrated. If you need to offset your zero reading on your meter after calibration, you must proceed with the following steps:

Scaling to Display Engineering Units

PRESS	THEN PRESS UNTIL (TO CHANGE DISPLAY IF REQUIRED) SHOWS	COMMENTS
'MENU'	"RDG OF"	Press the ' MENU ' button until the display shows "RDG OF".
'MIN'	"000000."	Press the 'MIN' button and the display will show the last offset entered.

If your meter displays an offset, which is a positive number, you must enter a negative "-" offset number into Reading Offset ("RDG OF"). An example would be if your zero input shows "20" on your meter display, you would enter "-00020" in Reading Offset ("RDG OF") and if your zero input shows a negative "-20" you would enter a positive 000020 in Reading Offset ("RDG OF").

PRESS	THEN PRESS (TO CHANGE IF REQUIRED)	UNTIL DISPLAY) SHOWS	COMMENTS
'MIN'	'MAX'	"XXXXX"	Use the 'MIN' button to move to each digit and the 'MAX' button to change the flashing digits value and enter your zero offset number.
'MENU'		"STORED" then "IN CNF"	Press the 'MENU' button to store your selection. The display will momentarily show "STORED" then "IN CNF".
'RESET'	'RESET'	"RESET2" then the Measured Value	Press the 'RESET' button two times. The display will momentarily show "RESET2" and then will display the currently measured values.

8.4.4 ENTERING ZERO OFFSET NUMBERS

The RDG OF (Reading Offset) menu item should be used if the meter shows a nonzero reading with zero input. The offset value zeroes the display by canceling out the nonzero reading.

If your meter displays a positive reading at zero input, you must enter a negative offset value. If your meter displays a negative reading at zero input, you must enter a positive offset value.

If you are using an active decimal point (RDG.2=0), your offset value will be the negative of the display reading at zero point.

If you are using the more common independent decimal point (the -factory setting, RDG.2=1), follow these instructions to convert the display reading to the appropriate offset value:

- Note the display reading at zero input, ignoring the decimal point. This
 reading represents the count value the number of whole counts that
 need to be Offset.
- 2. Shift the count value to the left side of the decimal point.
- 3. If the count value is positive, make it negative by replacing the leading digit (the left-most digit) with a minus sign. If the count value is negative, make it positive by replacing the negative sign with a zero.

Example 1: Your meter displays, 000.003 when the input is zero. The count value is 000003. Shift this value to the left side of the decimal point: 003.000. Change the leading zero to a minus sign: -03.000. This is the "converted offset value" you will use for configuring RDG OF.

Example 2: Your meter displays -00.003 when the input is zero. The count value is -00003. Shift this value to the left side of the decimal point: -03.000. Change the leading minus sign to a zero: 003.000. This is the "converted offset value" you will use for configuring RDG OF.

If the nonzero reading is fluctuating between two numbers, convert the smaller count value to the offset value, then add a 5 just right of the decimal point. This adds half a count to the offset. For example, the display is fluctuating between 00.0001 and 00.0002.

Calculate the offset using the 000001 count value. The converted offset value is -1.0000. Add a 5 to the right of the decimal point: the final offset value is -1.5000.

Scaling to Display Engineering Units

PRESS	THEN PRESS (TO CHANGE IF REQUIRED)	DISPLAY	COMMENTS
'MENU'		"RDG OF"	Press the ' MENU ' button until the display shows "RDG OF".
'MIN'		"000000."	Press the 'MIN' button and the display will show the last offset entered.
'MIN'	'MAX'	"XXXXX"	Use the 'MIN' to move to each digit and the 'MAX' button to change the flashing digits value and enter your zero offset number.
'MENU'		"STORED" then "IN CNF"	Press the 'MENU' button to store your selection. The display will momentarily show "STORED" then "IN CNF".
'RESET'	'RESET'	"RESET2" then the Measured Value	Press the 'RESET' button two times. The display will momentarily show "RESET2" and then will display the currently measured values.



NOTE: If after zeroing the display with RDG OF, the reading again drifts from zero, the required offset value is the **sum** of the current RDG OF value and the current converted offset value. The examples below illustrate the calculation of required offset values when using an independent decimal. If you are using an active decimal point, the current converted offset value is simply the negative value of the display reading.

Example 1: You use a RDG OF value of -1.0000 to zero the meter. The next morning, the meter displays 00.0008 at zero input; you need to rezero. The current count value is 000008; shifting this value to the left of the decimal makes it 08.0000, and making the value negative makes it -8.0000. The required RDG OF value is the **sum** of the current RDG OF value (-1.0000) and the current converted offset value (-8.0000):

-1.0000 + -8,0000 = -9,0000

Example 2: You use a RDG OF value of -1.0000 to zero the meter. The next morning, the meter displays -0.0008 at zero input; you need to rezero. The current count value is -00008; shifting this value to the left of the decimal makes it -8.0000, and making the value positive makes it 08.0000. The required RDG OF value is **sum** of the current RDG OF value (-1.0000) and the current converted offset value (08.0000):

-1.0000 + 08.0000 = 07.0000

If you require further configuration(s) for your specific application, refer to Sections 9 through 21.



NOTE: Should you receive an error code of any kind while configuring your meter, refer to Section 17 - Troubleshooting - Display Messages and Troubleshooting Guide.

Meter Function Menus

EXPLANATION OF LOCKOUT CONFIGURATIONS AND METER FUNCTION MENUS

HOW TO USE THE TABLES IN SECTION 9

MIN/MAX/MENU These are the buttons on the meter you are to

press to access the parameters given in the

same column.

MAIN MENU/ SUBMENU: These are headings for the table columns.

DISPLAYED INFORMATION:

These are parameters seen on the display after pressing either 'MIN', 'MAX', or 'MENU'

button(s).



NOTE: If you press the '**RESET**' button two times while the meter is in the run mode, all Setpoints, Alarms, Peak & Valley will be reset and the meter will begin new measurements.

If you press the 'RESET' button one time while in the configuration mode, you will move one MAIN MENU backwards and any selection will not be saved. If you press the 'RESET' button two times while in the configuration mode, you will reset the meter and only those menu items saved by pressing the 'MENU' button will be saved.

9.1 Individual Lockout Information

To restrict access to different parameters of the program in the meter, you may want to lockout parts of the meter. When you lock out a parameter, it will no longer appear when you scroll through the menu. To lock out specific parameters of the meter (setpoint, scaling), refer to the following tables.

Once set (to unlock useful features for a given application and to lock out any features), these four "L1C", "L2C", "L3C", and "L4C" can be rapidly skipped over by pressing the '**MENU**' button four times.

MENU BUTTON	MIN/MAX* BUTTON	
MAIN MENU	SUB MENU	CONDITION
"L1 CNF":		LOCKOUT CONFIGURATION #1
	" <u>L1C.1=0</u> "	Setpoint 1 change unlocked.
	"L1C.1=1"	Setpoint 1 change locked out.
	" <u>L1C.2=0</u> "	Setpoint 2 change unlocked.
	"L1C.2=1"	Setpoint 2 change locked out.
	" <u>L1C.3=0</u> "	Setpoint 3 (Alarm 1) change unlocked.
	"L1C.3=1"	Setpoint 3 (Alarm 1) change locked out.
	" <u>L1C.4=0</u> "	Setpoint #4 (Alarm 2) change unlocked.
	"L1C.4=1"	Setpoint #4 (Alarm 2) change locked out.
	" <u>L1C.5=0</u> "	Valley-value (LO RDG) display is permitted.
	"L1C.5=1"	Displays microprocessor revision.
	" <u>L1C.6=0</u> "	Peak-value (HI RDG) display is permitted.
	"L1C.6=1"	Peak-value (HI RDG) display is not permitted.
	" <u>L1C.7=0</u> "	INPUT CLASS (CURRENT VOLTAGE or POT) can be selected.
	"L1C.7=1"	INPUT CLASS is locked out.
	" <u>L1C.8=0</u> "	INPUT TYPE (such as 0-20 mA, 4-20 mA, 0-100 mV, 0-10 Vdc, etc.) can be selected.
	"L1C.8=1"	INPUT TYPE is locked out.

^{*}The 'MIN' button allows you to sequence through L1C.1, L1C.2, L1C.3, L1C.4, L1C.5, L1C.6, L1C.7 and L1C.8.

The 'MAX' button allows you to select the "0" or "1" state for each "L1C" condition.

The 'MENU' button stores the selected values for all "L1C" condition(s) changed and advances the meter to "L2 CNF". Do not press the 'MENU' button after each change within the submenu or the meter will advance to the next menu item.

Meter Function Menus

MENU BUTTON MAIN MENU	MIN/MAX* BUTTON SUB MENU	CONDITION
"L2 CNF":		LOCKOUT CONFIGURATION #2
	" <u>L2C.1=0</u> "	RDG.CNF (scale/offset method and display features) may be chosen.
	"L2C.1=1"	RDG.CNF (scale/offset method and display features) is locked out.
	" <u>L2C.2=0</u> "	Either RDG SC (computed input-to-display scale factor)
		or RD.SC.OF (two data points, which determine the reading scale/offset) may be entered.
	"L2C.2=1"	Either RDG SC (computed input-to-display scale factor)
		or RD.SC.OF (two data points, which determine the reading scale/offset) is locked out.
	" <u>L2C.3=0</u> "	RDG OF (offset computed in display digits) may be entered.
	"L2C.3=1"	RDG OF (offset computed in display digits) is locked out.
	" <u>L2C.4=0</u> "	INP.CNF (meter rates, front-end features, prelinearizing scale/offset) may be chosen.
	"L2C.4=1"	INP.CNF (meter rates, front-end features, prelinearizing scale/offset) may not be locked out.
	" <u>L2C.5=0</u> "	IN.SC.OF (two data points for additional scale/offset) may be entered.
	"L2C.5=1"	IN.SC.OF (two data points for additional scale/offset) may not be entered.
	" <u>L2C.6=0</u> "	DEC PT (decimal-point location) may be chosen
	"L2C.6=1"	DEC PT (decimal-point location) may not be chosen.

MENU BUTTON MAIN MENU	MIN/MAX* BUTTON SUB MENU	CONDITION
"L2 CNF"		
	" <u>L2C.7=0</u> "	CNT BY (round off of display) can be specified.
	"L2C.7=1"	CNT BY (round off of display) cannot be specified.
	" <u>L2C.8=0</u> "	FIL CNF (adaptive/fixed filtering and for which output(s)) can be chosen.
	"L2C.8=1"	FIL CNF (adaptive/fixed filtering and for which output(s)) cannot be chosen.

^{*} The 'MIN' button allows you to sequence through L2C.1, L2C.2, L2C.3, L2C.4, L2C.5, L2C.6, L2C.7, and L2C.8.

The 'MAX' button allows you to select the "0" or "1" state for each "L2C" condition.

The 'MENU' button stores the selected values for all "L2C" condition(s) changed and advances the meter to "L3 CNF". Do not press the 'MENU' button after each change within the submenu or the meter will advance to the next menu item.

MENU BUTTON MAIN MENU	MIN/MAX* BUTTON SUB MENU	CONDITION
"L3 CNF":		LOCKOUT CONFIGURATION#3
	" <u>L3C.1=0</u> "	FIL TI (# of samples in average) can be chosen.
	"L3C.1=1"	FIL TI (# of samples in average) cannot be locked out.
	" <u>L3C.2=0</u> "	SP CNF (mode of action of setpoints 1 & 2 LEDs, transistors and relays) can be selected.
	"L3C.2=1"	SP CNF (mode of action of setpoints 1 & 2 LEDs, transistors and relays) cannot be locked out.
	" <u>L3C.3=0</u> "	AL CNF (mode of action of Setpoints 3 & 4, often used as alarms) can be locked out.

Meter Function Menus

MENU BUTTON MAIN MENU	MIN/MAX* BUTTON SUB MENU	CONDITION
"L3 CNF"	"L3C.3=1"	AL CNF (mode of action of setpoints 3 & 4, often used as alarms) cannot be locked out.
	" <u>L3C.4=0</u> "	AL FNC (Setpoints 3 & 4 independent or ganged with Setpoints 1 and 2) can be selected.
	"L3C.4=1"	AL FNC (Setpoints 3 & 4 independent or ganged with Setpoints 1 and 2) cannot be accessed.
	" <u>L3C.5=0</u> "	AL RDG (# of out-of-range readings before trip of setpoints 3 & 4) can be selected.
	"L3C.5=1"	AL RDG (# of out-of-range readings before trip of setpoints 3 & 4) cannot be accessed.
	" <u>L3C.6=0</u> "	SP DB (hysteresis or deadband of Setpoints and Alarms) can be specified.
	"L3C.6=1"	SP DB (hysteresis (deadband) of Setpoints and Alarms) cannot be accessed.
	" <u>L3C.7=0</u> "	OUT.CNF (analog & BCD outputs, setpoint display flashing) can be specified.
	"L3C.7=1"	OUT.CNF (analog & BCD outputs, setpoint display flashing) cannot be accessed.
	" <u>L3C.8=0</u> "	OT.SC.OF (2-data-point method for independent analog-output scale/offset) can be entered.
	"L3C.8=1"	OT.SC.OF (2-data-point method for independent analog-output scale/offset) cannot be accessed.

^{*} The 'MIN' button allows you to sequence through L3C.1, L3C.2, L3C.3, L3C.4, L3C.5, L3C.6, L3C.7, and L3C.8.

The 'MAX' button allows you to select the "0" or "1" state for each "L3C" condition.

The 'MENU' button stores the selected values for all "L3C" condition(s) changed and advances the meter to "L4 CNF". Do not press the 'MENU' button after each change within the submenu or the meter will advance to the next menu item.

MENU	MIN/MAX*	
BUTTON MAIN MENU	BUTTON SUB MENU	CONDITION
"L4 CNF":		LOCKOUT CONFIGURATION #4
	" <u>L4C.1=0</u> "	BAUD (communication rate) can be chosen.
	"L4C.1=1"	BAUD (communication rate) cannot be accessed.
	" <u>L4C.2=0</u> "	SER.CNF (parity/stop-bit length) is selectable.
	"L4C.2=1"	SER.CNF (parity/stop-bit length) is not selectable.
	" <u>L4C.3=0</u> "	ADDRES (meter address # on a multipoint bus) can be changed.
	"L4C.3=1"	ADDRES (meter address # on a multipoint bus) cannot be accessed.
	" <u>L4C.4=0</u> "	DAT FT & BUS FT (format of datA stream and bus interaction for digital communications) can be altered.
	"L4C.4=1"	DAT FT & BUS FT (format of data stream and bus interaction for digital communications) cannot be accessed.
	" <u>L4C.5=0</u> "	SERCNT (interval # of readings for the automatic digital output of meter) can be changed.
	"L4C.5=1"	SERCNT (interval # of readings for the automatic digital output of meter) cannot be accessed.
	" <u>L4C.6=0</u> "	Analog output trim input can be entered.
	"L4C.6=1"	Analog output trim input cannot be entered.

^{*} The 'MIN' button allows you to sequence through L4C.1, L4C.2, L4C.3, L4C.4, L4C.5 and L4C.6.

The 'MAX' button allows you to select the "0" or "1" state for each "L4C" condition.

The 'MENU' button stores the selected values for all "L4C" condition(s) changed and advances the meter to "INPUT". Do not press the 'MENU' button after each change within the submenu or the meter will advance to the next menu item.

Meter Function Menus

9.2 METER FUNCTION MENUS

9.2.1 Input

By pressing the 'MAX' and 'MENU' buttons you can select and then store respectively either "CURRNT", "VOLTAGE" or "POT" (input type). Refer to the chart below to go the next level of programming of the meter.

MENU BUTTON	MIN/MAX* BUTTON	
MAIN MENU	SUB MENU	DESCRIPTION
		SIGNAL TYPE
"CURRNT"	"0-20 mA"	DC current
	"4-20 mA"	
"VOLT"	"100 mV"	Unipolar DC voltage
	"1 V"	
	"10 V"	
	"100 V"	
		Bipolar DC voltage
	"50 mV"	
	"500 mV"	
	"5 V"	
	"50 V"	
"POT"		No input selection is made.

9.2.2 RDG.CNF (Reading Configuration)

Reading configuration is used to select:

- reading scale and offset (direct vs 2-point) [RDG.1]
- active or independent decimal point [RDG.2]
- display brightness [RDG.3]
- leading zero suppression on your meter display [RDG.4]

Direct scale and Offset: these two values are used in the straight line equation, y = mx + b. (RD.SC.OF)

Display = m times input plus b or [m (input) + b] (where m is the RDG SC and b is the RDG OF).

RDG.6 enables or disables (RD.SC.OF), (RDG,SC), (RDG.OF).

The 2-data-point method allows the user to use two known points to convert from one scale to another. For example, to convert from degrees Fahrenheit to degrees Celsius, enter two (2) known points, such as $32^{\circ}F = 0^{\circ}C$ and $0^{\circ}F = 17.77^{\circ}C$. The meter will automatically compute scale and offset and display the correct value.

MENU BUTTON MAIN MENU	MIN/MAX/MENU * BUTTON SUB MENU	DESCRIPTION
"RDG.CNF":	OOD WENT	READING CONFIGURATION
	"RDG.1=0" "RDG.1=1"	Reading Scale & Offset: Direct Format 2-Coordinate format
	<u>"RDG.2=0"</u> "RDG.2=1"	Decimal point effect: Active Independent
	<u>"RDG.3=0"</u> "RDG.3=1"	Display Brightness: Normal 50% of Normal
	"RDG.4=0" "RDG.4=1"	Leading Zeros on Display: Displayed Not Displayed
	"RDG.5=0" "RDG.5=1" "RDG.5=2"	Unit of Temperature: NOT USED WITH PROCESS
	<u>"RDG.6=0"</u> "RDG.6=1"	Reading Scale & Offset Functions: Disables Reading Scale and Offset (RDG SC=1.0, RDG OF=0.0) Enables Reading Scale and Offset (Uses scale and offset values entered by user)
	<u>"RDG.7=0"</u> "RDG.7=1"	Resetting Mode: Grounding P2-5 causes Hard Reset (RESET 2) Grounding P2-5 causes Peak/Valley (HI/LO) Reset

^{*} The **'MIN'** button allows you to sequence through RDG.1, RDG.2, RDG.3, RDG.4, RDG.5, RDG.6, and RDG.7.

The 'MAX' button allows you to select the "0" or "1" state for each "RDG" condition.

The 'MENU' button stores the selected values for all "RDG.CNF" condition(s) changed and advances the meter to "RD SC". Do not press the 'MENU' button after each change within the submenu or the meter will advance to the next menu item.

Every underlined "0" or "1" state is the factory preset value.

9.2.3 RDG SC (Reading Scale) And RDG OF (Reading Offset)

Typically, this would be used only when you cannot connect a known load to your meter, you require a display with 3 or more positions to the right of the decimal point position, you have scaled your meter using Input Scale and Offset ("IN.SC.OF") and want to enter a constant multiplying factor, or you have an extremely large offset.

If "RDG.1=0" were chosen, then you go automatically into "RDG SC" and "RDG OF" where:

"RDG SC" is reading scale from -99999 to +499999 where you set the display to "1.00000" and "RDG OF" is reading offset from -99999 to 999999 when you set the display to "000000".

When "RDG SC" is displayed, press the 'MIN' button to see the previously-set value. Process measurement scale is set to "1.00000" using the 'MIN/MAX' buttons. Store by pressing the 'MENU' button.

For "RDG OF", you may choose to enter a reference temperature offset here (e.g., "-100.00") so that the display will read deviation of the input from the boiling point (or some other temperature).

If "RDG.1 = 1" were chosen, then you go automatically into "RD.SC.OF".



Direct reading offset "RDG OF" now has programmable decimal point position. This makes the decimal point independent of the display decimal point and allows larger offset values.

MENU BUTTON MAIN MENU	MIN/MAX* BUTTON SUB MENU 1	MIN/MAX /MENU** BUTTON SUB MENU 2	DESCRIPTION
"RD.SC.OF":			READING SCALE & OFFSET
	INPUT 1		Item #1 of Coordinate #1
		000000. (<u>"00000.0"</u>)	Enter the first value displayed by the meter.
	READ 1		Item #2 of Coordinate #1.
		000000. (<u>"00000.0"</u>)	Enter first desired value.
	INPUT 2		Item #1 of Coordinate #2.
		000000. (<u>"10000.0"</u>)	Enter the second value displayed by the meter.
	READ 2		Item #2 of Coordinate #2.
		000000. (<u>"10000.0"</u>)	Enter second desired value.

^{*} The 'MIN' button allows you to sequence through "INPUT 1", "READ 1", "INPUT 2", and "READ 2" headings.

The 'MAX' button sends you to the value corresponding to "INPUT 1", "READ 1", "INPUT 2", or "READ 2" so you can change it (go to the SUB MENU 2 item).

** The 'MIN' button allows you to step through the digits of the applicable number being changed.

The 'MAX' button changes the value of the digit to be displayed.

The 'MENU' button stores the selected values for each input required in "RD.SC.OF". After the last value ("READ 2") has been entered and the 'MENU' button is pressed, the meter display will advance to "IN CNF".

Every underlined item is the factory preset value.



Meter now stores all scale and offset values for "IN.SC.OF", "RD.SC.OF", and "OT.SC.OF".

The meter will display previously input values when entering these menus. If system decimal point changes, all values will be modified accordingly; if overflow occurs meter will flash that parameter with 999999.

9.2.4 IN CNF (Input Configuration)

Input configuration is used to select:

- 50 or 60 Hz line frequency [INP.1]
- slow or fast read rate [INP.2]
- unipolar or bipolar inputs
- cold junction compensation [INP.5]

INP.1 and INP.2 are related to each other. If your power requirements require 50 Hz, you can have optimum integration in FAST read mode (12/sec). In the FAST mode, you need a jumper in the S1A position on the vertical Signal Input Board. If you set the SLOW read rate, this jumper should be removed to avoid overloading the integrator. SLOW read rate produces less noise.

MENU BUTTON	MIN/MAX /MENU * BUTTON	
MAIN MENU		DESCRIPTION
"IN CNF":		INPUT CONFIGURATIONS
	" <u>INP.1=0</u> " "INP.1=1"	Line Frequency: 60 Hz 50 Hz
	" <u>INP.2=0</u> " "INP.2=1"	Read Rate: Slow Fast
	" <u>INP.3=0</u> " "INP.3=1"	Input Voltage: Unipolar Bipolar
	"INP.4=0" "INP.4=1" "INP.4=2"	Transmitter Type: No Transmitter Not used Not used
	" <u>INP.5=0</u> " "INP.5=1"	Process Mode: Must be set to this bit Not Used
	" <u>INP.6=0</u> " "INP.6=1"	IN.SC.OF: Disabled Enabled
		Type of Reading: (not used for Temperature, set "INP.7 = 0")
	" <u>INP.7=0</u> " "INP.7=1"	Non Ratiometric Not used

9

* The 'MIN' button allows you to sequence through INP.1, INP.2, INP.3, INP.4, INP.5, INP.6, and INP.7.

The 'MAX' button allows you to select the "0" or "1" state for each "INP" condition.

The 'MENU' button stores the selected values for all "IN CNF" condition(s) changed and advances the meter to "IN.SC.OF". Do not press the 'MENU' button after each change within the submenu or the meter will advance to the next menu item.

Every underlined "0" or "1" state is the factory preset value.

9.2.5 IN.SC.OF (Input Scale and Offset)

Refer to Section 8 for a detailed discussion of this feature.

Input scale and offset is typically used when you want to scale your meter (using two input data points):

MENU BUTTON MAIN MENU	MIN/MAX * BUTTON SUB MENU 1	MIN/MAX/ MENU ** BUTTON SUB MENU 2	DESCRIPTION
"IN.SC.OF":	SOB WIENU I	30B WENU 2	INPUT SCALE OFFSET
114.00.01			Input scale and offset in
			2-Coordinate Format
	INPUT 1		Item #1 of Coordinate #1.
		000000. (" <u>000000.</u> ")	Enter the first value displayed by the meter.
	READ 1		Item #2 of Coordinate #1.
		000000. (" <u>000000.</u> ")	Enter first desired value.
	INPUT 2		Item #1 of Coordinate #2.
		000000. (" <u>100000.</u> ")	Enter the second value displayed by the meter.
	READ 2		Item #2 of Coordinate #2.
		000000. (" <u>100000.</u> ")	Enter second desired value.

^{*} The 'MIN' button allows you to sequence through "INPUT 1", "READ 1", "INPUT 2", and "READ 2" headings.

The 'MAX' button sends you to the value that corresponds to "INPUT 1", "READ 1", "INPUT 2", or "READ 2" so you can change it (go to the SUB MENU 2 item).

9

Meter Function Menus

** The 'MIN' button allows you to sequence through the digits of the applicable number being changed.

The 'MAX' button changes the value of the digit to be displayed.

The 'MENU' button stores the selected values for each input required in "IN.SC.OF". After the last value ("READ 2") has been entered and the 'MENU' button is pressed, the meter display will advance to "DEC PT".

Pressing the '**MENU**' button allows you go to the next SUB MENU 1 item automatically.

After changing the last value at the bottom of the chart, pressing the 'MENU' button once more stores everything that was changed and advances the meter to the next configuration ("DEC PT").

Every underlined item is the factory preset value.

9.2.6 DEC PT (Decimal Point)

Refer to Section 8 for a detailed discussion of this feature.

Decimal point is used to select the resolution of your meter display such as in one degree, tenths of a degree, hundredths of a degree or more.

If "ERR 01" is displayed, check that "RDG OF" is within the display range.

MENU BUTTON	MIN/MAX/MENU * BUTTON	
MAIN MENU	CONDITION	DESCRIPTION
"DEC PT":		DECIMAL POINT POSITION
	"FFFFF." "FFFF.FF" "FF.FFF" "F.FFFF"	Position 1 Position 2 Position 3 Position 4 Position 5 Position 6

^{*} Press the 'MIN' button to show all "F's" on the display.

Press the 'MAX' button to move the decimal point.

Press the '**MENU**' button to store the decimal point location and the meter will advance to "CNT BY".

The underlined item is the factory preset value.

9.2.7 CNT BY (Count By)

Count by is used to round off the meter values by 1's, 2's, 5's, 10's, 20's, 50's, or 100's. This feature is normally set to "001" so that the display shows all possible values for the least-significant digit.

If the combination of input-signal noise and selected resolution is high, however, your meter can round off the display to the nearest 2, 5, 10, 20, 50 or even 100 digits. This can eliminate annoying display jitter without introducing any filter time delays.

MENU BUTTON MAIN MENU	MIN/MAX/MENU * BUTTON SUB MENU	DESCRIPTION
"CNT BY":		COUNT BY ROUNDING OFF THE VALUE
	"001" "002" "005" "010" "020" "050" "100"	(the decimal point position is ignored)

^{*} Press the 'MIN' button to show "001", "002", "005", "010", "020", "050", or "100".

Press the 'MAX' button to select one of the above.

Press the 'MENU' button to store the Count By number and the meter will advance to "FIL.CNF".

The underlined item is the factory preset value.

9

9.2.8 FIL.CNF (Filter Configuration)

Filter configuration is used to select:

- Adaptive Bandwidth Control (ABC) filtering or moving average filter [FIL.1]
- whether the value displayed on the meter is filtered or unfiltered [FIL.2]
- whether the value sent to the optional analog output is filtered or unfiltered [FIL.3]

"FIL.1=0" for Adaptive Bandwidth Control (ABC filtering, which averages over a larger number of samples when the input is not moving, but drops down to no averaging for systematic input changes). "FIL.1=1" is for averaging over a fixed number of samples. The number of samples to be used is selected in "FIL TI".

"FIL.3=0" removes the selected filtering from the analog output (if that option is installed in your meter). "FIL.3=1" puts the selected filtering on that output. Usually you choose "FIL.3=0", relying on the signal conditioning available at the device receiving the analog output data.

MENU BUTTON MAIN MENU	MIN/MAX/ MENU * BUTTON SUB MENU	DESCRIPTION
"FIL.CNF":		FILTER CONFIGURATION
	" <u>FIL.1=0</u> " "FIL.1=1"	Filter Type: ABC Filter Moving Average Filter
	"FIL.2=0" " <u>FIL.2=1</u> "	Value to be displayed: Unfiltered Filtered
	"FIL.3=0" " <u>FIL.3=1</u> " "FIL.3=2" "FIL.3=3"	Value to be transmitted on Analog Output: Unfiltered Filtered Peak value Valley value

The 'MIN' button allows you to sequence through FIL.1, FIL.2, and FIL.3.

The 'MAX' button allows you to select the "0", "1", "2", or "3" state for each "FIL" condition.

The 'MENU' button stores the selected values for all "FIL.CNF" condition(s) changed and advances the meter to "FIL TI". Do not press the 'MENU' button after each change within the submenu or the meter will advance to the next menu item.

Adaptive Bandwidth Control takes the average of the samples except when the input is rapidly changing. Patent applied for.

Every underlined "0", "1", "2", or "3" is the factory preset value.

9.2.9 FIL TI (Filter Time Constant)

Filter time constant is used to determine the number of readings the meter will average before displaying an input value. The choices are 001, 002, 004, 008, 016, 032, 064, or 128.

For fixed filtering, the averaged number of samples is fixed; for Automatic Bandwidth Control, the chosen value is the maximum number of samples in the average computed by ABC when the input is not changing significantly (ABC, for slowly-moving signals, filters by averaging the "TI" number of samples, but follows signal changes rapidly by decreasing that averaging number).

Pressing the **'MENU'** button stores your selection and moves on to "RESET 1" and then to "RUN" (unless setpoints, outputs, or communications have been unlocked for programming change)

MENU BUTTON MAIN MENU	MIN/MAX/MENU * BUTTON SUB MENU	DESCRIPTION
"FIL TI":		FILTER TIME CONSTANT
	"001" "002" "004" "008" "016" "032" " <u>064</u> " "128"	Number of readings used in averaging.

^{*} Press the 'MIN' button to show "001", "002", "004", "008", "016", "032", "064" or "128".

Press the 'MAX' button to select one of the above.

Press the '**MENU**' button to store the selection made and to advance the meter to the next menu ("SP CNF").

The underlined item is the factory preset value.

9.2.10 SP CNF (Setpoints 1 & 2 Configuration)

Refer to Section 10 for an in-depth discussion of these features.

Setpoint configuration is used to select:

- the active zone of each setpoint to above and below the setting [SPC.1 & SPC.4]
- whether the open-collector output is on or off [SPC.2 & SPC.5]
- whether the reading compared with the setpoints is filtered or unfiltered [SPC.3 & SPC.6]
- enabled or disabled setpoints [SPC.7]
- enabled or disabled setpoint LED displays [SPC.8]

MENU	MIN/MAX/MENU *	
BUTTON MAIN MENU	BUTTON	DESCRIPTION
"SP CNF":		SETPOINTS 1 & 2 CONFIGURATIONS
	" <u>SPC.1=0</u> " "SPC.1=1"	Setpoint 1 Active Zone: Above Below
	" <u>SPC.2=0</u> " "SPC.2=1"	Setpoint 1 open-collector or relay output Active ON or OFF: On Off
	"SPC.3=0" " <u>SPC.3=1</u> "	Filtered/unfiltered reading compared with Setpoint 1 value: Unfiltered Filtered
	" <u>SPC.4=0</u> " "SPC.4=1"	Setpoint 2 Active zone: Above Below
	" <u>SPC.5=0</u> " "SPC.5=1"	Setpoint 2 open-collector or relay output Active ON or OFF: On Off
	"SPC.6=0" " <u>SPC.6=1</u> "	Filtered/unfiltered reading compared with Setpoint 2 value: Unfiltered Filtered
	" <u>SPC.7=0</u> " "SPC.7=1"	Setpoints 1 & 2 action: Enabled Disabled
,	" <u>SPC.8=0</u> " "SPC.8=1"	Setpoint 1 & 2 LEDs action: Enabled Disabled

* The 'MIN' button allows you to sequence through SPC.1, SPC.2, SPC.3, SPC.4, SPC.5, SPC.6, SPC.7 and SPC.8.

The 'MAX' button allows you to select the "0" or "1" state for each "SPC" condition.

The 'MENU' button stores the selected values for each "SPC" condition changed and advances the meter to the next configuration ("AL CNF").

Every underlined "0" or "1" is the factory preset value.

9.2.11 AL CNF (Alarm Configuration)

Refer to Section 10 for an in-depth discussion of these features.

Alarm configuration is used to select:

- the active zone for each alarm point to above or below the setting [ALC.1 & ALC.4]
- whether the open-collector output is on or off [ALC.2 & ALC.5]
- whether the readings compared with the alarm points are filtered or unfiltered [ALC.3 & ALC.6]
- enabled or disabled alarm points [ALC.7]

MENU BUTTON MAIN MENU	MIN/MAX/MENU * BUTTON SUB MENU	DESCRIPTION
"AL CNF":		ALARMS 1 & 2 (SETPOINTS 3 & 4) CONFIGURATIONS
	" <u>ALC.1=0</u> " "ALC.1=1"	Alarm 1 Active zone (Setpoint 3): Above Below
	" <u>ALC.2=0</u> " "ALC.2=1"	Alarm 1 open-collector or relay output Active ON or OFF: On Off
	"ALC.3=0" " <u>ALC.3=1</u> "	Filtered/unfiltered reading compared with Alarm 1 (Setpoint 3) value: Unfiltered Filtered
	" <u>ALC.4=0</u> " "ALC.4=1"	Alarm 2 Active zone (Setpoint 4): Above Below

MENU BUTTON MAIN MENU	MIN/MAX/MENU * BUTTON SUB MENU	DESCRIPTION
	" <u>ALC.5=0</u> " "ALC.5=1"	Alarm 2 open-collector or relay output Active ON or OFF: On Off
	"ALC.6=0" " <u>ALC.6=1</u> "	Filtered/unfiltered reading compared with Alarm 2 (Setpoint 4) value: Unfiltered Filtered
	" <u>ALC.7=0</u> " "ALC.7=1"	Alarms 1 & 2 (Setpoints 3 & 4) action and LEDs: Enabled Disabled
	" <u>ALC.8=0</u> " "ALC.8=1"	Alarm reset at P2-11 connector: Disabled Enabled

^{*} The 'MIN' button allows you to sequence through ALC.1, ALC.2, ALC.3, ALC.4, ALC.5, ALC.6, ALC.7 and ALC.8.

The **'MAX'** button allows you to select the "0" or "1" state for each "ALC" condition. The **'MENU'** button stores the selected values for each "ALC" condition changed and advances the meter to the next configuration ("AL FNC").

Every underlined "0" or "1" is the factory preset value.

9.2.12 AL FNC (Alarm Function)

Refer to Section 10 for an in-depth discussion of these features.

Alarm function is used to select:

- whether the alarms are used in the process, high-deviation, low-deviation or band deviation modes [ALF.1 & ALF.3]
- whether or not to latch the alarms [ALF.2 & ALF.4]

MENU BUTTON	MIN/MAX/MENU * BUTTON	
MAIN MENU		DESCRIPTION
"AL FNC":		ALARMS 1 & 2 FUNCTION
	"ALF.1=0" "ALF.1=1" "ALF.1=2" "ALF.1=3"	Alarm 1 State: Process Mode High Deviation Mode Low Deviation Mode Band Deviation Mode
	" <u>ALF.2=0</u> " "ALF.2=1"	Alarm 1 Latch Action: Unlatched Latched
	" <u>ALF.3=0</u> "	Alarm 2 State: Process Mode. Process Mode means the deadband is equally above and below the setpoint.
	"ALF.3=1" "ALF.3=2" "ALF.3=3"	High Deviation Mode Low Deviation Mode Band Deviation Mode
	" <u>ALF.4=0</u> " "ALF.4=1"	Alarm 2 Latch Action: Unlatched Latched

^{*} The 'MIN' button allows you to sequence through ALF.1, ALF.2, ALF.3 and ALF.4.

The 'MAX' button allows you to select the "0", "1", "2", or "3" state for each "ALF" condition.

The 'MENU' button stores the selected values for each "ALF" condition changed and advances the meter to the next configuration ("AL RDG").

Every underlined item is the factory preset value.

9.2.13 AL RDG (Alarm Readings)

Refer to Section 10 for an in-depth discussion of these features.

Alarm reading is used to select the number of readings (from 01 to 15) the meter must make prior to activating the alarms.

MENU BUTTON MAIN MENU	MIN/MAX/MENU * BUTTON SUB MENU	DESCRIPTION
"AL RDG":		ALARM NUMBER OF READINGS
	"00 00" (" <u>03 03</u> ")	Number of readings to delay activation of Alarms 1 & 2 (from "01" to "15") (AL1), (AL2)

* Press the 'MIN' button to show the current number of readings on the display (left pair of digits are flashing).

The 'MAX' button is used to change the value of the flashing digits (from 01 to 15).

Pressing the 'MIN' button allows you go to the second set of digits.

The 'MAX' button is used to change the value of the flashing digits.

After changing the last number, if necessary, pressing the 'MENU' button stores everything that was changed and advances the meter to the next configuration ("SP DB").

The underlined item is the factory preset value.

9.2.14 SP DB (Setpoint Deadband)

Refer to Section 10 for an in-depth discussion of these features.

Setpoint deadband is used to select the amount of hysteresis for the setpoints (programmable from "0000" to "9999").

MENU BUTTON MAIN MENU	MIN/MAX/MENU * BUTTON SUB MENU	DESCRIPTION
"SP DB":		SETPOINTS 1 & 2 DEADBAND
	"0000" (" <u>0020</u> ")	Hysteresis for (w/system decimal points) Setpoints1 and 2 (Programmable from"0000" to "9999")

^{*} Press the 'MIN' button to show the value on the display.

The 'MIN' button also allows you to sequence through the digits of the number being changed.

The 'MAX' button changes the value of the digit to be displayed.

The 'MENU' button stores the selected values for each "SP DB" condition changed and advances the meter to the next configuration ("AL DB"):

The underlined item is the factory preset value.

9.2.15 AL DB (Alarm Deadband)

Refer to Section 10 for an in-depth discussion of these features.

Alarm deadband is used to select the amount of hysteresis for the alarms (programmable from "0000" to "9999").

MENU BUTTON MAIN MENU	MIN/MAX/MENU * BUTTON SUB MENU	DESCRIPTION
"AL DB":		ALARMS 1 & 2 DEADBAND
	"0000" (" <u>0020</u> ")	Hysteresis for (w/System decimal points) Alarms 1 & 2 (Programmable from "0000" to "9999")

^{*} Press the 'MIN' button to show the value on the display.

The 'MIN' button also allows you to sequence through the digits of the number being changed.

The 'MAX' button changes the value of the digit to be displayed.

Press the '**MENU**' button to store the changes and advances the meter to the next configuration ("OUT.CNF").

The underlined item is the factory preset value.

9.2.16 OUT.CNF (Output Configuration)

Output configuration is used to select:

- whether or not to send data to the optional analog output board [OUT.1]
- the analog output signal of 0-10 V dc or 4-20 mA DC [OUT.2]
- whether or not to send data to the optional BCD output board [OUT.3]
- to send peak value via the optional BCD output board [OUT.4]
- to select type of BCD output [OUT.5]
- enable or disable the flashing display [OUT.6]

MENU BUTTON	MIN/MAX/MENU * BUTTON	
MAIN MENU	SUB MENU	DESCRIPTION
"OUT.CNF":		OUTPUT CONFIGURATION
	" <u>OUT.1=0</u> " "OUT.1=1"	Data on the Analog Output Board: Disabled Enabled
	"OUT.2=0" " <u>OUT.2=1</u> "	Analog Output Mode: 0-1 V, 0-5 V, 1-5 V, 0-10 V 0-20 mA or 4-20 mA
	" <u>OUT.3=0</u> " "OUT.3=1"	Data out on Parallel BCD Board: Disabled Enabled
	" <u>OUT.4=0</u> " "OUT.4=1"	Type of data out on BCD Board: Display Peak
	"OUT.5=0" " <u>OUT.5=1</u> "	BCD Output: Used for standard parallel printers. Used for Specialty printers.
	"OUT.6=0" "OUT.6=1" "OUT.6=2" "OUT.6=3" "OUT.6=4" "OUT.6=5"	Type of Display Flashing: Disabled - display flashing. SP1 active - display flashing. SP2 active - display flashing. SP3 active - display flashing. SP4 active - display flashing. any SP active - display flashing.

^{*} The 'MIN' button allows you to sequence through OUT.1, OUT.2, OUT.3, OUT.4, OUT.5, and OUT.6.

The 'MAX' button allows you to select the "0", "1", "2", "3", "4" or "5" state for each "OUT" condition.

The 'MENU' button stores the selected values for each "OUT" condition changed and advances the meter to the next configuration ("OT.SC.OF").

Every underlined item is the factory preset value.

9.2.17 OT.SC.OF (Output Scale and Offset)

Output scale and offset is used to calibrate your optional analog output to correspond to the engineering units you desire.

MENU BUTTON MAIN MENU	MIN/MAX * BUTTON SUB MENU 1	MIN/MAX/ MENU ** BUTTON SUB MENU 2	DESCRIPTION
"OT.SC.OF":			OUTPUT SCALE & OFFSET
	READ 1		Item #1 of Coordinate #1.
		000000. (" <u>000000."</u>)	Enter the first value displayed by the meter.
	OUTPT1		Item #2 of Coordinate #1.
		00.0000 (" <u>04.0000</u> ")	Enter first desired output value.
	READ 2		Item #1 of Coordinate #2.
		000000. (" <u>100000.</u> ")	Enter the second value displayed by the meter.
	OUTPT2		Item #2 of Coordinate #2.
		00.0000 (" <u>20.0000</u> ")	Enter second desired output value.

^{*} The 'MIN' button allows you to sequence through "READ 1", "OUTPT1", "READ 2", and "OUTPT2" headings.

The 'MAX' button sends you to the value corresponding to "READ 1", "OUTPT1", "READ 2", and "OUTPT2" so you can change it (go to the SUB MENU 2 item).

The 'MAX' button changes the value of the digit to be displayed.

The 'MENU' button stores the selected values for each input required in "OT.SC.OF". After the last value ("READ 2") has been entered and the 'MENU' button is pressed, the meter display will advance to "BAUD".

Every underlined item is the factory preset value.

^{**} The 'MIN' button allows you to step through the digits of the applicable number being changed.

9.2.18 BAUD (Baud Rate)

Baud is used to select the baud rate for communication via the optional RS-232 or RS-485 communications boards. The choices are 300, 600, 1200, 2400, 4800, 9600, and 19200.

MENU BUTTON MAIN MENU	MIN/MAX/MENU * BUTTON SUB MENU	DESCRIPTION
"BAUD":	"00300" "00600" "01200" "02400" "04800" "09600" "19200"	Select baud rate for communications via RS-232 or RS-485

^{*} Press the 'MIN' button to show "00300", "00600", "01200", "02400", "04800", "09600", or "19200".

Press the 'MAX' button to select one of the above.

Press the '**MENU**' button to store the changes and the meter advances to the next configuration ("SERCNF").

The underlined item is the factory preset value.

9.2.19 SERCNF (Serial Communication Configuration)

Serial communication configuration is used to select:

- no parity, odd parity, or even parity for communications [SER.1]
- 1 stop bit or 2 stop bits [SER.2]
- No parity, 1 stop is not allowed

MENU BUTTON	MIN/MAX/MENU * BUTTON	
MAIN MENU	SUB MENU	DESCRIPTION
"SERCNF":		SERIAL COMMUNICATION CONFIGURATION
	"SER.1=0" "SER.1=1" "SER.1=2"	Select parity for communications via RS-232 or RS-485: No parity Odd parity Even parity
	"SER.2=0" "SER.2=1"	Select stop bits for communications via RS-232 or RS-485: 1 Stop Bit 2 Stop Bits

^{*} The 'MIN' button allows you to toggle between SER.1 and SER.2.

The 'MAX' button allows you to select the "0", "1", or "2" state for each "SER" condition.

The 'MENU' button stores the selected values for each "SER" condition changed and advances the meter to the next configuration ("ADDRES").

Every underlined "0", "1" or "2" is the factory preset value.



9.2.20 ADDRESS (Multipoint Communications Device Address)

Address is used to give each meter a unique address while on a local area network using the optional RS-485 board.

MENU BUTTON MAIN MENU	MIN/MAX/MENU * BUTTON SUB MENU	DESCRIPTION
"ADDRES":		MULTIPOINT COMMUNICATIONS DEVICE ADDRESS
	"000" (" <u>001</u> ")	Enter address as an integer value: "000" to "199"

^{*} Press the 'MIN' button to show the value on the display.

The 'MIN' button also allows you to change the position of the digit being changed.

The 'MAX' button changes the value of the digit to be displayed.

Press the '**MENU**' button to store the changes and advances the meter to the next configuration ("DAT FT").

The underlined item is the factory preset value.

9.2.21 DAT FT (Data Format)

Data format is used to set all the parameters to be transmitted via the optional RS-232 or RS-485 serial communications board. Data format allows you to select:

- whether to transmit Alarm 1 or 2 status character [DAT.1]
- whether to transmit peak and valley status character [DAT.2]
- whether or not the data transmitted is filtered or unfiltered [DAT.3 & DAT.4]
- whether or not to transmit the peak and valley readings [DAT.5 & DAT.6]
- the type of separator [DAT.7]
- whether or not to transmit the unit of measure [DAT.8]

MENU BUTTON	MIN/MAX/MENU * BUTTON	
MAIN MENU	SUB MENU	DESCRIPTION
"DAT FT":		DATA FORMAT
	" <u>DAT.1=0"</u> "DAT.1=1"	Alarms 1 & 2 Status Character: Excluded Included
	" <u>DAT.2=0"</u> "DAT.2=1"	HI/LO (Peak/Valley) Status Character: Excluded Included
	"DAT.3=0" " <u>DAT.3=1</u> "	Filtered Value to be transmitted: No Yes
	" <u>DAT.4=0"</u> "DAT.4=1"	Filtered value to be transmitted: No Yes
	" <u>DAT.5=0</u> " "DAT.5=1"	Peak value to be transmitted: No Yes
	" <u>DAT.6=0"</u> "DAT.6=1"	Valley value to be transmitted: No Yes
	" <u>DAT.7=0"</u> "DAT.7=1"	Separator for above items: Space <cr></cr>
	" <u>DAT.8=0</u> " "DAT.8=1"	Unit of measurement to be transmitted: No Yes

^{*} The 'MIN' button allows you to sequence through DAT.1, DAT.2, DAT.3, DAT.4, DAT.5, DAT.6, DAT.7, and DAT.8.

The 'MAX' button allows you to select the "0" or "1" state for each "DAT" condition.

The 'MENU' button stores the selected values for each "DAT" condition changed and advances the meter to the next configuration ("BUS FT").

Every underlined "0" or "1" is the factory preset value.

9.2.22 BUS FT (Bus Format)

Bus format is to select:

- whether or not to include check sum with reading [BUS.1]
- whether or not to include line feeds [BUS.2]
- whether or not to have the meter respond in echo mode [BUS.3]
- multipoint or point-to-point mode [BUS.4]
- (if in point-to-point mode) select whether to communicate continuously or on command [BUS.5]
- whether a message character is used in handshake or continuous mode [BUS.6]
- whether or not you have installed the RS-485 board [BUS.7]
- whether or not to enable the external print command at P2-11.

MENU BUTTON	MIN/MAX/MENU * BUTTON	
MAIN MENU		DESCRIPTION
"BUS FT":		BUS FORMAT
	" <u>BUS.1=0</u> " "BUS.1=1"	Check sum with reading: Excluded Included
	" <u>BUS.2=0</u> " "BUS.2=1"	Line feed following all <cr>'s: Excluded Included</cr>
	"BUS.3=0" " <u>BUS.3=1</u> "	Response from the meter (echo): No Yes
	" <u>BUS.4=0</u> " "BUS.4=1"	Point to Point mode or Multipoint mode: Pt-Pt Multi-Pt
	"BUS.5=0" " <u>BUS.5=1</u> "	Point-to-Point mode only: Continuous On Command
	" <u>BUS.6=0</u> " "BUS.6=1"	Handshake if continuous mode: Message Character
	" <u>BUS.7=0</u> " "BUS.7=1"	RS-485 Board installed?: Not installed Installed
	"BUS.8=0" " <u>BUS.8=1</u> "	Print Command at P2-11: Disabled Enabled

* The 'MIN' button allows you to sequence through BUS.1, BUS.2, BUS.3, BUS.4, BUS.5, BUS.6, BUS.7 and BUS.8.

The 'MAX' button allows you to select the "0" or "1" state for each "BUS" condition.

The 'MENU' button stores the selected values for each "BUS" condition changed and advances the meter to the next configuration ("SERCNT").

Every underlined "0" or "1" state is the factory preset value.

9.2.23 SERCNT (Serial Count)

Serial count is used to program the number of readings the meter must take (programmable from "00001" to "59,999") between transmissions of data via the optional RS-232 or RS-485 serial communications board.

Once you are done with the changes, press the 'MENU' button to display the normal operating display. The meter advances to run mode showing the currently measured values. Pressing the 'RESET' button two times allows you to return to the run mode.

MENU BUTTON MAIN MENU	MIN/MAX/MENU * BUTTON SUB MENU	DESCRIPTION
"SERCNT":		SERIAL COUNT
	"00000" (<u>"00001"</u>)	This specifies the number of readings between data transmissions: "00001" to "59999"

* Press the 'MIN' button to show the value on the display.

The 'MIN' button also allows you to change the position of the digit being changed.

The 'MAX' button changes the value of the digit to be displayed.

Press the 'MENU' button to store the changes and advances the meter to "RESET 2" and returns to the run mode.

The underlined item is the factory preset value.



NOTE: After you complete your programming you may want to go back and remove the jumper in S3A position on the main board to insure against any unauthorized changes.

9.2.24 ANALOG OUTPUT CALIBRATION NUMBERS

The analog output calibration numbers (see Figure 12-1) are printed on the optional analog output board. These four numbers (CAL VZ, CAL VS, CAL mAS), must be entered into the meter to ensure that the analog output board is calibrated with the microprocessor.

MENU BUTTON	MIN/MAX/MENU * BUTTON	
MAIN MENU	SUB MENU	DESCRIPTION
"CAL VZ"	0 to 59999	Calibration number marked on the analog output board must be entered for voltage zero.
"CAL VS"	0 to 59999	Calibration number marked on the analog output board must be entered for voltage span.
"CAL mAZ"	0 to 59999	Calibration number marked on the analog output board must be entered for current zero.
"CAL mAs"	0 to 59999	Calibration number marked on the analog output board must be entered for current span.



NOTE: After you complete your programming you may want to go back and remove the jumper in S3A position on the main board to insure against any unauthorized changes.

Once you are done with the changes, press the 'MENU' button to display. The meter advances to run mode showing the currently measured values.

Setpoints/Alarms

SETPOINTS/ALARMS

Setpoints 1 through 4 can be configured for a very large variety of zone and level signalling.

SP1 and SP2 have balanced configurable hysteresis and are non-latching, suitable for control-level signalling. SP3 and SP4 are often used as ALarm 1 and ALarm 2, because they have single-sided hysteresis and can be configured for latching action.

The levels of these setpoints are entered during run mode via the front-panel pushbuttons (refer to Section 10.11). Many performance options are entered during the configuration mode (refer to Sections 10.2 through 10.10).

10.1 FEATURES OVERVIEW

- 1. Four full-range levels with many menu programmable features.
- 2. Independent operation or ganged action (including guard-band assignments).
- Active above or below level, outside or inside band.
- 4. SP1 and SP2 have configurable hysteresis, 50% on either side of setpoint.
- 5. SP3 and SP4 have configurable hysteresis, 100% on inactive side.
- 6. SP3 and SP4 is configurable for latching action.
- Setpoint levels can be compared to the unfiltered or filtered input signal measurements.
- 8. Configurable delays in alarm action.
- 9. Individual front-panel LED indicators.
- 10. Four (4) open-collector transistor outputs with clamping diodes, are isolated from signal input.
- Setpoints can be displayed and reset as desired without interrupting measurements.

Setpoints 1 and 2 have selectable hysteresis, allocated 50% on either side of the setpoint level. A single setpoint can now generate on/off control signals for an operating region defined by the hysteresis. Refer to Figures 10-1 and 10-2 to understand how hysteresis works:

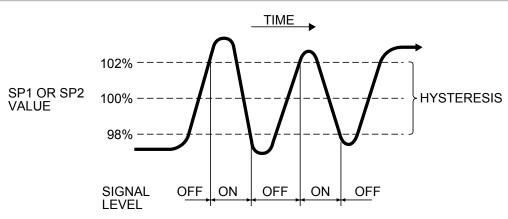


Figure 10-1. Setpoints 1 & 2 Action (Setpoint at 100 with 4% hysteresis)

These two setpoints have selectable single-sided hysteresis. When used as alarms, the action is immediate (unless a delay is programmed) going into the alarm zone but turning off is deferred (if latching is not programmed) by the hysteresis amount.

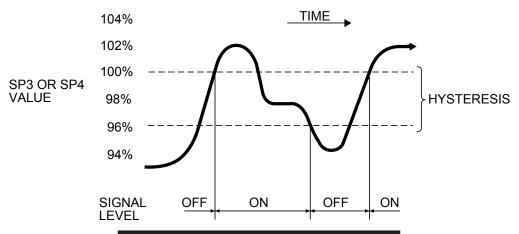


Figure 10-2. Setpoints 3 & 4 Action

(for Low Alarm with Relay on at -100, relay off at -96 with a hysteresis of 4)

You are now able to program the setpoint features (as described in the following sections).

Setpoints/Alarms

10.2 UNLOCKING THE FEATURES

All setpoint values and features can be set via the front-panel buttons or the optional serial communications boards (RS-232 or RS-422/485). Control from the front-panel buttons can be locked out by jumpers on S3A and S3C on the main board or by setting lockout bits "L3C.2", and "L3C.6" in Lockout configuration "L3 CNF".

1. Check that main board jumpers S3A and S3C are installed (to permit memory storage of program and data along with button controls).



NOTE: Jumper S3B should NOT be installed. This jumper is reserved for factory recalibration!

- 2. Press the 'MENU' button to see "L1 CNF" and then press the 'MIN' button to view "L1C.1=0" if "SP 1" is unlocked. If "L1C.1=1", change to equal "0" by pressing the 'MAX' button.
- Press the 'MIN' button again to advance to "L1C.2" and set equal to "0" to unlock "SP 2".
- 4. Repeat for "L1C.3=0" and "L1C.4=0" to access "SP 3" and "SP 4".
- Press the 'MENU' button to save these choices and advance to "L2 CNF". Skip over "L2 CNF" by pressing the 'MENU' button and advance to "L3 CNF".
- 6. Press the 'MIN' and 'MAX' buttons to set "L3C.2=0", "L3C.3=0", "L3C.4=0", "L3C.5=0", "L3C.6=0", "L3C.7=0" to gain access to the programming for the setpoints. All changes are then saved by pressing the 'MENU' button.

10.3 SELECTING "SP CNF" SETPOINT CONFIGURATION FEATURES

These eight bits select the modes for "SP 1" and "SP 2" (see Section 10.5 for "SP 3" and "SP 4").

- Press the 'MENU' button until "SP CNF" is displayed, then press the 'MIN' button to sequence through the selections. Use the 'MAX' button to choose alternate choice.
- "SPC.1=0" makes "SP 1" active ABOVE its level; "SPC.1=1" sets "SP 1" active BELOW.
- 3. "SPC.2=0" turns "SP 1" transistor ON when "SP 1" is active. "SPC.2=1" turns it OFF.
- "SPC.3=0" compares the "SP 1" level to the UNFILTERED measurements.
 "SPC.3=1" compares "SP 1" to the FILTERED measurements.
- "SPC.4=0" makes "SP 2" active ABOVE setpoint.
 "SPC.4=1" makes "SP 2" active BELOW setpoint.
- 6. "SPC.5=0" turns "SP 2" transistor ON when "SP 2" is active. "SPC.5=1" turns it OFF.

- 7. "SPC.6=0" compares the "SP 2" level to the UNFILTERED measurements.
 - "SPC.6=1" compares "SP 2" to the FILTERED measurements.
- 8. "SPC.7=0" Enables both setpoints 1 and 2.
 - "SPC.7=1" Disables both setpoints 1 and 2.
- "SPC.8=0" ENABLES the two front-panel LED indicators for setpoints 1 and 2 when you have chosen "SPC.7=0".
 - "SPC.8=1" DISABLES the two front-panel LED indicators for setpoints 1 and 2. (use with caution; recommended only when other external overrange indicators are present).
- 10. Press the '**MENU**' button to store your selections and advance to "AL CNF" (Alarm Configuration).

10.4 DEVIATION FUNCTION FOR ALARMS

Deviation functions apply to Alarms 1 and 2 (Setpoints 3 and 4) and act as buffer zones to control setpoint action. The Alarm 1 deviation is the sum of the Alarm 1 value plus the Setpoint 1 value; the Alarm 2 deviation is the Alarm 2 value plus the Setpoint 2 value. The four types of deviation functions are Process (no deviation), High, Low, and Deadband. The following illustrate the ways in which the deviation function alters the alarm response.

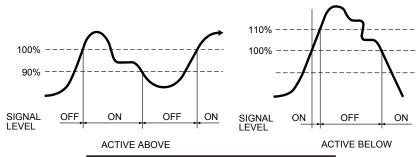


Figure 10-3. Process Deviation

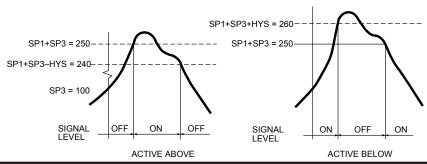


Figure 10-4. High Deviation for both Active Above and Active Below

Setpoints/Alarms

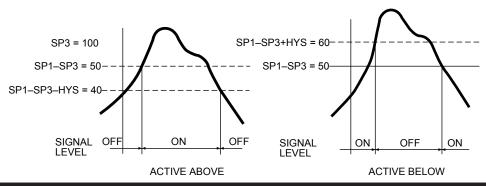


Figure 10-5. Low Deviation for both Active Above and Active Below

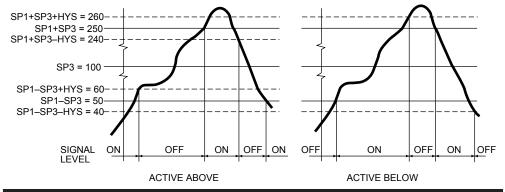


Figure 10-6. Band Deviation for both Active Above and Active Below

10.5 SELECTING "AL CNF" ALARM CONFIGURATION FEATURES

These bits offer the same selections for "SP 3" and "SP 4" as "SP CNF" did for "SP 1" and "SP 2", except for the last bit, which controls "SP 3" and "SP 4" LATCH reset.

1. "ALC.1=0" makes Alarm 1 (Setpoint 3) active above the Setpoint value.

"ALC.1=1" makes Alarm 1 (Setpoint 3) active below the Setpoint value.

When Alarm 1 (Setpoint 3) is assigned to place a band about the Setpoint 1 level (by setting "ALF.1=3", described in Section 10.6), "ALC.1=0" makes Alarm 1 (Setpoint 3) active ABOVE and BELOW the band (OUTSIDE the band), with the chosen hysteresis for Alarm 1 (Setpoint 3) now inside the band. If "ALC.1=1", Alarm 1 (Setpoint 3) is active INSIDE the band, with the chosen hysteresis for Alarm 1 (Setpoint 3) now outside the band.

Figure 10-7 Illustrates the Alarm configuration for hysteresis.

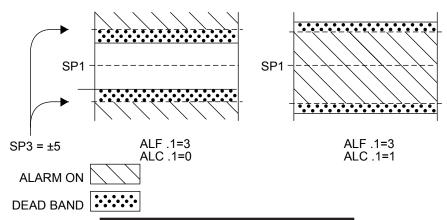


Figure 10-7. AL CNF Hysteresis

2.	"ALC.2=0"	turns the Alarm 1 (Setpoint 3) open-collector output ON
		when Setpoint 3 is active.

"ALC.2=1" turns it OFF.

3. "ALC.3=0" compares the Alarm 1 (Setpoint 3) level to the UNFILTERED measurements.

"ALC.3=1" compares the Alarm 1 (Setpoint 3) level to the FILTERED measurements.

4. "ALC.4=0" makes Alarm 2 (Setpoint 4) active ABOVE the Setpoint value.

"ALC.4=1" makes Alarm 2 (Setpoint 4) active BELOW the Setpoint value.

When Alarm 2 (Setpoint 4) is assigned to place a band about the Setpoint 4 level (by setting "ALF.1=3", described in Section 10.6), "ALC.4=0" makes Alarm 2 (Setpoint 4) active ABOVE and BELOW the band (OUTSIDE the band), with the chosen hysteresis for Alarm 2 (Setpoint 4) now inside the band. If "ALC.4=1", Alarm 2 (Setpoint 4) is active INSIDE the band, with the chosen hysteresis for Alarm 2 (Setpoint 4) now outside the band.

5.	"ALC.5=0"	turns the Alarm 2 (Setpoint 4) open-collector output ON when Setpoint 1 is active.
		which octpoint i io dotive.

"ALC.5=1" turns it OFF.

6. "ALC.6=0" compares the Alarm 2 (Setpoint 4) level to the UNFILTERED measurements.

"ALC.6=1" compares the Alarm 2 (Setpoint 4) level to the FILTERED measurements.

Setpoints/Alarms

7.	"ALC.7=0"	ENABLES both Alarms 1 and 2 (Setpoints 3 and 4) action and LEDs.
	"ALC.7=1"	DISABLES both Alarms 1 and 2 (Setpoints 3 and 4) action and LEDs.
8.	"ALC.8=0"	DISABLES Alarm reset at the P2-11 connector.
	"ALC.8=1"	ENABLES Alarm reset at the P2-11 connector.

Press the '**MENU**' button to store any changes and advance to "AL FNC" (Alarm Function).

10.6 SELECTING "AL FNC" ALARM FUNCTION FEATURES

This byte allows you to select independent or ganged operation for "SP 3" and "SP 4", and whether or not they should latch once triggered.

- 1. "ALF.1=0" makes Alarm 1 (Setpoint 3) INDEPENDENT, with a level equal to the value inserted for Setpoint 3.
 - "ALF.1=1" assigns Setpoint 3 ("SP 3") to Setpoint 1 ("SP 1"), placing it ABOVE Setpoint 1 ("SP 1") by the amount entered for Setpoint 3 ("SP 3").
 - "ALF.1=2" places "SP 3" BELOW "SP 1" by the amount entered for "SP 3".
 - "ALF.1=3" places "SP 3" ON BOTH SIDES OF "SP 1" by the amount entered for "SP 3".
- 2. "ALF.2=0" makes Alarm 1 (Setpoint 3) a NON-LATCHING Alarm.
 - "ALF.2=1" makes Alarm 1 (Setpoint 3) LATCHING. This means that once Alarm 1 (Setpoint 3) is triggered it will remain active until it is reset by pressing the 'RESET' button one time or by grounding P2-11 when configuration bit "ALC.8=1" is set. Reset can also be accomplished via the optional RS-232 or RS-485 serial communication board.
- 3. "ALF.3=0" makes "SP 4" INDEPENDENT, with a level equal to the value inserted for "SP 4".
 - "ALF.3=1" assigns "SP 4" to "SP 2", placing it ABOVE "SP 2" by the amount entered for "SP 4".
 - "ALF.3=2" places "SP 4" BELOW "SP 2" by the amount entered for "SP 4".
 - "ALF.3=3" places "SP 4" ON BOTH SIDES OF "SP 2" by the amount entered for "SP 4".

4. "ALF.4=0" makes Alarm 2 (Setpoint 4) a NON-LATCHING Alarm.

"ALF.4=1" makes Alarm 2 (Setpoint 4) LATCHING. This means that once Alarm 2 (Setpoint 4) is triggered it will remain active until it is reset by pressing the 'RESET' button one time or by grounding P2-11 when configuration bit "ALC.8=1" is set. Reset can also be accomplished via the optional RS-232 or RS-485 serial communication board.

Press the '**MENU**' button to store any changes and advance to "AL RDG" (Alarm Reading).

10.7 "AL RDG": ALARM READINGS-SELECT DELAY IN ALARM ACTION

This byte allows you to select the number of input readings required to trigger Alarm 1 (Setpoint 3) and Alarm 2 (Setpoint 4) action.

When "AL RDG" is displayed, press the 'MIN' button to see two

2-digit numbers, with the first one flashing, indicating that you can reset the delay for SP3 by pressing the 'MAX' button.

After choosing "SP 3" delay, press the 'MIN' button and select the delay for "SP 4" by pressing the 'MAX' button.

Store your selections or changes by pressing the 'MENU' button and advance to "SP DB" (Setpoint Deadband).

10.8 "SP DB": SELECT "SP 1" AND "SP 2" DEADBAND (HYSTERESIS)

The deadband (hysteresis) for Setpoint 1 ("SP 1") and Setpoint 2 ("SP 2") is displayed with the same decimal point location as chosen for run mode.

This selected hysteresis value is EVENLY SPLIT on both sides of the levels chosen for "SP 1" and "SP 2".

View the value by pressing the 'MIN' button, reset by pressing the 'MAX' button, and store by pressing the 'MENU' button. Advance to "AL DB" (Alarm Deadband).

10.9 "AL DB": SELECT ALARM 1 ("SP 3") AND ALARM 2 ("SP 4") DEADBAND (HYSTERESIS)

This selected deadband (hysteresis) for Alarm 1 ("SP 3") and Alarm 2 ("SP 4") is placed on the INACTIVE side of the selected levels. This results in immediate action (if zero (0) delay is selected in "AL RDG") when an alarm limit is exceeded, but defers recovery when the input returns to pre-alarm levels.

Press the 'MIN' button to view the values, change the values of each flashing digit by pressing the 'MAX' button, store any changes by pressing the 'MENU' button. Advance to "OUT.CNF" (Output Configuration).

10

Setpoints/Alarms

10.10 "OUT.CNF": CONTROL FLASHING OF THE DISPLAY

You may wish to bring abnormal conditions to immediate attention by causing the display to flash.

Press the 'MIN' button to see "OUT.6".

Press the 'MAX' button to select "0", "1", "2", "3", "4", or "5".

"OUT.6=0" disables display flashing.

"OUT.6=1" flashes the display if SP1 is active.

"OUT.6=2" flashes the display if SP2 is active.

"OUT.6=3" flashes the display if SP3 is active.

"OUT.6=4" flashes the display if SP4 is active.

"OUT.6=5" flashes the display if any SP is active.

Save your choice or changes by pressing the 'MENU' button and the meter will momentarily display "STORED", then "RUN" and proceed with normal operation (go into run mode).

10.11 ENTERING SETPOINT LEVELS (IN RUN MODE)

When you have completed selecting the setpoint(s) (and other features), the last press of the 'MENU' button stores any changes and the meter will automatically return to the run mode (the display will momentarily display "RESET2"). The stored values are placed into operation, and the meter proceeds with normal measurements.

Now you can view and reset all four setpoint levels.

- 1. Press the 'SETPTS' button. The meter now starts its setpoint display cycle; every 15 seconds, the display flashes the SP number, and then displays the value of that setpoint, with a flashing left-hand digit.
- You can restart the time-out of any of these display intervals by pressing the 'MIN' button (to shift the flashing [alterable] digit position), or by pressing the 'MAX' button (to increment the value of that digit).
- 3. When you change the value of any setpoint and then decide to revert to the original value instead, just press the 'RESET' button or allow the display to return to "RUN" at the end of its cycle. The meter does not store a new value for the setpoint in either case.
- 4. To save a newly-entered setpoint value, press the 'SETPTS' button again.
- You may return to viewing the measurements by pressing the 'RESET' button or repeatedly pressing the 'SETPTS' button (or by letting the meter complete its setpoint display cycle).

PEAK AND VALLEY READINGS

The meter examines every new reading to see if it is greater than the stored PEAK or less than the stored VALLEY readings.

If you have unlocked access to these values with "L1C.5=0" and "L1C.6=0" (part of the first lockout byte "L1 CNF"), you can view the PEAK ("HI RDG") by pressing the 'MAX' button, or the VALLEY ("LO RDG") by pressing the 'MIN' button while in the run mode.

Selection of either PEAK or VALLEY causes the display to flash giving the indication that it is NOT the current measurement value. If the meter measures a more extreme value while displaying the PEAK or VALLEY measurement, the new value will immediately replace the old.

Unlike the setpoint display, there is no time out period. Press the 'SETPTS' button or '**MENU**' button to return to current-value display WITHOUT resetting the PEAK or VALLEY memory.

Press the '**RESET**' button to return to run mode and start a new PEAK/VALLEY measurement period.

The BCD option can be programmed to read the PEAK (but not the VALLEY) instead of the current measurement (refer to Section 13).

Both PEAK and VALLEY readings (and/or a PEAK/VALLEY status summary character) can be transmitted by the RS-232 or RS-422/485 digital communications (refer to Section 15).

The PEAK or VALLEY value can be transmitted via the optional analog output board (refer to Section 12).

Analog Output Options

ANALOG OUTPUT OPTION

If you received your meter with the optional analog board installed, you should not have to enter the trim data as described in Section 12.5.

Your meter converts display readings into an independently-scaled-and-offset isolated voltage and/or current analog output. Isolation is accomplished via opto-isolators on the board. Your meter has the capability of transmitting SIMULTANEOUS voltage and current outputs although when this is done, the current analog output is not as accurate.

12.1 FEATURES OVERVIEW

- Precise analog levels are generated from digital code using a proprietary ASIC chip.
- Voltage (to 10 V) is available at the same time as current (to 22 mA), but the total current drawn should not exceed 24 mA.
- 3. Load resistance for the voltage output can be as low as 500 ohms (20 mA at 10 V out) when current output is not used.
- 4. Loop resistance for the current output can be as high as 600 ohms (12 volts compliance) with negligible current from the voltage output.
- 5. Both outputs are galvanically isolated from both power and measurement circuits of the meter: 354 V per IEC spacing, 500 V test.
- Precision calibration is applied by the meter to either the voltage output or the current output (but not to both simultaneously). When both outputs are used simultaneously, the non-calibrated output is stable but does require external adjustment if fine-trimming is required.
- Independent, 15-bit resolution OuTput SCale and OFfset (OT.SC.OF)
 can convert a wide range of meter readings to the desired current or
 voltage output span.
- 8. The output resolution permits good accuracy for turndown ratios (offset/span) as high as 100:1.
- 9. 50° to 104°F (10° to 40°C) accuracy within 0.1% after installation calibration.
- 10. 10% to 90% step response time is 50 milliseconds (plus filter delay, if any, programmed for the analog output).
- Configurable so that output will track the PEAK or VALLEY measurement.

12.2 UNLOCKING

- 1. Press the 'MENU' button until "L3 CNF" is displayed, then press the 'MIN' button until "L3C.7" is displayed.
- Press the 'MAX' button (if required) to set "L3C.7=0", unlocking the choice of current or voltage as the calibrated output.
- 3. Press the 'MIN' button (and the 'MAX' button if required) to set "L3C.8=0", unlocking OT.SC.OF.
- 4. Press the 'MENU' button to store these choices.
- 5. If your analog board is NEWLY INSTALLED, you will need to enter the four trimming constants (refer to the one-time only procedure in Section 12.5). To unlock this feature, press the 'MIN' button and then the 'MAX' button to set "L4C.6=0" and store by pressing the 'MENU' button.

12.3 "OUT.CNF": CONFIGURING THE OUTPUT

- 1. Press the **'MENU'** button until "OUT.CNF" is displayed, then press the **'MIN'** button to display "OUT.1=0" or "OUT.1=1".
- Press the 'MAX' button to set "OUT.1=1" if you wish the analog output to be driven at once when you return to run mode. (You can leave this as "OUT.1=0" and complete all the other programming if you wish to activate the analog output at a later time by returning to this configuration bit).
- 3. Press the 'MIN' button (and the 'MAX' button if required) and set "OUT.2=0" for calibrated VOLT output (0-1 V, 0-5 V, 1-5 V, or 0-10 V) or "OUT.2=1" for calibrated CURRENT (0-20 mA or 4-20 mA) output.
- Press the 'MENU' button to store these choices (the rest of the "OUT.CNF" byte controls BCD and display-flashing features).
 After pressing the 'MENU' button again, you advance to "OT.SC.OF" (Output Scale and Offset).

12.4 "OT.SC.OF": SETTING OUTPUT SCALE AND OFFSET

Any two data points can be used here: a data point is specified by a value of the display ("READ") and the desired output ("OUTPT") for that display.

- 1. Press the 'MIN' button to see "READ1" and then use the 'MIN' and 'MAX' buttons to enter a small display value, for example, "000.000", where the center decimal point position is used as an example.
- 2. Store this value by pressing the 'MENU' button and then you see "OUTPT1". Use the 'MIN' and 'MAX' buttons to specify the desired output value, for example, "04.0000" if current calibration had been selected ("OUT.2=1"), or "00.0000" for voltage.
- Store this value by pressing the 'MENU' button and then advance to "READ2". Use the 'MIN' and 'MAX' buttons to enter a large display value, for example, "123.456", for the display that you want the analog output at full scale.

Analog Output Options

- 4. Store this value by pressing the 'MENU' button and then advance to "OUTPT2". Use the 'MIN' and 'MAX' buttons to enter the desired output for the display value in step 3. For example, enter "20.0000" for calibrated current or "10.0000" for calibrated voltage.
- 5. Press the 'MENU' button to store. Press the 'RESET' button two times to return to run mode and check calibration points, unless your analog output board is newly installed; in this case, follow Section 12.5.

12.5 BOARD INSTALLATION; ENTERING THE TRIM DATA

To precisely calibrate your analog output board with your meter, each analog output board has been supplied with voltage and current zero trim values printed on the board. "CAL VZ" is for the voltage output and "CALmAZ" is for the current output.

Similarly, the fine trim for output gain is "CAL VS" for the voltage output and "CALmAS" for the current output.

These 4 data points are obtained from the factory calibration of each analog output board and are inscribed on the top edge of each board, as shown in Figure 12-1.

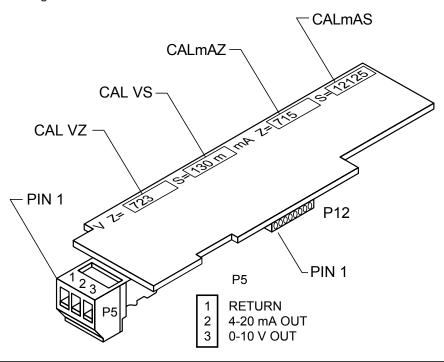


Figure 12-1. Analog Option Board and Connection Diagram at P5.

If you are installing an analog output board, follow this "one time only" procedure:

Write down the four (4) numbers inscribed on the top edge of your

١.	analog output board	scribed on the t	op eage of	youi
	CAL VZ =	 		
	CAL VS =			

CALmAS =

- 2. "Reveal the main board" and install the analog output board using the procedures outlined in Section 5.2.
- 3. Attach connector wires, insert connectors, and apply power to the meter as described in Section 5.3.
- If not already unlocked, press the 'MENU' button until "L4 CNF" is displayed and press the 'MIN' button six times. Now press the 'MAX' button to set "L4C.6=0".
- 5. Press the 'MENU' button to store and advance to "CAL VZ". Use the 'MIN' and 'MAX' buttons to enter the value (recorded from the edge of the board).
- 6. Press the 'MENU' button to store and advance to "CAL VS". Use the 'MIN' and 'MAX' buttons to enter the value.
- 7. Repeat for "CALmAZ".

CALmAZ =

- 8. Repeat for "CALmAS".
- Press the 'MENU' button to store your entries and then you will see "C.JUN.OF". Press the 'RESET' button two times and you will see "RESET2", followed by "RUN". Verify your calibration points for the analog output.

Analog Output Options

12.6 FILTER CONFIGURATION "FIL.CNF" VALUE TO BE TRANSMITTED ON ANALOG OUTPUT

- 1. Press the 'MENU' button until the display shows "FIL.CNF".
- 2. Press the 'MAX' button until the display shows "FIL.3=0", "FIL.3=1", "FIL.3=2", or "FIL.3=3".
- "FIL.3=0" Transmits the unfiltered value of your signal input.
 "FIL.3=1" Transmits the filtered value of your signal input.
 "FIL.3=2" Transmits the recorded PEAK ("HI RDG") value(s).
 "FIL.3=3" Transmits the recorded VALLEY ("LO RDG") value(s).
- Press the 'MENU' button to store your selection or changes and the meter will advance to "FIL TI" (Filter Time Constant). Press the 'RESET' button two times to return to the run mode.

12.7 WIRING/CONNECTIONS



WARNING: Do not connect ac power to your meter until you have completed all input and output connections. Failure to do so may result in injury! This device must only be installed electrically by specially trained electrician with corresponding qualifications.

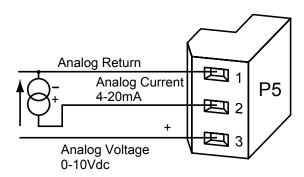


Figure 12-2. Isolated Analog Output Board Wiring Connections.

13.1 FEATURES OVERVIEW

- 6 BCD digits (24 lines plus 1 polarity, 3 decimal-point location code, 1 overflow, 1 timing, 1 control, 4 card address, and 3 isolation power lines).
- Furnished 40-line mass-terminated connector: pin compatibility with 50pin BCD cable assignments.
- 3. Can be jumpered for internal, non-isolated drive or external power with isolation (354 V per IEC spacing, 500 V test).
- Upper 3 BCD digits can be multiplexed onto lower 3 BCD lines for 3 digits at a time readout.
- 5. All outputs tri-state, TTL/CMOS compatible, 10 LSTTL loads.
- Data always valid (stored, buffered).
- Selectable 4-line card address (with internal pull-ups) or single-line activation.

Figure 13-1 shows the rear of the meter case with the 40-line edge connector highlighted and the upper and lower pin assignments.

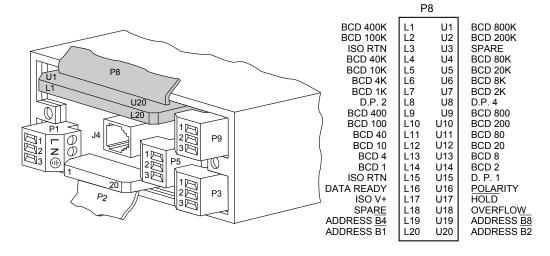


Figure 13-1. BCD 40-Pin Cable Connector (P8)

13 BCD Option

Figure 13-2 shows the board connections and pin designators. The locations of the jumpers are also shown.

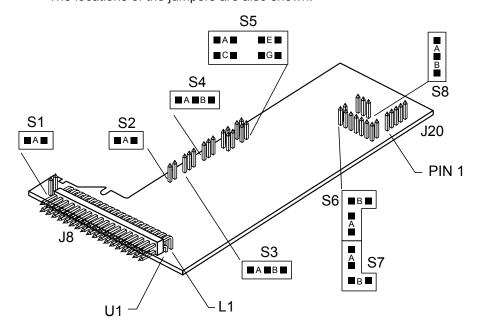


Figure 13-2. BCD Option Board

13.2 BCD CARD JUMPER TABLE

JUMPER	WHEN USED
S1A	Brings OVERFLOW signal to P8-U18
S2A	Insert for 3-digit multiplex
	Remove for 6-digit readout
S3A	Insert for 3-digit multiplex or one-line card-address enable
	OR
S3B	4-line card-address enable
S4A	Insert for 3-digit multiplex
	OR
S4B	Insert for 6-digit readout
S5A	P8-U20 must be low to enable card
	Remove for high or open enable
S5C	P8-L20 must be low to enable card
	Remove for high or open enable
S5E	P8-U19 must be low to enable card
	Remove for high or open enable
S5G	P8-L19 must be low to enable card
	Remove for high or open enable
S6A, S6B,	Install for internal power
S7A, S7B	Remove for isolated power
S8A	Output data is negative-true
	OR
S8B	Output data is positive-true

13.3 INTERCONNECT BOARD

For mechanical support and electrical interconnection, each BCD board is shipped with a small 5-pin INTERCONNECT board. Insert onto the main board pins immediately behind the right-hand side of the display board. The BCD board itself (component side down) is then plugged into the interconnect board at J20, with the PCB connection fingers protruding from the case rear. For assembly detail, refer to Figure 5-4 (in Section 5).

13 BCD Option

13.4 50-LINE CABLE COMPATIBILITY

The 40 lines of the BCD connector are compatible with lines 9 through 48 of some 50-line busses (left-most 8 and right-most 2 are not used by this BCD option).

13.5 SELECTING THE SOURCE OF BCD DATA: "OUT.CNF"

If "L3C.7=0" has been selected to unlock the OUTput CoNFiguration byte, set "OUT.3=1" to send data to this BCD board. "OUT.4=0" selects that data as the DISPLAYED (current) measurement value. "OUT.4=1" sends the PEAK (HI) value to the BCD. Save your selection by pressing the '**MENU**' button.

13.6 HOLD CONTROL

P8-U17 is the HOLD line, referenced to the same ground as the BCD outputs (on P8-L15 and P8-L3). Pulling this line low freezes the BCD outputs (useful for a slow reading device or asymmetric cable delays).

When released, all 6 digits of the BCD data are updated together.

13.7 DATA READY TIMING PULSES

The tri-state BCD outputs are always valid (to within a few nanoseconds; a single update pulse controls all the digits).

To generate a timing marker, P8-L16, DATA READY, goes active low for approximately 200 microseconds at the time of each BCD update. The polarity of this line is NOT CHANGED by S8, the data polarity control jumper.

13.8 BRINGING OUT THE BCD OVERFLOW LINE

P8-U18 can be used for BCD OVERFLOW by inserting jumper S1A. If this line is used for another purpose by some other equipment on the BCD bus, remove this jumper.

13.9 3 DIGIT AT A TIME MULTIPLEX

When jumpers S2A, S3A, and S4A are used, P8-L20 and S5C control when the upper 3 digits of the 6-digit BCD value appear on the output line (P8-U9 through P8-L14).

With jumper S5C, a LOW level on P8-L20 activates those upper 3 digit outputs; a high or open level disables those digits.

With jumper S5C removed, a high or open level on P8-L20 enables those upper 3 digits and a low level disables them.

When the upper 3 digits are NOT enabled, the lower 3 digits can be enabled in just the same way by jumper S5A and P8-U20, and they now appear on the same 12 lines.

13.10 6 DIGIT AT A TIME CARD ADDRESS

Jumpers S2A and S4A are removed for full parallel (6-digit output).

If jumper S3A is installed, the outputs are enabled by line P8-L20 ALONE: a low level enables the outputs when jumper S5C is installed, and a high or open level does the job if S5C is removed.

When jumper S3A is removed, the outputs are enabled only when the selected 4-line address is applied to P8-U19, L19, U20 and L20. Each of these four is exclusive-OR'd with its jumper, and the following four outputs are AND'd to create a 1 of 16 enable code.

If jumper S5A is installed, P8-U20 must be LOW to enable the card (BIT 2).

If jumper S5C is installed, P8-L20 must be LOW to enable the card (BIT 1).

If jumper S5E is installed, P8-U19 must be LOW to enable the card (BIT 8).

If jumper S5G is installed, P8-L19 must be LOW to complete enabling the card outputs (BIT 4).

BINARY B	IT	1	2	4	8			1	2	4	8
JUMPER S5-		С	Α	G	Ε			С	Α	G	Е
	00	Х	Х	Х	Х		80	Х	Х	Х	
	01		Х	Х	Х		09		Х	Х	
	02	Х		Х	Х	10 11		Х		Х	
	03			Х	Х					Х	
	04	Х	Х		Χ		12	Х	Х		
	05		Х		Х		13		Х		
	06	Х			Х		14	Х			
	07				Х		15				

Figure 13-3. Address Programming Chart for 4 -line Address



NOTE: "X" in chart indicates jumper that must be installed.

EXAMPLE: For a positive true address of 03, install jumpers S5-G and S5-E.

If any of these jumpers are removed, the corresponding line must go HIGH or OPEN to assist the card enable; if all four jumpers are missing, for example, the card outputs are enabled ONLY when all four lines are HIGH or OPEN, a ground on any of the four input lines causes the outputs to go the high impedance state.

13 BCD Option

13.11 SELECT DATA POLARITY: JUMPER S8

Inserting the jumper in S8B (the usual shipping position) makes the output data (including decimal point code) positive-true. Placing the jumper in S8A converts the data to negative-true.

13.12 DECIMAL POINT ADDRESS CODE

P8-U15, P8-L8 and P8-U8 output a 3-bit positive-true binary code for the location of the decimal point: "001" for the extreme right position and "110" for the extreme left position (just to the right of the left-hand digit).

Panel-mounted printers, however, may require an inverted/shifted decimal point code. You can create this by setting "OUT.5=1" in the "OUT.CNF" byte (unlocked by setting "L1C.7=0"), rather than the normal "OUT.5=0".

13.13 APPLYING NON-ISOLATED/ISOLATED POWER

Non-isolated power from the meter is connected to this board by inserting jumpers S6A, S6B, S7A, and S7B (bridging the isolation separation distance on the board). Current drawn is less than 10 mA.

To isolate these outputs from the other meter circuits, remove the four jumpers described earlier, and connect an external, nominal 5 V supply to P8-L17, with its ground return connected to P8-L15.

13.14 DRIVING A PRINTER

Direct connection of the 24 BCD lines and the 3 decimal point address lines is all that is needed for positive-true printers that accept a binary-coded decimal point address (which do not print the decimal point).

If your printer has more than 6 digits, tie the unused inputs to ground or V+ or leave open (whichever produces blanks in those locations).

For negative-true decimal point addresses, found in some panel-mounted printers, set "OUT.5=1" (part of menu item "OUT.CNF", unlocked by "L1C.7=0").

14.1 FEATURES OVERVIEW

The Dual Relay Output Board and 4 Relay Output Board provides two isolated (354 V per IEC spacing, 500 test), 7-ampere Form-C electro-mechanical relays that enable setpoint-triggered switching to an external device (plus two 1-ampere Form-C electro-mechanical relays for 4 Relay Option). Each relay can accommodate a single setpoint. 200 W, 2500pf snubbers are provided for each normally open contact.

These options may not be used with parallel BCD Board Option. Figure 14-1 and 14-2 shows the board connections and jumper locations.

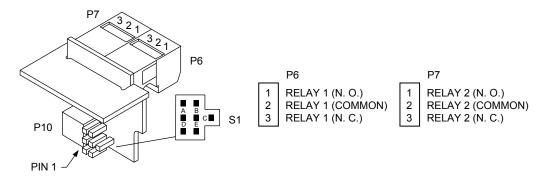


Figure 14-1 Dual Relay

TABLE 14.1 Dual Relay Board Jumpers

JUMPER	FUNCTION
S1A*	Drives Relay 1 from SP3 (P6)
S1B	not used
S1C	Drives Relay 2 from SP2 (P7)
S1D	Drives Relay 1 from SP1 (P6)
S1E*	Drives Relay 2 from SP4 (P7)

^{*} Factory preset jumper locations

Relay Options

Figure 14-2 below show the locations of the 4 Relay Output Board jumpers, the P10 plug connecting the board to the Main Board, and the positions of P6, P7 and P18, the output plugs.

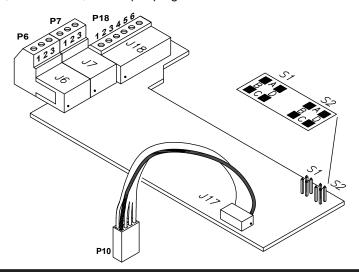


Figure 14-2. 4 Relay Board Jumpers and Plugs.

Table 14-2 shows which jumpers are assigned to each relay. Defaults have asterisks.

Table 14-2. 4 Relay Board Jumpers.

S1	S2	FUNCTION
A, C*	A, C*	Assigns SP1 to Relay 3 (P18) Assigns SP2 to Relay 4 (P18) Assigns SP3 to Relay 1 (P6) Assigns SP4 to Relay 2 (P7)
B, D	A, C	Assigns SP1 to Relay 1 (P6) Assigns SP2 to Relay 4 (P18) Assigns SP3 to Relay 3 (P18) Assigns SP4 to Relay 2 (P7)
B, D	B, D	Assigns SP1 to Relay 1 (P6) Assigns SP2 to Relay 2 (P7) Assigns SP3 to Relay 3 (P18) Assigns SP4 to Relay 4 (P18)
A, C	B, D	Assigns SP1 to Relay 3 (P18) Assigns SP2 to Relay 2 (P7) Assigns SP3 to Relay 1 (P6) Assigns SP4 to Relay 4 (P18)

14.2 WIRING/CONNECTIONS



WARNING: Do not connect ac power meter until you have completed all input and output connections. Failure to do so may result in injury! This device must only be installed electrically by specially trained electrician with corresponding qualifications.

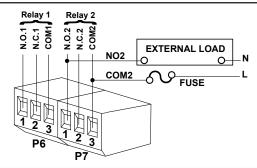


Figure 14-3. Dual Relay Output Board Wiring Connections

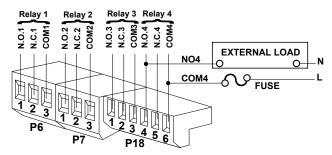


Figure 14-4. 4 Relay Output Board Wiring Connections

CONNECTOR	PIN	FUNCTION
P-6	1	NO1 (Normally Open)
(Relay 1 Connection)	2	Common 1
,	3	NC1 (Normally Closed)
P-7	1	NO2 (Normally Open)
(Relay 2 Connection)	2	Common 2
	3	NC2 (Normally Closed)
P-18	1	NO3 (Normally Open)
(Relay 3 & 4	2	Common 3
Connection	3	NC3 (Normally Closed)
for 4 Relay Option only.)	4	NO4 (Normally Open)
- ,	5	Common 4
	6	NC4 (Normally Closed)

Table 14-3 Pin Assignments for the P6, P7 and P18 plugs

RS-232 or RS-485 Option Board

15.1 FEATURES OVERVIEW

The Isolated Serial RS-232 Communications Board provides an isolated digital communications channel between a single meter and another meter or device, or between a single meter and a computer. The Isolated Serial RS-485 Communications Board adheres to the IEC standard, providing an isolated channel between up to 32 meters and a single computer or intelligent device—but can actually address up to 199 devices.

- When you order either option board, you will also receive a software diskette, a complete configurations setup program, and a six foot communications cable that plugs into J4. Optional female 9-pin and 25pin "D" computer connector-adapters are offered for either RS-232 or RS-422/485 hookup.
- 2. The communications board you ordered, plugs into the main board socket (P11 connects into J11 next to the transformer) with the 6-pin telephone socket. J4 is then protruding out of the rear of the case.
- 3. Install, run, establish communication and meter setup information are described in Section 15.3; screen error messages are described in Section 15.4 and a sample basic program to read the meter information to your screen is described in Section 15.5.
- There are no jumpers on the RS-232 card (all software controlled with or without button programming).
- Only 3 RS-422/485 jumpers (half/full duplex and impedance- matching resistors).
- 6. Choose baud rate from 300 to 19200. Standard factory setting is 9600.
- 7. Wide choice of commands and message formats available.

15

Figure 15-1 gives the board connections and pin designators for RS-232.

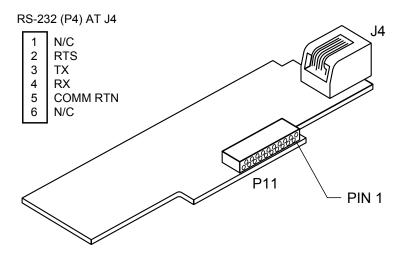


Figure 15-1. RS-232 Option Board and Pin Designations

Figure 15-2 shows board connections and pin designators for RS-485.

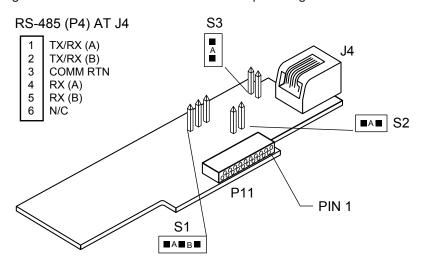


Figure 15-2. RS-485 Option Board and Pin Designations

RS-232 or RS-485 Option Board

15.2 FRONT-PANEL PUSHBUTTON CONFIGURATION

Setup configuration can be accomplished via the front panel buttons or via your computer if you use the configuration setup program. If you are going to use a computer, your choices include "AUTO SET" or "MANUAL SET" for establishing communication with your meter. "AUTO SET" cycles through the possible combinations of baud rate, parity and stop bits to find a match for your meter settings. For faster action, you may enter the values for your meter via "MANUAL SET".

If your meter communications settings are unknown or need changing, you can insert the factory-set values with the front panel buttons (or, after communications has been established, from your keyboard).

- Unlock the communications bits by setting "L4C.1=0", "L4C.2=0", "L4C.3=0", "L4C.4=0" and "L4C.5=0".
- Press the 'MENU' button until "BAUD" is displayed, then press the 'MAX' button until the baud rate you require is displayed. Press the 'MENU' button to store this choice and your meter will display "SERCNF".
- Press the 'MIN' button until you see the display show "SER.1=0" for no parity, "SER.1=1" for odd parity, or "SER.1=2" for even parity. Press the 'MAX' button to select the parity required for your system. Once you have done that, press the 'MIN' button and advance to "SER.2=0" or "SER.2=1".
- By pressing the 'MAX' button you can select the "SER.2" value. Setting "SER.2=0" picks the value to one stop bit; "SER.2=1" selects two stop bits. Select "SER.2=0".
- Pressing the 'MENU' button stores these choices and then the meter advances to "ADDRES". Use the 'MAX' button to set to "001" (unless your meter is one of several on an RS-485 bus, in which case you must give a different address to each device and use those addresses when communicating from your computer).
- Press the 'MENU' button again and press the 'RESET' button two times to return to the run mode. The remaining communications format and options are set from your keyboard.

15.3 INSTRUCTIONS FOR USING THE SETUP PROGRAM

- 1. Requirement: 640 K or more RAM and DOS 3.1 or higher.
- 2. Insert appropriate size diskette into your computer drive.
- 3. If you are using an LCD screen computer, at the DOS prompt "A:\>", "B:\>", or "C:\>", type "MODE MONO" (or, for some DOS version, type "MODE BW80"), then press 'ENTER'.
- 4. If loading from the floppy (rather than moving the program onto your hard disk, if any) with a CRT computer, at the DOS prompt "A:\>" or "B:\>", type "INF" and then press 'ENTER'.
- 5. To copy the program from floppy disk to the hard drive, at the DOS prompt "C:\>", type "MD INF" and press 'ENTER'. Now type "CD\INF" and press 'ENTER' again. Type "COPY A:*.*" (or "COPY B:*.*" for the other floppy drive) and press 'ENTER'.

To start the program, type "INF" and press 'ENTER'.

Your screen now displays a WELCOME message and the program begins to load into your RAM. (**NOTE:** Loading time can vary from seconds to 3 minutes depending on computer speed and the drive chosen; hard disk drives are the fastest).

When loading is completed, the COPYRIGHT screen appears. Press 'ESC' to go to the top level screen.

TOP-LEVEL MENU
GUIDE TO MENUS AND KEYSTROKES
SERIAL COMMUNICATIONS MENU
METER SETUP MENU
QUIT

The GUIDE selection shows you all the different menus and keystrokes used in the program.

The SERIAL COMMUNICATIONS MENU is to be used before the SETUP MENU, to identify your meter, initialize the communication parameters, and establish communication with the meter.

The METER SETUP MENU is used AFTER communication with the meter is established and will lead you through the selection of all the meter features to specialize it to your application.



WARNING: IF YOU ATTEMPT TO SEND THE METER SETUP DATA BEFORE ESTABLISHING COMMUNICATIONS, YOUR COMPUTER MAY LOCK UP (AND THEN YOU MUST START FROM THE BEGINNING BY REBOOTING THE SOFTWARE).

After selecting SERIAL COMMUNICATIONS MENU (by moving the highlight to this line with your arrow keys and then pressing 'ENTER'), the screen shows:

RS-232 or RS-485 Option Board

COMMUNICATION PROTOCOL RS-232 PROTOCOL RS-485 PROTOCOL

Use your up or down arrow key, highlight your choice and press 'ENTER'. Now the screen shows:

SET RSxxx AUTO SET MANUAL SET

(where xxx is either 232 or 485).

If you choose:

AUTO SET with RS-232: the program will cycle through the possible choices of baud rate, parity, stop bits and recognition symbols in trying to talk to the meter.



NOTE: This takes some time, so be patient!

AUTO SET with RS-485: the only item necessary is the meter's address.

If you have selected MANUAL SET and pressed 'ENTER', the screen shows:

RS-232 CONFIGURATION	
COMMUNICATION PORT:	1
BAUD RATE:	9600
PARITY:	ODD
STOP BIT(S):	ONE
TRANSMIT/RECEIVE	
SWITCHING DELAY:	100 ms

OR

1
1
9600
ODD
ONE
100 ms

The above values are the factory settings. If your meter differs, enter its values on this screen by moving the highlight with the arrow keys, changing values with the number keys, and storing each entry by pressing 'ENTER'.

After pressing 'ENTER', the program starts to establish communications with your meter.

When the program successfully establishes communication, your screen shows:

COMMUNICATION ESTABLISHED PLEASE PRESS 'ESC' TO CONTINUE

If, however, an error message is displayed instead, refer to Section 15.4 to interpret the message and start over again after correcting the error.

When you press 'ESC', the TOP LEVEL MENU is displayed again. Highlight "METER SETUP MENU" and press 'ENTER'.

You will now be guided through the different meter configuration selections required for your application such as "INPUT", "INPUT TYPE, etc.

After completing your selections, select 'SEND TO (THE METER)' on your screen and press 'ENTER'. The program now transmits the proper codes to load the meter's non-volatile memory with your choices.

If there is an error, you will be prompted with the appropriate flashing error message.

If the program completes successfully, you will see:

COMMUNICATION COMPLETED
PLEASE PRESS 'ESC' TO CONTINUE

You may now start to program another meter, make changes, or select "QUIT" from the TOP LEVEL MENU, and then press 'ENTER'.

15.4 SCREEN ERROR MESSAGES

MESSAGE		PROBABLE SOURCE
COMMUNICATION ERROR:		No meter response, so:
	1.	Hardware: bad connections, no meter power, bad cable, boards not inserted correctly, defective boards, etc.
	2.	Baud rate or stop bits mismatched between computer and meter.
	3.	Computer communications port not correct.
	4.	RS-485 meter address does not match.



RS-232 or RS-485 Option Board

MESSAGE	PROBABLE SOURCE
PARITY ERROR:	Meter setting and computer selection do not agree.
COMMAND ERROR:	Command character wrong.
FORMAT ERROR:	Transmitted characters do not have proper length or are not valid characters.
CHECKSUM ERROR:	Noise causing errors in received characters.
EEPROM LOCKOUT:	Meter not storing data: jumper
	S3A on main board is missing, or pin 10 on the meter's P2 rear connector is grounded.
DECIMAL POINT FRACTION TOO LARGE:	Selected decimal point location is too far to the left to permit READING OFFSET or SETPT value storage. Everything is stored here except the decimal point.



NOTE: "ECHO" command mode is recommended for all communications since it always produces a response for successful communication. Otherwise, the program cannot warn you with a COMMUNICATION ERROR message.

15.5 SERIAL COMMUNICATIONS SAMPLE PROGRAM

The following sample program will allow you to send a request for information to the meter and receive a response.



NOTE: The codes in this sample program are found in the serial communications operators guide.

15.5.1 Program Objectives

- Clear screen
- 2. Print "Enter a Command>"
- 3. Accept "X01" (requests unfiltered meter reading)
- 4. Accept "X02" (requests PEAK meter reading)
- 5. Accept "X03" (requests VALLEY meter reading)
- 6. Accept "X04" (requests filtered meter reading)
- Accept any other command code and suffix, ("ccc") from list in the Serial Communications Operators guide.
- 8. Screen echoes the chosen command
- 9. Computer sends request to meter
- 10. Stall for 0.5 seconds, then look for response

RS-232 or RS-485 Option Board

- 11. Put watchdog message on screen if no response in 10 seconds
- 12. Print meter response on screen
- 13. User selects Quit or more commands.

15.5.2 Code and [Notes]


	_	
	1000	CLS [Clear screen command]
	1010	COMM\$ = "COM1" [Label for communications port COM1]
	1020	BAUD\$ = "9600" [Label for choice of 9600 baud]
	1030	PARITY\$ = "0" [Label for Odd parity]
	1040	STOPBT\$ = "1" [Label for one stop bit]
	1050	CLOSE #1 [Get ready to reopen #1]
	1060	OPEN COMM\$ + BAUD\$ + "," + PARITY\$ + ",7," + "CS,DS,RS" AS #1 [OPENS COM1]
	1070	INPUT "ENTER A COMMAND >",CMD\$ [Prompts and Labels Input]
	1080	IF CMD\$ <>"^AE" THEN CMD\$ = "*" + CMD\$ [Add recognition character unless command is that for setup data]
	1090	PRINT CMD\$ [Screen echoes command]
	1100	PRINT #1, CMD\$ [Send command to meter]
	1110	N = 0 [Initialize watchdog]
	1120	SOUND 32767,27:SOUND 32767,1: SOUND 32767,1 [Delay 0.5 seconds]
	1130	N = N + 1 [Increment watchdog]
	1140	IF N <> 20 THEN 1180 [Test for timeout]
	1150	INPUT "NO RESPONSE YET: TYPE 'C' TO CONTINUE,
		'Q' TO QUIT",B\$ [10 second timeout]
	1160	IF B\$ = "Q" THEN 1230 [Exit if desired]
	1170	N = 0 [Restart watchdog]
	1180	IF LOC(1) = 0 THEN 1120 [Stall until buffer has contents]
	1190	A\$ = INPUT\$(LOC(1),#1) [Read and label contents of COM1]
	1200	PRINT A\$ [Put data onto screen]
	1210	INPUT "TYPE 'M' FOR MORE COMMANDS OR 'Q' TO QUIT", B\$
	1220	IF B\$ = 'M' THEN 1070
	1230	END
_		

External Control Lines

EXTERNAL CONTROL LINES

P2, the 20-pin connector at the rear of the main board, connects to the setpoint transistor collectors and permits remote control of significant meter features.

The meter case label gives the names (abbreviated functions) of each of the twenty pins of P2, the center-bottom connector. Refer to Figure 16-1.

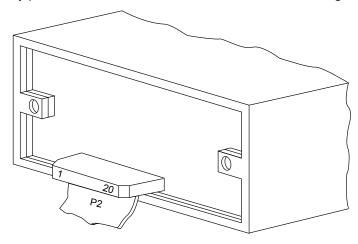

	Р	2	
TARE(T)	1	2	PEAK (P)
VALLEY (V)	3	4	SWLIN2
PEAK/VALLEY OR EXT. RESET	5	6	PUSH TO CAL
DIG RTN	7	8	+5V
DISPLAY HOLD	9	10{	LOCKOUT EEPROM &
RESET ALARMS AND/OR	}11	101	MENU PUSH BUTTON
PRINT COMMAND	}''	12	NONSTANDARD RX
NONSTANDARD TX	13	14	PUSH TO CAL
+V EXT	15	16	SP1
SP2	17	18	AL1
AL2	19	20	RTN EXT

Figure 16-1. Connector Label Detail

16.1 TARE (PIN 1)

Tare is available when P2-1 and P2-4 are connected to a momentary contact switch. This feature allows you to automatically zero your meter when the switch is activated.

16.2 PEAK (PIN 2)

When this is connected to P2-4 by an external switch, the meter displays the stored PEAK ("HI RDG") value rather than the current reading. The display flashes to distinguish this value.

16.3 VALLEY (PIN 3)

When this is connected to P2-4 by an external switch, the meter displays the stored valley ("LO RDG") value rather than the current reading. The display flashes to distinguish this value.

16.4 SWLIN2 (PIN 4)

Completes the circuit for any of the above three signals.

16.5 PEAK & VALLEY OR EXTERNAL RESET (PIN 5)

Connecting this to ground (P2-7) when "RDG.7=0" has been programmed causes a "HARD" **RESET** (when you see "RESET2" on the display). If you set "RDG.7=1", grounding causes only a PEAK/VALLEY **RESET**.

16.6 PUSH TO CAL (PIN 6)

Not applicable for process meters.

16.7 DIGITAL RETURN (PIN 7)

This is a non-isolated return to be used for the digital controls provided on this P2 connector.



WARNING: THIS METER RETURN IS NOT ISOLATED FROM THE SIGNAL INPUT AND SHOULD NOT BE CONNECTED TO EXTERNALLY-GROUNDED DEVICES UNLESS ISOLATION IS PROVIDED EITHER AT THE SIGNAL INPUT OR AT THIS EXTERNAL-LOGIC CONNECTION.

16.8 +5 V (PIN 8)

Up to 20 mA is available for driving external devices, but isolation should be provided if there is a possibility of common mode (ground) currents, since this supply is NOT isolated from the signal input.

16.9 DISPLAY HOLD (PIN 9)

Grounding this pin to P2-7 freezes the display value. However, the meter continues to take new samples and update the other outputs, such as Analog Output, BCD, Setpoints/Alarms, and Peak/Valley.

16.10 LOCKOUT EEPROM (AND 'MENU' BUTTON) (PIN 10)

Grounding this pin to P2-7 stops any configuration changes and new storage into the non-volatile memory, and when in run mode does not allow entry into the setup mode when the 'MENU' button is pressed.

16.11 PRINT COMMAND AND/OR RESET OF ALARMS (PIN 11)

Grounding this pin to P2-7 when "BUS.8=1" has been programmed will initiate a meter printout via serial communications in the format previously selected. If "ALC.8=1" it causes the alarm latches to reset.

External Control Lines

16.12 NONSTANDARD RX (PIN 12) AND NONSTANDARD TX (PIN 13)

These two pins allow digital communications with the meter using 5 V CMOS logic levels and RS-232 protocols and format. This access is normally reserved for specialized equipment communication in a calibration lab or at the factory.

16.13 PUSH TO CAL (PIN 14)

NOT USED

16.14 +V EXT (PIN 15)

This is the pin on which to bring in isolated external 5 to 30 V to power the snubbing diodes of the four setpoint/alarm open-collector transistors.

16.15 SP1 (PIN 16)

The open-collector of the first setpoint transistor (can carry 150 mA).

16.16 SP2 (PIN 17)

The open-collector of the second setpoint transistor (can carry 150 mA).

16.17 AL1 (PIN 18)

The open-collector of the third setpoint (first alarm) transistor (can carry 150 mA).

16.18 AL2 (PIN 19)

The open-collector of the fourth setpoint (second alarm) transistor (can carry 150 mA).

16.19 RTN EXT (PIN 20)

This is the return to the external ground (P2-20) of the external power for the setpoint transistors and snubbing diodes brought in on P2-15, 16, 17, 18 and 19. Figure 16-2 shows an example of a circuit using an external relay with SP1 (Setpoint 1). If a solid state relay is used, delete connection to Pin 15.

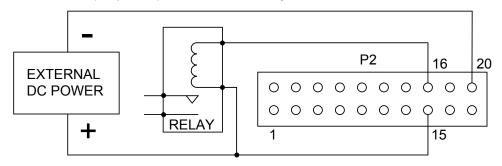


Figure 16-2. Connection of External Power for Setpoint Transistors

TROUBLESHOOTING - DISPLAY MESSAGES AND TROUBLESHOOTING GUIDE

A flashing alpha-numeric message in the display generally indicates an incorrect combination of jumpers and/or configuration values.

17.1 ERROR MODE MESSAGES

17.1.1 Flashing "999999" (Numerical Overflow)

The maximum number of counts in the display cannot exceed –99999 or 999999. If, by moving the ACTIVE decimal point one or more places to the left, you cause the display to move beyond the maximum number of counts it is capable of showing (for example, 12345.0 to 12345.00), the display will indicate the overflow by flashing "999999".

17.1.2 Flashing "ERR O1" (Offset Overflow)

When an offset value has been entered and then the ACTIVE decimal point has been moved one or more places to the left, causing the offset display reading to move beyond the maximum number of counts it is capable of showing (for example, 1000.00 to 1000.000), the display will go into offset overflow.



NOTE: The meter will only display 6 digits (999999) maximum.

17.1.3 Flashing "ERR O2" (Setpoint Overflow)

After a Setpoint (or Alarm) value has been entered and then the ACTIVE decimal point has been moved one or more places to the left, causing the setpoint display reading to move beyond the number of counts it is capable of showing (for example, setpoint at 100.00 and then a decimal point change to 100.0000), the display will indicate the SETPOINT OVERFLOW by momentarily flashing "ERR 02" before returning to the run mode.



NOTE: The meter will only display 6 digits (999999) maximum.

17.1.4 "NOSTOR" & "STORED" (Programming Entries In EEPROM)

If you are in the configuration mode and you make a CHANGE to any setup parameter (for example, changing "RDG.1 = 1" to "RDG.1 = 0") and press the **'MENU'** button, the display will MOMENTARILY flash either "STORED" or "NOSTOR" and then go to the next menu item. If you are in a submenu, this will only occur when you press the **'MENU'** button to go to the next menu item.

17.1.5 Flashing "+OVLD" (Positive Input Overload)

If the input signal exceeds the range selected (for example, 0-100 mV range selected and greater than 200 mV is applied to the input), the display will flash a "+OVLD".

17.1.6 Flashing "+OPEN" (Open Sensor Indication)

Coupled with the proper jumper selection, the display will indicate an open sensor.



17.1.7 Flashing "-OPEN" (Open Sensor Indication)

Coupled with the proper jumper selection, a "-OPEN" indicates the input is below the bottom limit of the range selected.

17.1.8 Flashing "I OVSC" (Input Overscale)

This display occurs when the input scale and/or offset applied to the input signal causes the display to go into a numerical overflow.

17.1.9 Flashing "R OVSC" (Reading Overscale)

This display occurs when the reading scale and/or offset applied to the input signal causes the display to go into a numerical overflow.

17.1.10 Flashing "CB OVF" (Count By Overflow)

When a display value near the maximum display capability is forced into a numerical overflow by changing the CNT BY menu (for example, the display reads 999997 and the count by is changed from 001 to 005 and rounds the display up to 1000000).

17.1.11 Flashing "UOM.OVF" (Unit Of Measure Overflow)

If a unit of measure is selected and you are near the full scale capability of the display and in the ACTIVE decimal mode, the display will shift one digit to the left (for example, to a display of 1065.33 you add a unit of measure such as "F" for a display of 1065.33F), the display will flash "UOM.OVF".

17.2 TROUBLESHOOTING GUIDE

"00000"

99999	
POSSIBLE CAUSE:	Active decimal point change driving the display into numerical overload.
TO CORRECT:	Press the 'MAX' button to reset the entire display to all zeros, then enter a revised number into the submenu item that caused the overflow.
"ERR 01"	
POSSIBLE CAUSE:	Active decimal ("RDG.2=0") has been selected and/or DEC PT (decimal point) position has been moved one or more places to the left driving the programmed offset value into numerical overflow.
TO CORRECT:	Press the 'MENU' button and the meter will show the left most decimal point position possible for the chosen offset: by pressing the 'MENU' button again this revised entry is stored.
	Alternately, the amount of RDG.OF may be reduced to get the decimal point further to the left.

continued next page

"ERR 02"

POSSIBLE CAUSE: Active decimal (RDG.2) has been selected and/or

DEC PT (decimal point) position has been moved one or more places to the left driving the programmed

Setpoint value into numerical overflow.

TO CORRECT: Display will flash "ERR 02" message for a short period

of time, then automatically correct the setpoint's decimal point position and move to the next menu item. Press the 'SETPT' button until the meter displays flashing "999999". Then press the 'MAX' button to reset the display to "000000" and enter a

new valid setpoint value.

"+OVLD"

POSSIBLE CAUSE: The positive input CURRENT & VOLTAGE exceeds

the input range selected.

TO CORRECT: Check both the input range and the actual input to find

the error condition and either reduce the input or change jumpers to a higher input range for more input

attenuation.

"-OVLD"

POSSIBLE CAUSE: The negative input voltage exceeds the input range

selected.

TO CORRECT: Check both the input range and the actual input to find

the error condition and either reduce the input or change jumpers to a higher input range for more input

attenuation.

"+OPEN"

POSSIBLE CAUSE: Input sensor is open or broken, or the connection to

the meter is open or broken. Input sensor is not wired

to the proper input terminals.

TO CORRECT: Check thermocouple or RTD wiring.

"-OPEN"

POSSIBLE CAUSE: The input sensor is open or broken, or the connection

to the meter is open or broken. The input sensor is not wired to the proper input terminals. The input signal is below the minimum specified (refer to Section 18,

Specifications).

TO CORRECT: When jumper S2R on the signal input board is used,

this will be indicated if a sensor lead is broken or otherwise opened. Check thermocouple or RTD wiring.

17/-

Troubleshooting

1	OVS	C"				
---	------------	----	--	--	--	--

POSSIBLE CAUSE: The input scale and/or offset values chosen are large

enough to drive the display into numerical overflow.

TO CORRECT: Reduce the input and/or the input scaling/offset. Refer

to "IN.SC.OF" in Section 9.2.5.

"R OVSC"

POSSIBLE CAUSE: The reading scale and/or offset values chosen are

large enough to drive the display into numerical over-

flow.

TO CORRECT: Reduce the reading scale/offset and/or move the

active decimal point to the right. Reducing input scale/offset is not required, because the input overscale message has higher priority than this message and would be displayed if there were an

input overscale.

"CB OVF"

POSSIBLE CAUSE: CNT BY (count by value) has been changed causing

the display to round up to a numerical overflow.

TO CORRECT: Reduce the "CNT BY" count by value to 001. If you

have an active decimal point selected, move the decimal point one or more positions to the right.

"UOM.OVF"

POSSIBLE CAUSE: Selection of unit of measure displayed ("RDG.6=0")

moves the display reading one place to the left

causing a numerical overflow.

TO CORRECT: If you have an active decimal point, move the decimal

point position one or more positions to the right.

"SERIAL"

POSSIBLE CAUSE: A configuring change has been attempted via the front

panel buttons while the serial communications port is

actively communicating with the meter.

TO CORRECT: Either lockout the front panel buttons by removing the

jumpers S3A & S3C or disconnect the serial

communications option.

18.1 CURRENT INPUT

INPUT RANGES(+10%): 0-20 mA and 4-20 mA

RESOLUTION: 1µA

MAXIMUM INPUT: 200 mA

INPUT OHMS: 5

18.2 VOLTAGE INPUT

INPUT RANGES:

UNIPOLAR: 1 V 10 V 100 V 100 mV ±0.5 V ±5 V BIPOLAR: ±50 mV +50 V RESOLUTION: 1μV 10 μV 100 μV 1 mV 350 Vp 300 Vp MAX INPUT: 70 Vp 350 Vp INPUT OHMS: 1G 1M 1M 1M BIAS AMPS: Aq 07 Aq Z Aq 1 Aq 1

18.3 POTENTIOMETER INPUT

INPUT RANGES: 1 V or 10 V

RESOLUTION: programmed to 0.001%

18.4 GENERAL

SCALE: +0.000001 to +500000 or

-0.0001 to -99999.

OFFSET: Zero to +999999

POLARITY: Automatic

NOISE REJECTION

NMR: 60 dB, 50 or 60 Hz, + selected filter

CMR: 120 dB

CMV: Dielectric strength to 1500 V transient per

260 VRMS or DC working voltage.

ACCURACY at 25 °C:

MAX ERROR: ±0.005% of reading

SPAN TEMPCO: less than 20 ppm/°C

STEP RESPONSE: 1 second to 99.9%

18 Specifications

WARMUP: 55 minutes to rated accuracy. It is

recommended that the unit be continuously

running to insure its accuracy.

CONVERSION

TECHNIQUE: Dual-slope

READRATE and DISPLAY UPDATE/Programmable

INTEGRATION TIME: 3 samples/sec: 100 msec

13 samples/sec, 60 Hz: 16.7 msec 12 samples/sec, 50 Hz: 20 msec

DISPLAY LEDs: 6, 0.54" (13.8mm)h, red, 14-segment

4, 0.12" x 0.24" (3 x 6mm), red lamp

SYMBOLS: -.8.8.8.8. or 8.8.8.8.8.

DECIMAL

POINT POSITION: Programmable

SENSOR EXCITATION

AC-POWERED: 1.5 to 11 Vdc, up to 60 mA max.

24 Vdc at 25 mA max.

DC-POWERED: 10 Vdc at 120 mA

24 Vdc at 35 mA

OUTPUTS

(STANDARD): 4, isolated open collector; 150 mA at

1 V sink; 30 V open

BCD OUTPUT: Tri-state, TTL/CMOS compatible;

internal 5 V supply for non-isolated, external 5 V supply for isolated.

ANALOG OUTPUT: 0-5 V, 1-5 V, 0-10 V, 0-20 mA, 4-20 mA level;

compliance, 12 V at 20 mA; 15-bit resolution; 0.1% accuracy; programmable zero and span.

continued next page

RELAY OUTPUT: Dual Form-C relays or 4 Form-C relays

POWER RATING FOR RESISTIVE LOADS:

DUAL AND 4 RELAY: Two relays at P6 and P7

Normally open contact, 7 amp;

30Vdc or 230Vac

Normally closed contact, 7 amp;

30Vdc or 230Vac

4 RELAY ONLY: Two relays at P18

Normally open contact, 1 amp;

24Vdc or 30Vac

Normally closed contact, 1 amp;

24Vdc or 30Vac

TURNDOWN RATIO

(MAX OFFSET-MIN SPAN): 1000 with 0.1% or 100 with 0.01% resolution

COMMUNICATIONS INFORMATION

RS-232

COMMUNICATIONS: RJ11 4-wire connection; complete program

setup and message display capability; programmable to transmit current display,

alarm status, MIN/MAX, and status

BAUD RATES: 300, 600, 1200, 2400, 4800, 9600, 19200

RS-485 RJ12 6-wire connection; addressable from

COMMUNICATIONS: "000" to "199".

BAUD RATES: 300, 1200, 2400, 4800, 9600, 19200

POWER

AC VOLTAGES: 115/230 Vac ±10%

AC FREQUENCY: 50/60 Hz
CONSUMPTION: 12 watts, max

EXTERNAL FUSE PROTECTION RECOMMENDED:

115Vac IEC127-2/III, 125mA, 250V (Time-Leg)

or UL Slow-Blow, 125mA, 250V

230Vac IEC127-2/III, 63mA, 250V (Time-Leg)

or UL Slow-Blow, 63mA, 250V

Specifications

ENVIRONMENTAL

OPERATING TEMP RANGE: 0 to 50 °C (32 to 140°F) STORAGE TEMP RANGE: -40 to 85 °C (-40 to 202°F)

HUMIDITY: up to 95% non-condensing at 40°C (104°F)

FRONT PANEL: NEMA-4 rated

MECHANICAL

DIMENSIONS (H x W x D): 1.89 x 3.78 x 5.86in. (48 x 96 x 145mm) PANEL CUTOUT (H x W): 1/8 DIN 1.772 X 3.622in. (45 x 92mm)

WEIGHT: 1.316 pounds (600 g)

MATERIAL: 94V-0 UL-rated Polycarbonate

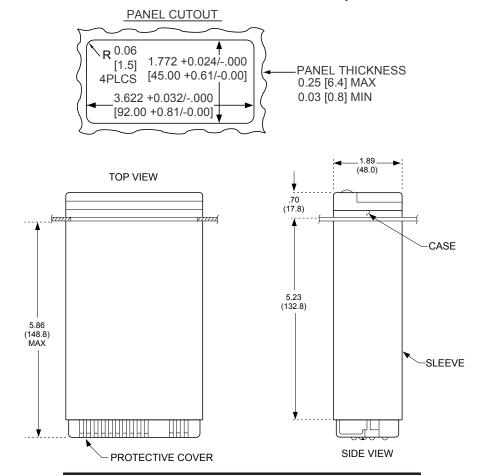


Figure 18-1. Meter Housing and Panel Cutout.

FLASHING MESSAGES

DURING PROGRAMMING (configuration mode)

NUMERICAL OVERFLOW: "999999"

OFFSET OVERFLOW: "ERR 01"

SETPOINT OVERFLOW: "ERR 02"

NOT STORED IN EEPROM: "NOSTOR"

VALUE PUT IN EEPROM: "STORED"

DURING MEASUREMENT (RUN MODE)

INPUT TOO LARGE, POSITIVE: "+ OVLD"
INPUT TOO LARGE, NEGATIVE: "- OVLD"
INPUT OUT OF RANGE, POSITIVE: "+ OPEN"
INPUT OUT OF RANGE, NEGATIVE: "- OPEN"
EXCESS INPUT SCALE/OFFSET: "I OVSC"
EXCESS DISPLAY SCALE/OFFSET: "R OVSC"
COUNT-BY DISPLAY OVERFLOW: "999999"

DURING SETPOINT ADJUST (RUN MODE)

OUT OF SELECTED DIGIT RANGE: "999999"

NOT STORED IN EEPROM: "NOSTOR"

VALUE PUT IN EEPROM: "STORED"

Factory Preset Values

JUMPER POSITIONS:

Current

S1: NONE S2: A, F, M, N, T, U

S3: A, C S4: NONE

LOCKOUT CONFIGURATION(S)

L1 CNF	L2 CNF	L3 CNF	L4 CNF
L1C.1=0	L2C.1=0	L3C.1=0	L4C.1=0
L1C.2=0	L2C.2=0	L3C.2=0	L4C.2=0
L1C.3=0	L2C.3=0	L3C.3=0	L4C.3=0
L1C.4=0	L2C.4=0	L3C.4=0	L4C.4=0
L1C.5=0	L2C.5=0	L3C.5=0	L4C.5=0
L1C.6=0	L2C.6=0	L3C.6=0	L4C.6=1
L1C.7=0	L2C.7=0	L3C.7=0	
L1C.8=0	L2C.8=0	L3C.8=0	

Input Class: Current: "CURRNT"

Input Type: 4-20 mA

Reading Configuration "RDG.CNF":

RDG.1=0 RDG.2=0 RDG.3=0 RDG.4=0

RDG.5=0 RDG.6=0 RDG.7=0

Reading Scale

("RDG SC"): 1.00000

Reading Offset

(RDG OF"): -00000

Input Configuration "IN CNF":

INP.1=0 INP.2=0 INP.3=0 INP.4=0

INP.5=0 INP.6=0 INP.7=0

Input Scale and Offset "IN.SC.OF":

INPUT 1: 000000. READ 1: 000000. INPUT 2: 100000. READ 2: 100000.

Decimal Point "DEC PT" Position: FFFFFF.

Count By "CNT BY": 001

Filter Configuration "FIL.CNF": FIL.1=0 FIL.2=1 FIL.3=1

Filter Time Constant "FIL TI": 064

Setpoint Configuration "SP CNF":

 SPC.1=0
 SPC.2=0
 SPC.3=1
 SPC.4=0

 SPC.5=0
 SPC.6=1
 SPC.7=0
 SPC.8=0

Alarm Configuration "AL CNF":

ALC.1=0 ALC.2=0 ALC.3=1 ALC.4=0 ALC.5=0 ALC.6=1 ALC.7=0 ALC.8=0

Alarm Function "AL FNC":

ALF.1=0 ALF.2=0 ALF.3=0 ALF.4=0

Alarm Number of Readings "AL RDG": 03 03 for (AL1) (AL2)

Setpoints 1 & 2 Deadband "SP DB": 0020 Alarms 1 & 2 Deadband "AL DB": 0020

Output Configuration "OUT.CNF":

OUT.1=0 OUT.2=1 OUT.3=0 OUT.4=0

OUT.5=1 OUT.6=0

Output Scale and Offset "OT.SC.OF":

READ 1: 000000. OUTPT 1: 04.0000 READ 2: 100000. OUTPT 2: 20.0000

Baud Rate "BAUD": 09600

Serial Communication Configuration "SERCNF":

SER.1=1 SER.2=0

Address "ADDRES" (for RS-485): 001

19

Factory Preset Values

Data Format "DAT FT":

DAT.1=0 DAT.2=0 DAT.3=1 DAT.4=0 DAT.5=0 DAT.6=0 DAT.7=0 DAT.8=0

Bus Format "BUS FT":

BUS.1=0 BUS.2=0 BUS.3=1 BUS.4=0 BUS.5=1 BUS.6=0 BUS.7=0 BUS.8=1

Serial Count "SERCNT": 00001

ANALOG OUTPUT

CAL VZ:

CAL VS:

CAL mAZ: CAL mAS:

Record your Setup Values

s 20/

JUMPER POSITIONS:

Current

S1: _____ S2: ____

S3: _____ S4: Not used

Voltage

S1: _____ S2: ____

S3: _____ S4: Not used

Potentiometer

S1: _____ S2: ____

S3: _____ S4: Not used

LOCKOUT CONFIGURATION(S)

L1 CNF	L2 CNF	L3 CNF	L4 CNF
L1C.1=	_ L2C.1=	L3C.1=	L4C.1=
L1C.2=	_ L2C.2=	L3C.2=	L4C.2=
L1C.3=	_ L2C.3=	L3C.3=	L4C.3=
L1C.4=	_ L2C.4=	L3C.4=	L4C.4=
L1C.5=	_ L2C.5=	L3C.5=	L4C.5=
L1C.6=	_ L2C.6=	L3C.6=	L4C.6=
L1C.7=	_ L2C.7=	L3C.7=	L4C.7=
L1C.8=	_ L2C.8=	L3C.8=	

Input Class: "CURRNT": _____ (check one) "VOLT": _____

"POT":

Input Type: For Current: _____

For Volt: _____

Reading Configuration "RDG.CNF":

RDG.1=__ RDG.2=__ RDG.3=__ RDG.4=__ RDG.5=__

Reading Scale and Reading Offset "RDG SC" and "RDG OF" (Direct Format):

Reading Scale "RDG SC": _______
Reading Offset "RDG OF":



Record your Setup Values

•	ale & Offset					
(2-coordina	,					
	INPUT 1=		READ 1=			
	INPUT 2=		READ 2=			
Input Config	guration "IN CNF	=":				
			INP.3=	INP.4=		
	INP.5=	INP.2= INP.6=	INP.7=			
Input Coolo	and Offsat "IN S	CO OE":				
Input Scale	and Offset "IN.S		DEAD 1.			
	INPUT 2:		READ 2:			
			NE/18 2.			
Decimal Po	int "DEC PT" Po	osition: FFl	FFF			
	ONT BY":					
		IF": FIL.1= FIL	2= FIL.3=			
Filter Time	Constant "FIL TI	":				
Setpoint Co	onfiguration "SP	CNF"·				
ootpoint oo	_	C.2= SPC.3=_	SPC.4=			
		C.6= SPC.7=_				
Alarm Conf	iguration "AL CN					
		.2= ALC.3=				
	ALC.5=ALC	.6=ALC.7=	ALC.8=			
Alarm Func	tion "AL FNC":					
	ALF.1= ALF.2	2= ALF.3= A	LF.4=			
Alarm Num	har of Dandings	"AL RDG":				
	eadband "SP D					
	2 Deadband "Al					
	/ 11					
Output Configuration "OUT.CNF":						
	OUT.1=		OUT.3=	OUT.4=		
	OUT.5=	OUT.6=	OUT.7=	OUT.8=		

Record your Setup Values 20

Output Sca	ale and Offset "0 READ 1: READ 2:		OUTPT 1: OUTPT 2:	
Baud Rate	"BAUD":			
Serial Com	nmunication Co	nfiguration "SER SER.2=	CNF":	
Address "A	ADDRES" (for R	S-485):		
Data Form	at "DAT FT":			
			DAT.3= DAT.7=	
Bus Forma	at "BUS FT":			
			BUS.3= BUS.7=	
Serial Cou	nt "SERCNT": _			
ANALOG	OUTPUT			
CAL VZ:				
CAL VS:				
CAL mAZ:				
CAL mAS:				

Warranty/Disclaimer

NEWPORT Electronics, Inc. warrants this unit to be free of defects in materials and workmanship for a period of one (1) year from the date of purchase. In addition to NEWPORT's standard warranty period, NEWPORT Electronics will extend the warranty period for one (1) additional year if the warranty card enclosed with each instrument is returned to NEWPORT.

If the unit should malfunction, it must be returned to the factory for evaluation. NEWPORT's Customer Service Department will issue an Authorized Return (AR) number immediately upon phone or written request. Upon examination by NEWPORT, if the unit is found to be defective it will be repaired or replaced at no charge. NEWPORT's WARRANTY does not apply to defects resulting from any action of the purchaser, including but not limited to mishandling, improper interfacing, operation outside of design limits, improper repair, or unauthorized modification. This WARRANTY is VOID if the unit shows evidence of having been tampered with or shows evidence of being damaged as a result of excessive corrosion; or current, heat, moisture or vibration; improper specification; misuse or other operating conditions outside of NEWPORT's control. Components which wear are not warranted, including but not limited to contact points, fuses, and triacs.

NEWPORT is pleased to offer suggestions on the use of its various products. However, NEWPORT neither assumes responsibility for any omissions or errors nor assumes liability for any damages that result from the use of its products in accordance with information provided by NEWPORT, either verbal or written. NEWPORT warrants only that the parts manufactured by it will be as specified and free of defects. NEWPORT MAKES NO OTHER WARRANTIES OR REPRESENTATIONS OF ANY KIND WHATSOEVER, EXPRESSED OR IMPLIED, EXCEPT THAT OF TITLE, AND ALL IMPLIED WARRANTIES INCLUDING ANY WARRANTY OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE ARE HEREBY DISCLAIMED. LIMITATION OF LIABILITY: The remedies of purchaser set forth herein are exclusive and the total liability of NEWPORT with respect to this order, whether based on contract, warranty, negligence, indemnification, strict liability or otherwise, shall not exceed the purchase price of the component upon which liability is based. In no event shall NEWPORT be liable for consequential, incidental or special damages.

CONDITIONS: Equipment sold by NEWPORT is not intended to be used, nor shall it be used: (1) as a "Basic Component" under 10 CFR 21 (NRC), used in or with any nuclear installation or activity; or (2) in medical applications or used on humans. Should any Product(s) be used in or with any nuclear installation or activity, medical application, or used on humans, or misused in any way, NEWPORT assumes no responsibility as set forth in our basic WARRANTY / DISCLAIMER language, and additionally purchaser will indemnify NEWPORT and hold NEWPORT harmless from any liability or damage whatsoever arising out of the use of the Product(s) in such a manner.

Return Requests/Inquiries

Direct all warranty and repair requests/inquiries to the NEWPORT Customer Service Department. BEFORE RETURNING ANY PRODUCT(S) TO NEWPORT, PURCHASER MUST OBTAIN AN AUTHORIZED RETURN (AR) NUMBER FROM NEWPORT'S CUSTOMER SERVICE DEPARTMENT (IN ORDER TO AVOID PROCESSING DELAYS). The assigned AR number should then be marked on the outside of the return package and on any correspondence.

The purchaser is responsible for shipping charges, freight, insurance and proper packaging to prevent breakage in transit.

FOR <u>WARRANTY</u> RETURNS, please have the following information available BEFORE contacting NEWPORT:

- P.O. number under which the product was PURCHASED,
- Model and serial number of the product under warranty, and
- Repair instructions and/or specific problems relative to the product.

FOR **NON-WARRANTY** REPAIRS, consult NEWPORT for current repair charges. Have the following information available BEFORE contacting NEWPORT:

- P.O. number to cover the COST of the repair,
- 2. Model and serial number of product, and
- Repair instructions and/or specific problems relative to the product.

NEWPORT's policy is to make running changes, not model changes, whenever an improvement is possible. This affords our customers the latest in technology and engineering.

NEWPORT is a registered trademark of NEWPORT ELECTRONICS, INC.

© Copyright 1999 NEWPORT ELECTRONICS, INC. All rights reserved. This document may not be copied, photocopied, reproduced, translated, or reduced to any electronic medium or machine-readable form, in whole or in part, without prior written consent of NEWPORT ELECTRONICS, INC.

For immediate technical or application assistance please call:

1-800-6397678° **1-800-NEWPOR**T

Newport Electronics, Inc.

2229 South Yale Street • Santa Ana, CA • 92704-4426 • U.S.A.

TEL: (714) 540-4914 • FAX: (714) 546-3022

Toll Free: 1-800-639-7678 • http://www.newportUS.com • e-mail: info@newportUS.com

ISO 9001 Certified

Newport Technologies, Inc.

976 Bergar • Laval (Quebec) • H7L 5A1 • Canada

TEL: (514) 335-3183 • FAX: (514) 856-6886

Toll Free: 1-800-639-7678 • http://www.newport.ca • e-mail: sales@newport.ca

Newport Electronics, Ltd.

One Omega Drive • River Bend Technology Centre Northbank, Irlam. • Manchester, M44 5EX, England

Tel: +44 161 777-6611 • FAX: +44 161 777-6622

Toll Free: 0800 488 488 • http://www.newportUK.co.uk • e-mail: sales@newportUK.co.uk

Newport Electronics B.V.

Postbus 8034 • 1180 LA Amstelveen • The Netherlands

TEL: +31 (0)20 6418405 • FAX: +31 (0)20 6434643

Toll Free: 0 800 0993344 • http://www.omega.com • e-mail: nl@omega.com

Newport Electronics spol s.r.o.

Rudé armády 1868, 733 01 Karvina 8 • Czech Republic

TEL: +420 (0)69 6311899 • FAX: +420 (0)69 6311114

Toll Free: 0800-1-666432 • http://www.newport.cz • e-mail: sales@newport.cz

Newport Electronics GmbH

Daimlerstrasse 26 • D-75392 Deckenpfronn • Germany

TEL: +49 (0)7056 9398-0 • FAX: +49 (0)7056 9398-29

Toll Free: 0130 / 112166 • http://www.newport.de • e-mail: sales@newport.de

Newport Electronique S.A.R.L.

9. rue Denis Papin • 78190 Trappes • France

TEL: +33 (0)130 621 400 • FAX: +33 (0)130 699 120

Toll Free: 0800-4-06342 • http://www.newport.fr • e-mail: sales@newport.fr

Mexico and Latin America

TEL: 001-800-826-6342 • FAX: 001 (203) 359-7807

En Español: 001 (203) 359-7803

NEWPORTnetsM On-Line Service http://www.newportUS.com

Internet e-mail

info@newportUS.com



M1297/N/0899 10997ML-03 Rev. C